

Well Name: JAMES RANCH UNIT	Well Location: T23S / R31E / SEC 6 / NENW /	County or Parish/State: EDDY / NM
Well Number: 73	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMNM02887D	Unit or CA Name: CONSL DWRM FMN PA ABC	Unit or CA Number: NMNM70965K
US Well Number: 3001528979	Well Status: Producing Oil Well	Operator: XTO PERMIAN OPERATING LLC

Accepted for record –NMOCD gc9/29/2023

Notice of Intent

LONG VO

Digitally signed by
LONG VO
Date: 2023.09.09
10:03:04 -05'00'

Sundry ID: 2747640

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 08/23/2023

Time Sundry Submitted: 11:59

Date proposed operation will begin: 09/23/2023

Procedure Description:

- 1) Unset TAC at 7440.9'. POOH tbg.
- 2) MIRU WLU, RIH GR to 11,150'. RIH set CIBP at 11,150'; spot 25 SKS Class H cement from 11,150' to 10,939'. WOC and tag to verify TOC. (T/ Wolfcamp, T/ Wolfcamp Perfs)
- 3) RIH set CIBP at 10,500'; dump bail 35' Class H cement from 10,500' to 10,465'. WOC and tag to verify TOC.(T/Bone Spring Perfs)
- 4) Spot 25 SKS Class H cement from 7800' to 7597'. WOC and tag to verify TOC. (T/Bone Spring)
- 5) RIH set CIBP at 7470', pressure test to 500 PSI for 30 minutes; spot 25 SKS Class C cement from 7470' to 7218'. WOC and tag to verify TOC. (T/ Delaware Perfs)
- 6) Spot 25 SKS Class C cement from 5700' to 5448'. (3000' Requirement)
- 7) Spot 83 SKS Class C cement from 3965' to 3130'. WOC and tag to verify TOC. (T/Delaware, Intermediate Casing Shoe)
- 8) Circulate 1.5x total casing volume (~110 barrels) fresh water from 3130' to surface. TOO H with tubing.
- 9) MIRU WLU, perforate at 3120'.
- 10) Establish circulation from surface (down casing and up annulus)
- 11) From surface (down casing) Squeeze and circulate 780 SKS Class C cement from 3120' to surface'. (B/Salt, T/Salt, Surface Casing shoe)
- 12) ND BOP and cut off wellhead 5' below surface. RDMO PU, transport trucks, and pump truck.
- 13) Set P&A marker.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

JRU_073_Proposed_WBD_20230823115944.pdf

DHWP_JRU_073_20230823115931.pdf

Well Name: JAMES RANCH UNIT

Well Location: T23S / R31E / SEC 6 /
NENW /County or Parish/State: EDDY /
NM

Well Number: 73

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM02887D

Unit or CA Name: CONSL DWRM FMN
PA ABCUnit or CA Number:
NMNM70965K

US Well Number: 3001528979

Well Status: Producing Oil Well

Operator: XTO PERMIAN
OPERATING LLC**Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: AMANDA THAMES

Signed on: AUG 23, 2023 11:59 AM

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 HOLIDAY HILL ROAD BLDG 5

City: MIDLAND

State: TX

Phone: (432) 221-7340

Email address: AMANDA.THAMES@EXXONMOBIL.COM

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

JRU 073 - Proposed WBD

562' Surface Casing Shoe

580' T/Salt

3125' TOC

3824' Intermediate Casing Shoe

3915' T/Delaware


7530' T/ Delaware Perfs

7748' T/Bone Spring

10,556' T/Bone Spring Perfs

11100' T/Wolfcamp

11166' T/ Wolfcamp Perfs

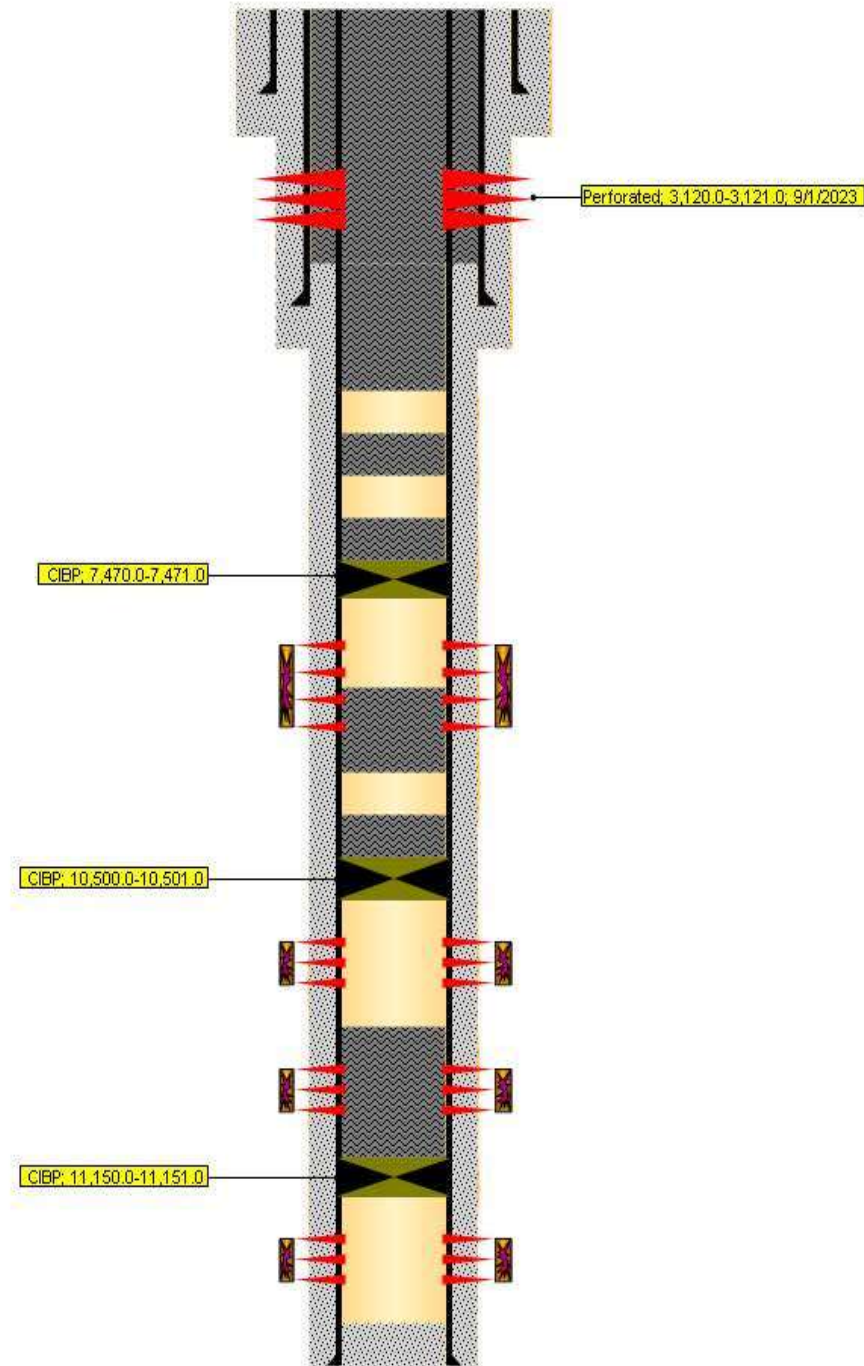

Perf and squeeze 780 SKS Class C: 3130' to surface'.

Spot 83 SKS Class C: 3965' to 3130'. WOC and Tag.

Spot 25 SKS Class C: 5700' to 5448'.

Spot 25 SKS Class C atop CIBP: 7470' to 7218'. PT CIBP to 500 PSIG for 30 min. WOC and Tag.

Spot 25 SKS **Class H**: 7800' to 7597'. WOC and Tag.


Dump bail 35' **Class H** atop CIBP: 10,500' to 10,465'. WOC and Tag.

Spot 25 SKS **Class H** atop CIBP: 11,150' to 10,939'. WOC and Tag.

Downhole Well Profile - with Schematic

Well Name: James Ranch Unit 073

API/UWI 3001528979	SAP Cost Center ID 1137032001	Permit Number	State/Province New Mexico	County Eddy	Ground Elevation (ft) 3,298.00	KB-Ground Distance (ft) 13.00	Surface Casing Flange Elevatio...
Surface Location T23S-R31E-S06	Spud Date 6/29/1996 20:00	Original KB Elevation (ft) 3,311.00					

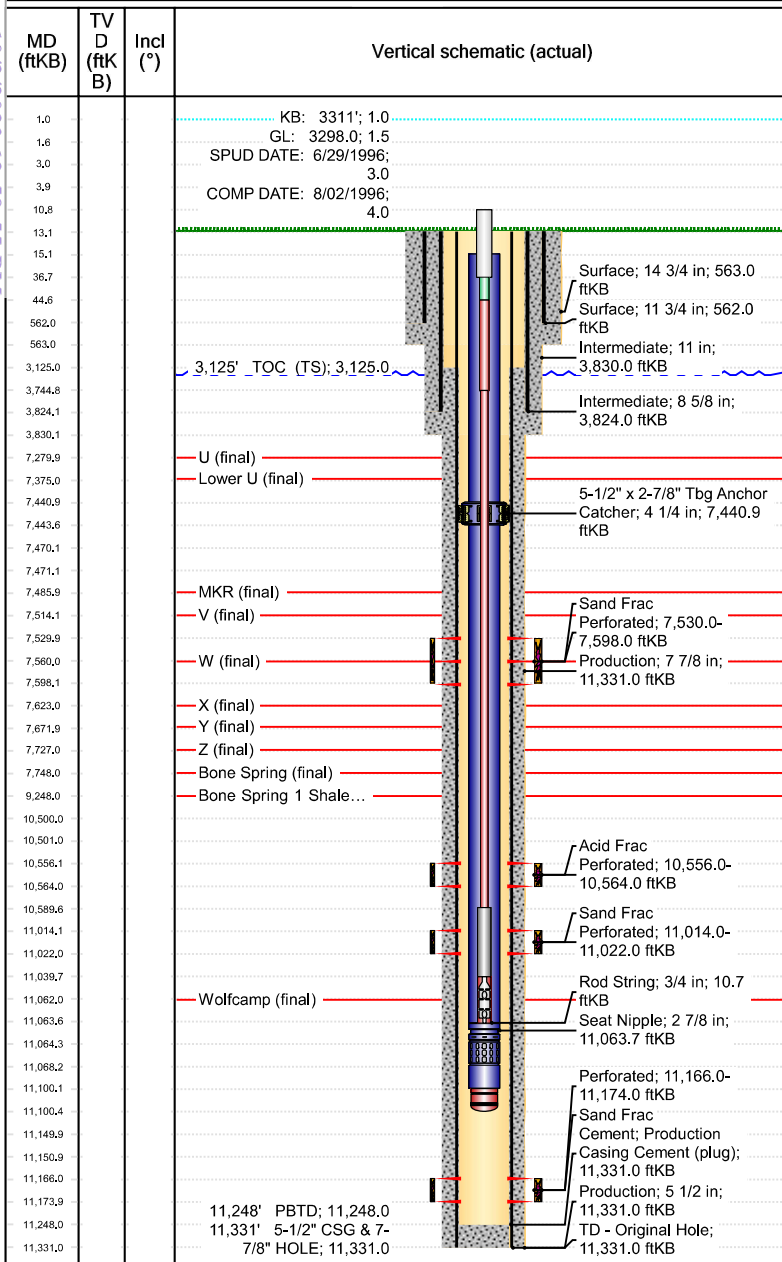

Wellbores					
Wellbore Name Original Hole		Parent Wellbore		Wellbore API/UWI	
Start Depth (ftKB)			Profile Type		
Section Des	Hole Sz (in)	Act Top (ftKB)	Act Btm (ftKB)		
Surface	14 3/4	13.0	563.0		
Intermediate	11	563.0	3,830.0		
Production	7 7/8	3,830.0	11,331.0		
Zones					
Zone Name	Top (ftKB)	Btm (ftKB)	Current Status		
Bone Spring					
Delaware					
Wolfcamp					
Del/BS/Wlf					
3rd Bone Spring	15.2				
Casing Strings					
Csg Des	Set Depth (ftKB)	OD (in)	Wt/Len (lb/ft)	Grade	
Surface	562.0	11 3/4	42.00	H40	
Intermediate	3,824.0	8 5/8	32.00	J55	
Production	11,331.0	5 1/2	17.00	J55	
Cement					
Des	Type	Start Date	Top (ftKB)	Btm (ftKB)	
Surface Casing Cement	Casing	6/30/1996	13.0	562.0	
Intermediate Casing Cement	Casing	7/5/1996	13.0	3,824.0	
Production Casing Cement	Casing	7/16/1996	3,125.0	11,331.0	
Perforations					
Date	Top (ftKB)	Btm (ftKB)	Linked Zone		
12/7/1996	7,530.0	7,598.0			
11/22/1996	10,556.0	10,564.0			
9/18/1996	11,014.0	11,022.0			
7/31/1996	11,166.0	11,174.0			
Stimulation Intervals					
Interval Number	Top (ftKB)	Btm (ftKB)	AIR (bbl/min)	MIR (bbl/min)	Proppant Total (lb)
1	11,166.0	11,174.0			0.0
1	10,556.0	10,564.0			0.0
2	11,014.0	11,022.0			0.0
3	7,530.0	7,598.0			0.0

**BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972**

**Permanent Abandonment of Federal Wells
Conditions of Approval (LPC Habitat)**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines **(Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure)**. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. **This will apply to well pads, facilities, and access roads.** Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Petroleum Engineering Tech/Environmental Protection Specialist
575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias
Environmental Protection Specialist
575-234-6230

Crisha Morgan
Environmental Protection Specialist
575-234-5987

Jose Martinez-Colon
Environmental Protection Specialist
575-234-5951

Mark Mattozzi
Environmental Protection Specialist
575-234-5713

Robert Duenas
Environmental Protection Specialist
575-234-2229

Doris Lauger Martinez
Environmental Protection Specialist
575-234-5926

Jaden Johnston
Environmental Protection Asst. (Intern)
575-234-6252

Sundry ID

2747640

Plug Type	Top	Bottom	Length	Tag	Sacks	Cement Class	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
Fresh Water @ 360	306.40	410.00	103.60	If solid			
Shoe Plug	507.37	613.00	105.63	Tag/Verify			
Top of Salt @ 594	538.06	644.00	105.94	Tag/Verify			
Base of Salt @ 3687	3600.13	3737.00	136.87	Tag/Verify	730.00	C	Perforate and squeeze from 3130' to surface. (In 310 sxs/Out 420 sxs) Verify at surface.
Shoe Plug	3736.75	3875.00	138.25	Tag/Verify			
Delaware @ 3915	3825.85	3965.00	139.15	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	83.00	C	Spot cement from 3965' to 3130'.
Spacer Plug @ 5650	5543.50	5700.00	156.50	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	25.00	C	Spot cement from 5700' to 5543'.

				If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations			
CIBP Plug	7435.00	7470.00	35.00	ns	25.00	C	Set CIBP at 7470'. Spot 25 sxs on top. Leak test CIBP.
Perforations Plug (If No CIBP)	7472.02	7648.00	175.98	Tag/Verify			
Bonesprings @ 7748	7620.52	7798.00	177.48	If solid			
Perforations Plug (If No CIBP)	10408.36	10614.00	205.64	Tag/Verify			
				If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations			
CIBP Plug	10465.00	10500.00	35.00	ns	5.00	H	Set CIBP at 10500'. Dump bail 35'. WOC and Tag.
Perforations Plug (If No CIBP)	10861.78	11072.00	210.22	Tag/Verify			

				If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations			
Wolfcamp @ 11100	10939.00	11150.00	211.00	ns			
Perforations Plug (If No CIBP)	11012.26	11224.00	211.74	Tag/Verify			
				If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations			
CIBP Plug	11115.00	11150.00	35.00	ns	26.00	H	Set CIBP at 11150'. Spot cement from 11150' to 10939'. WOC and Tag.
Shoe Plug	11167.69	11381.00	213.31	Tag/Verify			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C <7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater

R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft³/sx

Class H: 1.06 ft³/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement R111-P 50 Feet from Base of Salt to surface

Shoe @ 563.00
Shoe @ 3825.00

Shoe @ 11331.00 TOC @ 3125.00

Perforatons Top @	7530.00	Perforations	7598.00
Perforatons Top @	10556.00	Perforations	10564.00
Perforatons Top @	11014.00	Perforations	11022.00
Perforatons Top @	11166.00	Perforations	11174.00

CIBP @	11150.00
CIBP @	7470.00
CIBP @	10500.00

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 263592

CONDITIONS

Operator: XTO PERMIAN OPERATING LLC. 6401 HOLIDAY HILL ROAD MIDLAND, TX 79707	OGRID: 373075
	Action Number: 263592
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	9/29/2023