Office	State of New N	I exico	Form C-103 ¹ of 9
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Na	tural Resources	Revised July 18, 2013 WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATIO	N DIVISION	30-025-33849
<u>District III</u> – (505) 334-6178	1220 South St. Fr	ancis Dr.	5. Indicate Type of Lease STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa Fe, NM	87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505			330369
	TICES AND REPORTS ON WELL OSALS TO DRILL OR TO DEEPEN OR P		7. Lease Name or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPL	ICATION FOR PERMIT" (FORM C-101)		Estacado 27 State
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well 🗸 Other		8. Well Number 1
2. Name of Operator J R Oil Ltd. Co			9. OGRID Number 256073
3. Address of Operator			10. Pool name or Wildcat
PO Box 2975 Hobbs, NM 88	241		HIGH PLAINS; PERMO UPPER PENN
4. Well Location Unit Letter K	1650 feet from the South	line and 212	25feet from the Westline
Section 27		nne and Range 34E	reet from the vest line NMPM County Lea
Section 21	11. Elevation (Show whether D		•
	4103 GL		
12. Check	Appropriate Box to Indicate	Nature of Notice.	Report or Other Data
	••		•
NOTICE OF II PERFORM REMEDIAL WORK □	NTENTION TO: PLUG AND ABANDON ☑	REMEDIAL WOR	SEQUENT REPORT OF: K
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DR	—
PULL OR ALTER CASING	-	CASING/CEMEN	
DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM			otify OCD 24 hrs. prior to any work
OTHER:		OTHER:	one
			d give pertinent dates, including estimated date
proposed completion or re		_	mpletions: Attach wellbore diagram of
1. MIRU plugging service	_	needed	d MUST Tag TD @ 10400' or higher - Add cmt as
2. Lay down rods & tbg, handle 3. Set CIBP above pkr @ 10,312	rods with care to avoid banging	, send to inspection	1
	2		
4. RIH work string and spot 25 s	x Class H cement on top of plug	g, WOC, tag Test o	easing 500psi/30 min - Bubble test
4. RIH work string and spot 25 sa. All cement plugs shall be nea5. Circulate MLF	ex Class H cement on top of plug t Class H or C unless approved	by NMOCD	casing 500psi/30 min - Bubble test
4. RIH work string and spot 25 sa. All cement plugs shall be nea5. Circulate MLF6. MIRU Renegade wireline and	ex Class H cement on top of plug t Class H or C unless approved perform CBL from plug back to	by NMOCD surface	easing 500psi/30 min - Bubble test
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,7478, squeeze 50	t Class H cement on top of plug t Class H or C unless approved perform CBL from plug back to sx Class H, WOC, tag Perf 97 sx Class H, WOC, tag Perf 8	by NMOCĎ surface 700'	casing 500psi/30 min - Bubble test
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,7478, squeeze 50 9. Perforate 6,233, squeeze 50	t Class H cement on top of plug t Class H or C unless approved perform CBL from plug back to sx Class H, WOC, tag Perf 97 sx Class H, WOC, tag Perf 80 sx Class C, WOC, tag	by NMOCD surface 700' 168'	casing 500psi/30 min - Bubble test
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,7478, squeeze 50 9. Perforate 6,233, squeeze 50 10. Perforate 1,853, squeeze 51 11. Perforate 1,853, squeeze 5	cx Class H cement on top of plug t Class H or C unless approved perform CBL from plug back to sx Class H, WOC, tag Perf 97 sx Class H, WOC, tag Perf 80 sx Class C, WOC, tag Perf 40 50 sx Class C, WOC, tag Perf 40 50 sx Class C, WOC, tag Perf 40 50 sx Class C, WOC, tag Perf 40	by NMOCD surface 700' 168' 1495' 1905'	easing 500psi/30 min - Bubble test
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,540%, squeeze 50 9. Perforate 6,233', squeeze 50 10. Perforate 4,3445', squeeze 51. Perforate 1,858', squeeze 51. Perforate 493' and circulate 13. Cut off well head 3' beneath	ex Class H cement on top of plug t Class H or C unless approved perform CBL from plug back to sx Class H, WOC, tag Perf 97 sx Class H, WOC, tag Perf 80 sx Class C, WOC, tag Perf 40 sx Class	by NMOCD surface 700' 168' 1495' 1905' face arker, and back fill.	
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,7478, squeeze 50 9. Perforate 6,233, squeeze 50 10. Perforate 1,853, squeeze 51 11. Perforate 1,853, squeeze 5	ex Class H cement on top of plug t Class H or C unless approved perform CBL from plug back to sx Class H, WOC, tag Perf 97 sx Class H, WOC, tag Perf 80 sx Class C, WOC, tag Perf 40 sx Class	by NMOCD surface 700' 168' 1495' 1905' face arker, and back fill.	
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,546%, squeeze 50 9. Perforate 6,233°, squeeze 50 10. Perforate 4,4445°, squeeze 51. Perforate 1,858°, squeeze 512. Perforate 493° and circulate 13. Cut off well head 3' beneath	ex Class H cement on top of plug t Class H or C unless approved perform CBL from plug back to sx Class H, WOC, tag Perf 97 sx Class H, WOC, tag Perf 80 sx Class C, WOC, tag Perf 40 sx Class	by NMOCD surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo	
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650%, squeeze 50 8. Perforate 8,5448°, squeeze 50 9. Perforate 6,233°, squeeze 50 10. Perforate 4,3445°, squeeze 50 11. Perforate 1,853°, squeeze 512. Perforate 493° and circulate 13. Cut off well head 3° beneath 14. Remove all underground pip Spud Date: 03/06/1997	perform CBL from plug back to sx Class H, WOC, tag sx Class H, WOC, tag sx Class H, WOC, tag sx Class C, WOC, tag so Sx Class	by NMOCD surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo	ocation per SLO.
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650%, squeeze 50 8. Perforate 8,5448°, squeeze 50 9. Perforate 6,233°, squeeze 50 10. Perforate 4,3445°, squeeze 50 11. Perforate 1,853°, squeeze 512. Perforate 493° and circulate 13. Cut off well head 3° beneath 14. Remove all underground pip Spud Date: 03/06/1997	perform CBL from plug back to sx Class H, WOC, tag sx Class H, WOC, tag sx Class H, WOC, tag sx Class C, WOC, tag sx Class C, WOC, tag so Sx Class C,	by NMOCD surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo	ocation per SLO. DBY 10/1/24
4. RIH work string and spot 25 s a. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,5448, squeeze 50 9. Perforate 6,233, squeeze 50 10. Perforate 4,3445, squeeze 51 11. Perforate 1,853, squeeze 51 12. Perforate 493, and circulate 13. Cut off well head 3, beneath 14. Remove all underground pip Spud Date: 03/06/1997 ***SEE ATTAC I hereby certify that the information	perform CBL from plug back to sx Class H, WOC, tag sx Class H, WOC, tag sx Class C, WOC, tag sx Class C, WOC, tag sx Class C, WOC, tag so Sx Class C, WOC, tag sx Class C, WOC, tag sx Class C, WOC, tag sy Class C, WOC, tag so Sx Class C, WOC, tag sy C, WOC, t	by NMOCD surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo Date: MUST BE PLUGGED best of my knowledg	Decation per SLO. Decation per SLO.
4. RIH work string and spot 25 sa. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650%, squeeze 50 8. Perforate 8,54%, squeeze 50 9. Perforate 6,233′, squeeze 50 10. Perforate 1,853′, squeeze 51. Perforate 1,853′, squeeze 512. Perforate 493′ and circulate 13. Cut off well head 3′ beneath 14. Remove all underground pip Spud Date: O3/06/1997	perform CBL from plug back to sx Class H, WOC, tag sx Class H, WOC, tag sx Class C, WOC, tag so sx Class C, WOC, tag states C, WOC, tag sy Class C, WOC, tag states C, WOC, tag	by NMOCD o surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo Date: MUST BE PLUGGED best of my knowledgent	DEST 10/16/2023
4. RIH work string and spot 25 sa. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650%, squeeze 50 8. Perforate 8,54%, squeeze 50 9. Perforate 6,233°, squeeze 50 10. Perforate 4,34%, squeeze 50 11. Perforate 1,853°, squeeze 512. Perforate 493° and circulate 13. Cut off well head 3' beneath 14. Remove all underground pip Spud Date: 03/06/1997	perform CBL from plug back to sx Class H, WOC, tag sx Class H, WOC, tag sx Class C, WOC, tag so sx Class C, WOC, tag states C, WOC, tag sy Class C, WOC, tag states C, WOC, tag	by NMOCD o surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo Date: MUST BE PLUGGED best of my knowledgent	Decation per SLO. Decation per SLO.
4. RIH work string and spot 25 sa. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650%, squeeze 50 8. Perforate 8,523°, squeeze 50 9. Perforate 6,233°, squeeze 50 10. Perforate 1,853°, squeeze 51. Perforate 1,853°, squeeze 512. Perforate 493° and circulate 13. Cut off well head 3' beneath 14. Remove all underground pip Spud Date: 03/06/1997	perform CBL from plug back to sx Class H, WOC, tag sx Class H, WOC, tag sx Class C, WOC, tag so sx Class C, WOC, tag states C, WOC, tag sy Class C, WOC, tag states C, WOC, tag	by NMOCD o surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo Date: MUST BE PLUGGED best of my knowledgent	DEST 10/16/2023
4. RIH work string and spot 25 sa. All cement plugs shall be nea 5. Circulate MLF 6. MIRU Renegade wireline and 7. Perforate 9,650% squeeze 50 8. Perforate 8,5445°, squeeze 50 9. Perforate 6,233°, squeeze 50 10. Perforate 1,853°, squeeze 51. Perforate 1,853°, squeeze 512. Perforate 493° and circulate 13. Cut off well head 3° beneath 14. Remove all underground pip Spud Date: 03/06/1997	perform CBL from plug back to sx Class H, WOC, tag sx Class H, WOC, tag sx Class C, WOC, tag so sx Class C, WOC, tag states C, WOC, tag sy Class C, WOC, tag states C, WOC, tag	by NMOCD o surface 700' 168' 1495' 1905' ace arker, and back fill. emediate surface lo Date: MUST BE PLUGGED best of my knowledgent	DEV 10/1/24 The and belief. DATE 10/16/2023 DATE 575-691-6790

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD at 575-626-0830 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - 1) Glorieta
 - J) Yates.
 - K) Cherry Canyon Eddy County
 - L) Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 – Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S - R 31E


Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.


JR Oil Ltd.

Estacado 27 State #1

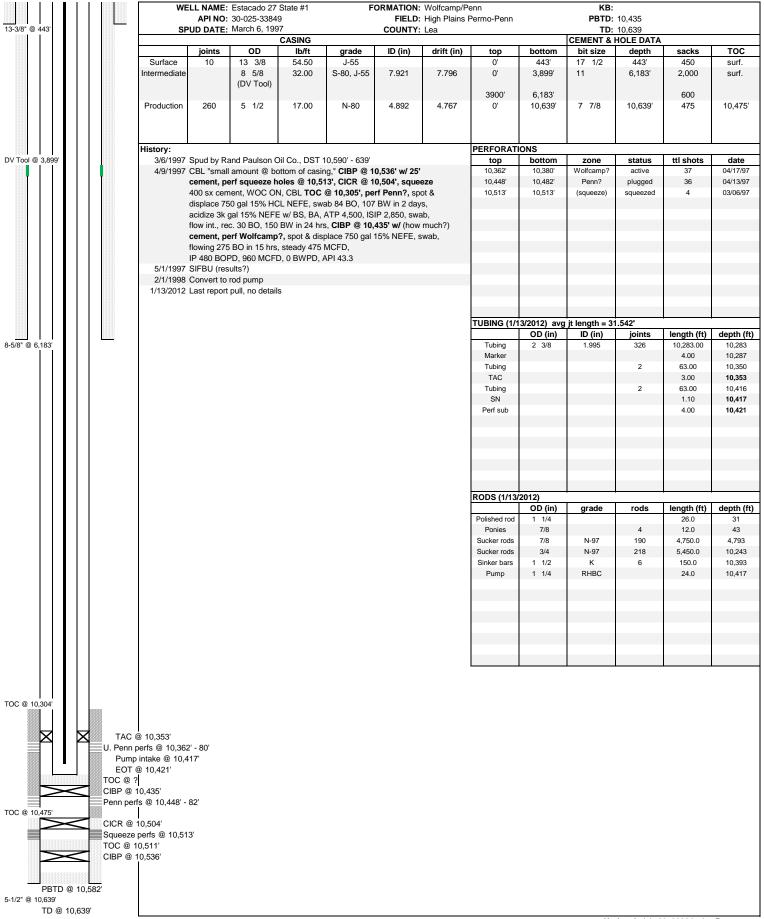

JR Oil Ltd.

Estacado 27 State #1 PROPOSED

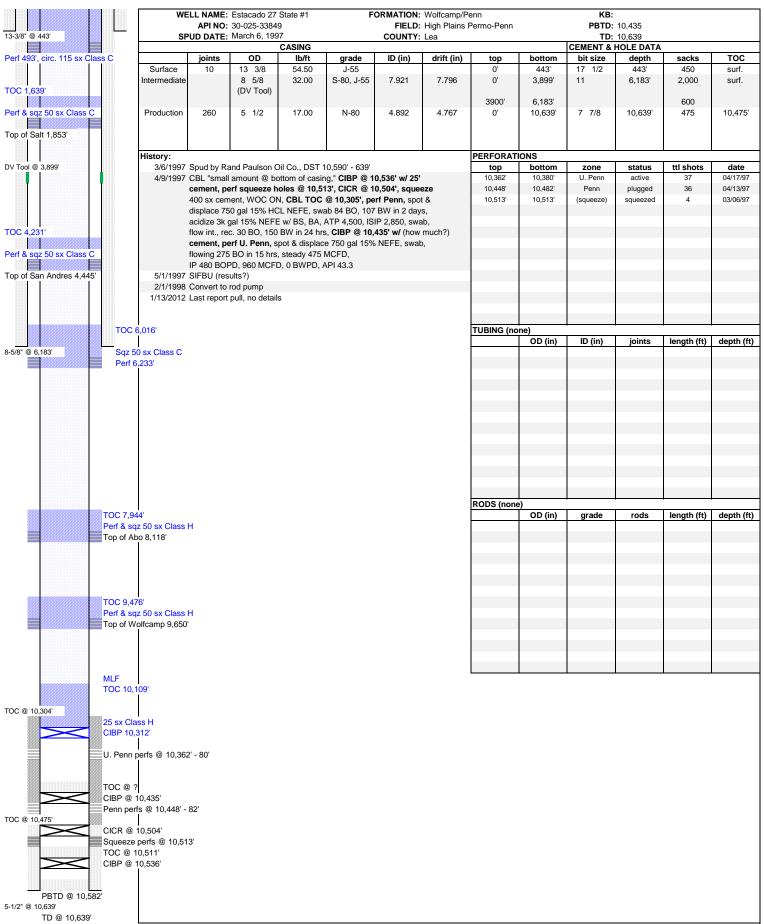

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 275936

COMMENTS

Operator:	OGRID:
J R OIL, LTD. CO.	256073
P.O. Box 52647	Action Number:
Tulsa, OK 74152	275936
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM.	10/20/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 275936

CONDITIONS

Operator:	OGRID:
J R OIL, LTD. CO.	256073
P.O. Box 52647	Action Number:
Tulsa, OK 74152	275936
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	10/20/2023