

Lease Number: NMNM0404441

Sundry Print Report

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Number: 21

Well Name: TODD 13G FEDERAL Well Location: T23S / R31E / SEC 13 / County or Parish/State: EDDY /

SWNE /

Type of Well: OIL WELL Allottee or Tribe Name:

Unit or CA Name:

US Well Number: 3001531514 Well Status: Oil Well Shut In Operator: HARVARD

PETROLEUM COMPANY LLC

Unit or CA Number:

Accepted for record -NMOCD gc11/2/2023

LONG VO

Digitally signed by LONG VO Date: 2023.06.21 09:36:55 -05'00'

Notice of Intent

Sundry ID: 2728522

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 05/01/2023 Time Sundry Submitted: 12:49

Date proposed operation will begin: 05/01/2023

Procedure Description: Harvard is planning on performing P&A procedure. Please see attachment.

Surface Disturbance

Is any additional surface disturbance proposed?: No

Approval Subject to

General Requirements and

Special Stipulations

Attached

NOI Attachments

Procedure Description

Todd_13G_Fed_21_PnA_Filing_20230501124900.pdf

eceived by OCD: 19/31/2023 3:39:35 PM Well Name: TODD 13G FEDERAL

Well Location: T23S / R31E / SEC 13 /

SWNE /

County or Parish/State: EDDY? of

Well Number: 21

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM0404441

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001531514

Well Status: Oil Well Shut In

Operator: HARVARD PETROLEUM COMPANY LLC

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: RONI KIDD Signed on: MAY 01, 2023 12:49 PM

Name: HARVARD PETROLEUM COMPANY LLC

Title: Business Manager

Street Address: PO BOX 936

City: ROSWELL State: NM

Phone: (575) 390-2069

Email address: RKIDD@HPCNM.COM

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

Page 2 of 2

Form 3160-5

UNITED STATES

	No. 1004-0137 Expires:
	December 31, 2024
~	

(June 2019)	DEPARTMENT OF THE INTE		December 31, 2024			
	BUREAU OF LAND MANAGE	5. Lease Serial No	NM0404441			
Do not use	RY NOTICES AND REPORTS this form for proposals to dr vell. Use Form 3160-3 (APD)	ill or to re-enter ar		ee or Tribe Name		
SUBI	IT INTRIPLICATE - Other instruction	s on page 2	7. If Unit of CA/A	greement, Name and/or No.		
1. Type of Well			9. Woll Name and	No		
✓ Oil Well	Gas Well Other		8. Well Name and	No. TODD 13 G Federal #21		
2. Name of Operator Harvard F	etroleum Company		9. API Well No. 30	0-015-31514		
^{3a.} Address PO Box 936, Ros	swell, NM 88202 3b. P	hone No. <i>(include area cod</i>) 623-1581	de) 10. Field and Pool Ingle Wells Del	or Exploratory Area		
4 Location of Well /Footage S	c., T.,R.,M., or Survey Description)	7023-1301	11. Country or Par			
1980 FNL & 1980 FEL Sect				Eddy, New Mexico		
1:	2. CHECK THE APPROPRIATE BOX(E	S) TO INDICATE NATUR	E OF NOTICE, REPORT OR	OTHER DATA		
TYPE OF SUBMISSION	0.000	T	YPE OF ACTION			
✓ Notice of Intent	Acidize	Deepen	Production (Start/Resun	ne) Water Shut-Off		
Trouble of America	Alter Casing	Hydraulic Fracturing	Reclamation	Well Integrity		
Subsequent Report	Casing Repair	New Construction	Recomplete	Other		
Final Abandonment Noti	Change Plans Convert to Injection	✓ Plug and Abandon Plug Back	Temporarily Abandon Water Disposal			
	the state of the s			d work and approximate duration thereof. If		
is ready for final inspection. Harvard Petroleum prop MIRU Pulling Unit. POH- Pump 25 sx class H @ 8 Set CIBP @ 7095' and of Load hole with plugging Pump 25 sx class C @ 8 Pump 301 sx class C @ Perf and squeeze 376 s Surface plug Verify at su After plugging operation installed. The location v	oses to plug the well as follows: w/ rods and tubing 461', 8461' to 8276'. ap with 35' bailed on top of CIBP. Lea mud and test casing to 500 psi. 1176'; 6176' to 6014' + DV tool WOC an 4570'; 4570' to 1594', WOC and tag - To c class C @ 1594'; 1594' to surface - To rface.	k Test CIBP. d Tag. Top Delaware and 8 5/8" op of Salt (In 162 sxs/Out) ound level, a steel plate of BLM stendards.	casing shoe , Base of Salt t 214 sxs) Shoe	nd the operator has detennined that the site		
14. I hereby certify that the foreg	oing is true and correct. Name (Printed/	Typed) Consulta	ant			
Frieips Writte		Title		Company of the Compan		
Signature		Date	04/2	28/2023		
•	THE SPACE FO	R FEDERAL OR S	TATE OFICE USE			
Approved by		Title		Date		
	re attached. Approval of this notice does negal or equitable title to those rights in the to conduct operations thereon.					
Title 18 U.S.C Section 1001 and	Title 43 U.S.C Section 1212, make it a cr	ime for any person known	ngly and willfully to make to ar	ny department or agency of the United States		

any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.


(Instructions on page 2)

Well Bore Diagram Worksheet

Operataor:Harvard Petroleum Co.Date Spud:Well Name:Todd 13 G Fed 21Date Complete:API #30-015-31514

Location: 13, 23S, 31E

Current Wellbore

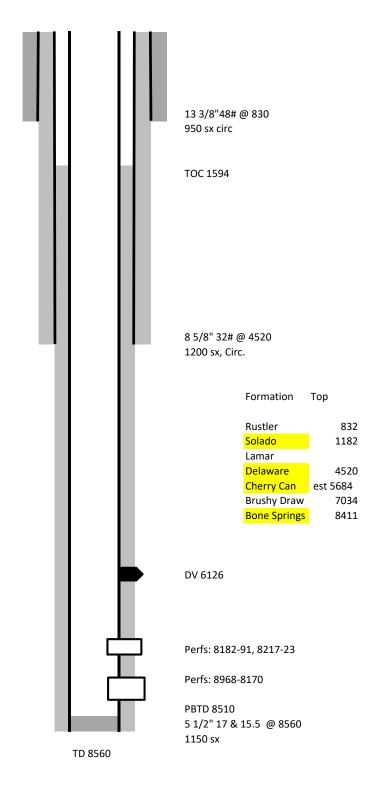

9/13/2001


10/31/2001

Well Bore Diagram Worksheet

Operataor: Harvard Petroleum Co.
Well Name: Todd 13 G Fed 21
API # 30-015-31514
Location: 13, 23S, 31E

Date Spud: 9/13/2001 Date Complete: 10/31/2001

BLM Approved Plugs

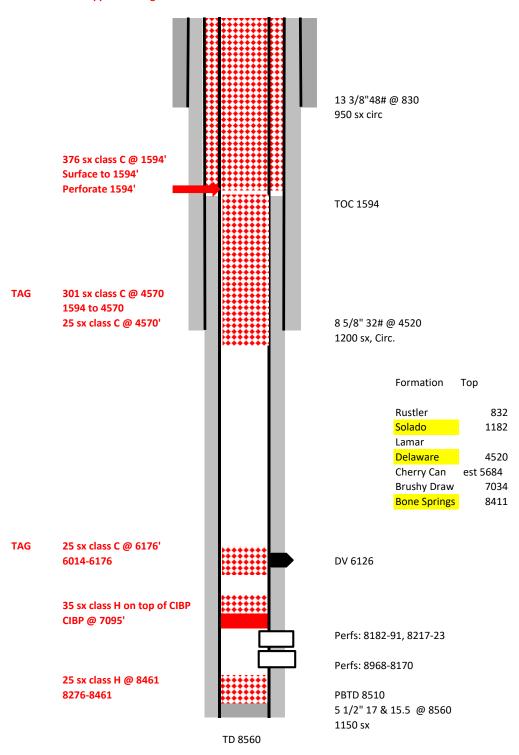

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229 Sundry ID 2728522

Sundry ID	2728522	1	1	1	ı		
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify			
Shoe Plug	771.70	880.00	108.30	Tag/Verify			
Top of Salt @ 1182	1120.18	1232.00	111.82	Tag/Verify			
Base of Salt @ 4275	4182.25	4325.00	142 75	Tag/Verify	376.00	С	Perforate and squeeze from 1594' to surface. (In 162 sxs/Out 214 sxs) Verify at surface.
Shoe Plug	4424.80			Tag/Verify			,
Delaware @ 4520	4424.80			If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio	301.00	С	Spot cement from 4570' to 1594'. WOC and Tag.
DV tool plug	6014.74	6176.00	161.26	Tag/Verify	25.00	C	Spot cement from 6176' to 6014'. WOC and Tag.
DV tool plug				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Set CIBP at 7095'. Dump bail 35' on top. Leak Test
CIBP Plug	7060.00	7095.00	35.00	ns	5.00	Н	CIBP.

Bonesprings @ 8411	8276.89	8461.00		If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio ns	Н	Tag PBTD and spot cement from 8461' to 8276'. WOC and Tag.
Shoe Plug	8424.40	8610.00	185.60	Tag/Verify		

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater

R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	R111-P	50 Feet from Base of Salt to surface				
Shoe @ Shoe @	830.00 4520.00					
Shoe @	8560.00	тос @	1594.00			
		Perforations				
Perforatons Top @	8318.00	Bottom @ Perforations	8338.00			
Perforatons Top @	7145.00	Bottom @	7156.00			
DV Tool @	6126.00	CIBP @	7095.00			

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 281561

CONDITIONS

Operator:	OGRID:
HARVARD PETROLEUM COMPANY, LLC	10155
P.O. Box 936 Roswell, NM 88202	Action Number: 281561
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	Spot 25 sacks cement 5488' - 5258' - T Cherry Canyon	11/2/2023