einediby Op Dr Aph/29/2023 stil: 17:0	Francis Minerals and Natural Resources		Form Case 3 of 1 Revised July 18, 2013	
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, witherars and	Tratarar Resources	WELL API NO.	
District II - (575) 748-1283	OIL CONSERVAT	NOISIVIO MOIT	30-025-28664	
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	1220 South St.		5. Indicate Type of Le	
1000 Rio Brazos Rd., Aztec, NM 87410			STATE 🗵	FEE _
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, N	WI 87303	6. State Oil & Gas Lea	ase No.
SUNDRY NOTION (DO NOT USE THIS FORM FOR PROPOSE DIFFERENT RESERVOIR. USE "APPLIC"		OR PLUG BACK TO A	7. Lease Name or Uni Robert	t Agreement Name
PROPOSALS.)  1. Type of Well: Oil Well	Gas Well 🛛 Other		8. Well Number	001
Name of Operator     Energy Acumen LLC.			9. OGRID Number 373817	
3. Address of Operator			10. Pool name or Wild	icat
10103 Gutierrez Rd NE, Albuque	rque, NM 87111		HARE;SAN ANDRE	
4. Well Location  Unit Letter M: 990 feet fro	m the S line and 660 feet from	m the W line		
Section 21		21S Range 37E	NMPM Coun	ty Lea
Section 21	11. Elevation (Show whether			S S S S S S S S S S S S S S S S S S S
12. Check A	ppropriate Box to Indicate	ate Nature of Notice,	Report or Other Dat	a
NOTICE OF IN	• •		SEQUENT REPOR	
PERFORM REMEDIAL WORK	PLUG AND ABANDON			ERING CASING
TEMPORARILY ABANDON	CHANGE PLANS		THE STATE OF STREET	ND A
PULL OR ALTER CASING	MULTIPLE COMPL			
DOWNHOLE COMMINGLE				
CLOSED-LOOP SYSTEM				
OTHER:		OTHER:		
13. Describe proposed or compl	eted operations. (Clearly sta	te all pertinent details, ar	d give pertinent dates, in	cluding estimated date
of starting any proposed wo proposed completion or reco	rk). SEE RULE 19.15.7.14 I	NMAC. For Multiple Co	mpletions: Attach wellb	ore diagram of
NMOCD plans to plug this w	ell in accordance with the att	ached procedure and any	agreed modifications the	ereto.
ESTIMATED START DATE	E 12/23			
pud Date:	Rig Rele	ase Date:		
			11 11 6	
hereby certify that the information a	bove is true and complete to	the best of my knowledg	ge and belief.	
IGNATURE: Ethan Wakefield	TITLE: Authorized	Representative 1	DATE 11/27/23	
ype or print name: Ethan Wakefiel or State Use Only	d E-mail address: e.w	vakefield@dwsrigs.com	PHONE: 405-34	3-7736
PPROVED BY:John Garcia	TITLE_	Supervisor	DATE_	12/1/23
onditions of Approval (if any):				

# **Energy Acuman LLC**

# Plug And Abandonment Procedure Robert #001

990' FSL & 660' FWL, Section 21, 21S, 37E Lea County, NM / API 30-025-28664

- 1. Hold pre-job safety meeting. Comply with all NMOCD, BLM safety and environmental regulations. Test rig anchors prior to moving in rig if not rigged to base beam.
- 2. Check casing, tubing, and Bradenhead pressures.
- 3. Remove existing piping on casing valve. RU blow lines from casing valves and begin blowing down casing pressure. Kill well as necessary. Ensure well is dead or on a vacuum.
- 4. ND wellhead and NU BOP. Function test BOP.
- 5. P/U 5.5" bit or casing scraper on 2-3/8" work string round trip as deep as possible, approximately 4133'.
- 6. P/U 5.5" CR, TIH and set CR at +/- 4083'. Pressure test tubing to 1000 psi. Sting out of CR. Load hole, and pressure test casing to 800 psi. If casing does not test, then spot or tag subsequent plugs as appropriate. POOH w/ tubing.
- 7. RU wireline and run CBL with 500 psi on casing from CR at 4083' to surface to identify TOC. Adjust plugs as necessary for new TOC. Email log copy to

Brandon Powell at <u>Brandon.powell@state.nm.us</u> upon completions of logging operations.

- 8. Rig up to pump cement down tubing. Pump water to establish rate down tubing.
- 9. Circulate wellbore with 9.5 ppg salt gel.

NOTE: All Plugs Include 100% excess outside casing and 50% Excess inside casing

10. Plug 1 (San Andres Perforations, and Formation Top, 4,083'-3,842', 28 Sacks Type I/II Cement)

Mix 28 sx Type I/II cement and spot a balanced plug inside casing to cover the San Andres perforations, and formation top.

11. Plug 2 (Grayburg and Queen Formation Tops, 3,690'-3,326', 42 Sacks Type I/II Cement)

Mix 42 sx Type I/II cement and spot a balanced plug inside casing to cover the Grayburg and Queen formation tops.

12. Plug 3 (Yates Formation Top, 2,634'-2,414', 25 Sacks Type I/II Cement)

Mix 25 sx Type I/II cement and spot a balanced plug inside casing to cover the Yates formation top.

13. Plug 4 (Surface Casing Shoe, 545'-Surface, 105 Sacks Type I/II Cement)

Attempt to pressure test the bradenhead annulus to 300 psi; note the volume to load. If BH annulus holds pressure, then establish circulation out casing valve with water. Mix approximately 105 sx cement and spot a balanced plug from 545' to surface, circulate good cement out of casing valve. TOOH and LD tubing. Shut well in and WOC. If BH annulus does not test, then perforate at the appropriate depth and attempt to circulate cement to surface filling the casing from 545' and the annulus from the squeeze holes to surface. Shut in well and WOC.

14. ND cementing valves and cut off wellhead. Fill annuli with cement as necessary. Install P&A marker to comply with regulations. Record GPS coordinate for P&A marker on tower report. Photograph P&A marker in place. RD, MOL and restore location per BLM stipulations.

# **Existing Wellbore Diagram**

Energy Acuman LLC Robert #001 API: 30-025-28664 Lea, New Mexico

# **Surface Casing**


8.625" 24# @ 495' OH: 12.25"

# **Formation Tops**

Yates - 2584 feet Queen - 3426 feet Grayburg - 3640 feet San Andres - 3942 feet

Perforations 4133 feet - 4160 feet

Production Casing 5.5" #15.5 @ 4267' OH: 7.825"

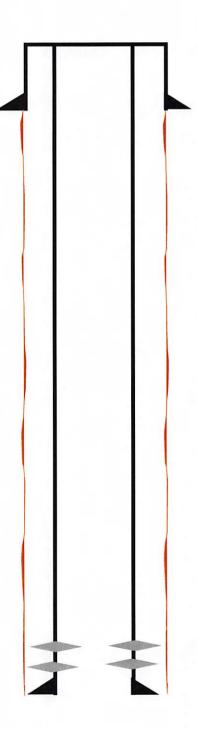

# **Proposed Wellbore Diagram**

Energy Acuman LLC Robert #001 API: 30-025-28664 Lea, New Mexico

## **Surface Casing**

8.625" 24# @ 495' OH: 12.25"

Formation Tops
Yates - 2584 feet
Queen - 3426 feet

Grayburg - 3640 feet

San Andres - 3942 feet

## Plug 4

545 feet - Surface 545 foot plug 105 Sacks of Type I/II Cement

#### Plug 3

2634 feet - 2414 feet 220 foot plug 25 Sacks of Type I/II Cement

#### Plug 2

3690 feet - 3326 feet 364 foot plug 42 Sacks of Type I/II Cement

#### Plug 1


4083 feet - 3842 feet 241 foot plug 28 sacks of Type I/II Cement

CR at 4083'

# <u>Perforations</u>

4133 feet - 4160 feet

Production Casing 5.5" #15.5 @ 4267' OH: 7.825"

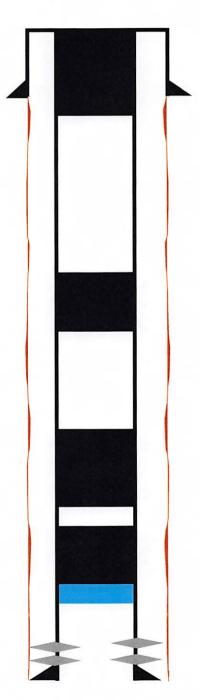

#### CONDITIONS FOR PLUGGING AND ABANDONMENT

#### OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E) Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - 1) Glorieta
  - J) Yates.
  - K) Cherry Canyon Eddy County
  - L) Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

#### **DRY HOLE MARKER REQUIRMENTS**

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

# R-111-P Area

#### T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

#### T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

#### T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

#### T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

#### T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

#### T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

#### T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

#### T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

#### T 21S - R 30E

Sec 1 – Sec 36

#### T 21S - R 31E

Sec 1 – Sec 36

## T 22S - R 28E

Sec 36 Unit A,H,I,P.

#### T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

#### T 22S - R 30E

Sec 1 – Sec 36

#### T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

#### T 23S - R 28E

Sec 1 Unit A

#### T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

#### T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

#### T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

#### T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

#### T 24S - R 30E

Sec 1 Unit A - H, J - N. Sec 2, Sec 3. Sec 4 Unit A,B,F - K, M,N,O,P. Sec 9 Unit A - L. Sec 10 Unit A - L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B - G. Sec 15 Unit A,B,G,H.

#### T 24S - R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

#### T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 289411

#### **CONDITIONS**

Operator:	OGRID:
J.A. Drake Well Service Inc.	330485
607 W Pinon	Action Number:
Farmington, NM 87401	289411
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created	By Condition	Condition Date
jagaro	Plugs must be inside/outside if no cement exists behind casing.	12/1/2023