Submit I Copy To Appropriate District Form C-103 State of New Mexico Revised July 18, 2013 Energy, Minerals and Natural Resources District I - (575) 393-6161 WELL API NO. 1625 N. French Dr., Hobbs, NM 88240 District II - (575) 748-1283 30-021-20185 OIL CONSERVATION DIVISION 811 S. First St., Artesia, NM 88210 5. Indicate Type of Lease District III - (505) 334-6178 1220 South St. Francis Dr. STATE **FEE** \bowtie 1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe, NM 87505 6. State Oil & Gas Lease No. District IV - (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH Hayoz 8. Well Number Gas Well Other CO2 1. Type of Well: Oil Well 005 9. OGRID Number 2. Name of Operator Breitburn Operating LP 370080 3. Address of Operator 10. Pool name or Wildcat 1401 McKinney St., Suite 2400 Houston, TX 77010 Bravo Dome 96010 4. Well Location Unit Letter J: 1980 feet from the South line and 1980' feet from the East line Section Township 19N Range 30E Harding County 11. Elevation (Show whether DR, RKB, RT, GR. etc.) GR 4483' 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: ALTERING CASING [PERFORM REMEDIAL WORK PLUG AND ABANDON 🛛 REMEDIAL WORK COMMENCE DRILLING OPNS. P AND A TEMPORARILY ABANDON CHANGE PLANS PULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT JOB DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM \Box OTHER: Permit Extension OTHER: \Box 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. Breitburn Operating LP intends to plug and abandon this well. Procedure as follows: MI RU single pole rig Set 5 ½" CIBP at 1958' (approximately 50' above top perfs) Spot 10 sx. Class A cement on top of CIBP (calc 51' fillup, top of plug at 1958') Spot cement plug inside 5 1/2" casing across casing surface shoe from 526' to 296' with 45 sx Class A Cement (calc 230' fillup, top of plug at 296') TOH, wait 4 hours, TlH and tag plug and record depth Spot cement plug inside 5 1/2" casing at surface from 100' to surface with 30 sx Class A Cement. (cement to surface) Cut off wellhead and install P&A Marker in accordance with NMOCD guidelines RD MO rig, remove all equipment from site. Restore site. Spud Date: Rig Release Date: I hereby certify that the information above is true and complete to the best of my knowledge and belief. **SIGNATURE** TITLE: Agent DATE: 06/09/2016 Type or print name Shelly Doescher PHONE: 505-320-5682 E-mail address: shelly doescher @yahoo.com

TITLE

APPROVED BY:

Conditions of Approval (if any)

