

NM OIL CONSERVATION

ARTESTA DISTRICT

MAR 09 2017

Form C-141
Revised August 8, 2011

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit 1 Copy to appropriate District Office in accordance with 19.15.29 NMAC.
RECEIVED

Release Notification and Corrective Action

NAB1707 232926 **OPERATOR** Initial Report Final Report

Name of Company: BOPCO, L.P. <i>200737</i>	Contact: Amy Ruth
Address: 522 W. Mermod, Suite 704 Carlsbad, N.M. 88220	Telephone No. 575-887-0300
Facility Name: PLU 400h	Facility Type: Exploration and Production
Surface Owner: Federal	Mineral Owner: Federal
API No. 30-015-40802	

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
N	22	24S	31E	245	South	1330	West	Eddy

Latitude 32.196227° Longitude -103.769871°

NATURE OF RELEASE

Type of Release	Produced Water and Crude Oil	Volume of Release	29.5 bbls PW 0.5 bbls Oil	Volume Recovered	1.5 bbls PW 0.5 bbls Oil
Source of Release	Flow Line	Date and Hour of Occurrence	2/27/2017 time unknown	Date and Hour of Discovery	2/27/2017 3 pm
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	Mike Bratcher/Crystal Weaver (NMOCD)		
By Whom?	Jacob Foust	Date and Hour	2/28/2017 12:06 pm		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	N/A		
If a Watercourse was Impacted, Describe Fully.*	N/A				

Describe Cause of Problem and Remedial Action Taken.*
Buried steel flow line from the wellhead developed hole due to external corrosion. Pipe section was replaced with coated steel line.

Describe Area Affected and Cleanup Action Taken.*
Leak affected south center portion of the caliche well pad and about 557 square feet of pasture south of the pad. Free standing fluids were recovered.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Amy C. Ruth</i>	OIL CONSERVATION DIVISION	
Printed Name: Amy C. Ruth	Signed By: <i>Mike Bratcher</i> Approved by Environmental Specialist	
Title: EHS Environmental Supervisor	Approval Date: <i>3/10/17</i>	Expiration Date: <i>N/A</i>
E-mail Address: Acruth@basspet.com	Conditions of Approval:	Attached <input checked="" type="checkbox"/>
Date: 3/8/2017	Phone: 432-661-0571	

* Attach Additional Sheets If Necessary

ARD-4142

Operator/Responsible Party,

The OCD has received the form C-141 you provided on 3/9/17 regarding an unauthorized release. The information contained on that form has been entered into our incident database and remediation case number 200-4142 has been assigned. **Please refer to this case number in all future correspondence.**

It is the Division's obligation under both the Oil & Gas Act and Water Quality Act to provide for the protection of public health and the environment. Our regulations (19.15.29.11 NMAC) state the following,

The responsible person shall complete division-approved corrective action for releases that endanger public health or the environment. The responsible person shall address releases in accordance with a remediation plan submitted to and approved by the division or with an abatement plan submitted in accordance with 19.15.30 NMAC. [emphasis added]

Release characterization is the first phase of corrective action unless the release is ongoing or is of limited volume and all impacts can be immediately addressed. Proper and cost-effective remediation typically cannot occur without adequate characterization of the impacts of any release. Furthermore, the Division has the ability to impose reasonable conditions upon the efforts it oversees. **As such, the Division is requiring a workplan for the characterization of impacts associated with this release be submitted to the OCD District 2 office in ALTESIA on or before 4/24/17. If and when the release characterization workplan is approved, there will be an associated deadline for submittal of the resultant investigation report. Modest extensions of time to these deadlines may be granted, but only with acceptable justification.**

The goals of a characterization effort are: 1) determination of the lateral and vertical extents along with the magnitude of soil contamination. 2) determine if groundwater or surface waters have been impacted. 3) If groundwater or surface waters have been impacted, what are the extents and magnitude of that impact. 4) The characterization of any other adverse impacts that may have occurred (examples: impacts on vegetation, impacts on wildlife, air quality, loss of use of property, etc.). To meet these goals as quickly as possible, the following items must, at a minimum, be addressed in the release characterization workplan and subsequent reporting:

- **Horizontal delineation of soil impacts in each of the four cardinal compass directions.** Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C₆ thru C₃₆), and for chloride by Method 300. This is not an exclusive list of potential contaminants. Analyzed parameters should be modified based on the nature of the released substance(s). Soil sampling must be both within the impacted area and beyond.
- **Vertical delineation of soil impacts.** Adsorbed soil contamination must be characterized for the following constituents using the associated laboratory methods: benzene, toluene, ethylbenzene, and total xylenes by either Method 8260 or 8021, total petroleum hydrocarbons by Method 8015 extended range (GRO+DRO+MRO; C₆ thru C₃₆), and for chloride by Method 300. As above, this is not an exclusive list of potential contaminants and can be modified. Vertical characterization samples should be taken at depth intervals no greater than five feet apart. Lithologic description of encountered soils must also be provided. At least ten vertical feet of soils with contaminant concentrations at or below these values must be demonstrated as existing above the water table.
- **Nominal detection limits for field and laboratory analyses must be provided.**
- **Composite sampling is not generally allowed.**
- **Field screening and assessment techniques are acceptable (headspace, titration, EC [include algorithm for validation purposes], EM, etc.), but the sampling and assay procedures must be clearly defined. Copies of field notes are highly desirable. A statistically significant set of split samples must be submitted for confirmatory laboratory analysis, including the laterally farthest and vertically deepest sets of soil samples. Make sure there are at least two soil samples submitted**

for laboratory analysis from each borehole or test pit (highest observed contamination and deepest depth investigated). Copies of the actual laboratory results must be provided including chain of custody documentation.

- Probable depth to shallowest protectable groundwater and lateral distance to nearest surface water. If there is an estimate of groundwater depth, the information used to arrive at that estimate must be provided. If there is a reasonable assumption that the depth to protectable water is 50 feet or less, the responsible party should anticipate the need for at least one groundwater monitoring well to be installed in the area of likely maximum contamination.

- If groundwater contamination is encountered, an additional investigation workplan may be required to determine the extents of that contamination. Groundwater and/or surface water samples, if any, must be analyzed by a competent laboratory for volatile organic hydrocarbons (typically Method 8260 full list), total dissolved solids, pH, major anions and cations including chloride and sulfate, dissolved iron, and dissolved manganese. The investigation workplan must provide the groundwater sampling method(s) and sample handling protocols. To the fullest extent possible, aqueous analyses must be undertaken using nominal method detection limits. As with the soil analyses, copies of the actual laboratory results must be provided including chain of custody documentation.

- Accurately scaled and well-drafted site maps must be provided providing the location of borings, test pits, monitoring wells, potentially impacted areas, and significant surface features including roads and site infrastructure that might limit either the release characterization or remedial efforts. Field sketches may be included in subsequent reporting, but should not be considered stand-alone documentation of the site's layout. Digital photographic documentation of the location and fieldwork is recommended, especially if unusual circumstances are encountered.

Nothing herein should be interpreted to preclude emergency response actions or to imply immediate remediation by removal cannot proceed as warranted. Nonetheless, characterization of impacts and confirmation of the effectiveness of remedial efforts must still be provided to the OCD before any release incident will be closed.

Jim Griswold

OCD Environmental Bureau Chief

1220 South St. Francis Drive

Santa Fe, New Mexico 87505

505-476-3465

jim.griswold@state.nm.us

Bratcher, Mike, EMNRD

From: Ruth, Amy <Amy_Ruth@xtoenergy.com>
Sent: Thursday, March 9, 2017 11:24 AM
To: Bratcher, Mike, EMNRD; Weaver, Crystal, EMNRD
Cc: Foust, Bryan; stucker@blm.gov; jamos@blm.gov
Subject: Initial C-141 PLU 400h 2/28/2017
Attachments: Initial C-141 PLU 400H 2-27-2017.pdf

Please find attached the initial form C-141 for the referenced spill at the PLU 400h on 2/27/2017. The release occurred prior to the change-over from BOPCO, L.P. to XTO Energy. Please call me with questions or concerns... Thanks and have a good day :)

Amy Ruth
XTO Energy
432-661-0571

-----Original Message-----

From: Foust, Bryan J. [mailto:BJFoust@BassPet.Com]
Sent: Tuesday, February 28, 2017 12:06 PM
To: Mike.bratcher@state.nm.us; Crystal.weaver@state.nm.us
Cc: Ruth, Amy C.
Subject: Reporting spill at PLU 400h 2/28/2017

The following Wellsite information and coordinates have been shared with you via Wellsite Navigator Pro iOS Edition.

Name: poker lake unit 400h bopco, l.p.
Description: API: 3001540802
Latitude: 32.196407
Longitude: -103.769600

Lease operator reported flow line release on steel pipe due to external corrosion. Lease operator contacted a vacuum truck to recover standing fluid. Recovered 2 bbls of fluid. ".5 BO & 1.5 BW

Approximately 27.5 bbl water and 0.63 bbl oil remain in soil. Attached are pictures and coordinates. Will send in initial c141 report soon. Thank you

Bratcher, Mike, EMNRD

From: Foust, Bryan J. <BJFoust@BassPet.Com>
Sent: Tuesday, February 28, 2017 12:06 PM
To: Bratcher, Mike, EMNRD; Weaver, Crystal, EMNRD
Cc: Ruth, Amy C.
Subject: Reporting spill at PLU 400h 2/28/2017
Attachments: image1.jpeg; ATT00001.txt; image2.jpeg; ATT00002.txt; image.jpeg; image.jpeg; image.jpeg; image.jpeg; image.jpeg

The following Wellsite information and coordinates have been shared with you via Wellsite Navigator Pro iOS Edition.

Name: poker lake unit 400h bopco, l.p.
Description: API: 3001540802
Latitude: 32.196407
Longitude: -103.769600

See a Map of this Well<<https://maps.google.com/maps?saddr=&daddr=32.196407,-103.769600>>

For additional information regarding the Wellsite Navigator app check us out in the Google Play Store<<https://play.google.com/store/apps/details?id=com.sitefinder.wellsitenavigatorusa>> or in the iTunes App Store<<https://itunes.apple.com/us/app/wellsite-navigator-usa-pro/id594298510?mt=8&uo=4>>

Lease operator reported flow line release on steel pipe due to external corrosion. Lease operator contacted a vacuum truck to recover standing fluid. Recovered 2 bbls of fluid. ".5 BO & 1.5 BW

Approximately 27.5 bbl water and 0.63 bbl oil remain in soil. Attached are pictures and coordinates. Will send in initial c141 report soon. Thank you

Notice:

This is a temporary email account being used by an employee of XTO Energy. As of March 1, 2017 the owner of this email account is employed by XTO Energy and is no longer employed by any entity associated with the Bass Family.
