

3/14/74 Drld. cement 2167'-2506'. Dev. 2200'-1 1/2°. Dev. 2232'-1 3/4°. Dev. 2267'-1 1/2°. Dev. 2292'-1°. Dev. 2325'-1°. Dev. 2353'-1°. Dev. 2380'-1 1/2°. Dev. 2414'-1 1/2°. Dev. 2445'-1°. Dev. 2475'-1°. Mixed mud.

3/15/74 Drld. 2506'-2530'. Lost circ. Trip out. WO water. Mixed mud & lost circ. material.

3/16/74 Mixed mud & lost circ. material. Pumped mud in hole from top. Ran 35 stds. DP in hole. Tried to circ.-no returns. Pulled DP. Thinned mud. WOO.

3/17/74 Mixed mud & lost circ. material. Pumped mud in hole from top. WO mud.

3/18/74 Mixed mud & lost circ. material. Pumped mud in hole from top-unable to see fluid level in hole. Checked BOPs. WOO.

3/19/74 WOO. Ran DP to 1,000'. Pumped 20 mins.-no returns. Ran DP to bottom. Pulled DP. WOO.

3/20/74 WOO. Ran DP to bottom. Bridge 72' off bottom. Drld. w/no returns. Pulled DP. Mixed mud. WOO.

3/21/74 Ran DP. Plugged back w/100 sacks cement. Tagged plug @ 2360'. Tried to fill hole. Plugged back w/100 sacks cement. Tagged plug @ 1959'. Lost returns. Total 147' fluid in hole. Pulled DP. WOO.

3/22/74 WOO.

3/23/74 WOO

3/24/74 RU to drill w/air. Reamed 7 7/8" hole to 8 3/4" from 125'-750' to permit 7" O.D. casing to be run in effort to shut-off lost circ. zones.

3/25/74 Reamed w/air 750'-1275'. Reamer hung up 75' below casing shoe.

3/26/74 Repairs to rotary drive pillow block due to rough reaming-18 hrs. Reamed w/air 175'-490' (C.C. Pitts signed Tour Report).

3/27/74 Reamed 490'-1170' w/air and water.

3/28/74 Reamed 1170'-1456' w/air and water.

3/29/74 Reamed 1456'-1770' w/air and water.

3/30/74 Reamed 1770'-1953' w/air and water.

3/31/74 DP torqued up. Bit locked up. Pulled DP. Changed pins in reamer. Ran DP. Reamed 1883'-1965'. Drld. cement & reamed 1965'-2082' w/air & water. Lost returns. Worked sticking DP.

4/1/74 Drld. & reamed (may be new hole) 2082'-2112', w/air & water-losing returns. Stuck DP 50' off bottom. Trip. Checked BOPs. Trip. Reamed & circulated.

4/2/74 Trip. Reaming tight places & getting circulation. Lost returns. Hole tight. Pulled DP. Mixed gel, etc. WOO.

4/3/74 Trip to 1260'-hole bridged. Lost returns. Mixed mud & reamed bridges.

4/4/74 Reamed hole. Trip. Mixed mud. Ran Electrical log. Electrical log (Schlumberger) indicated 20' long bottom joint of 9 5/8" O.D. surface casing had dropped down hole to about 1200'.

4/5/74 WOO. Ran DP. Mixed mud.

4/6/74 Ran DP to 1933'. Trip for plugged bit. Trip. Reamed & washed bridges.