Submit 3 Copies	State of New Me	exico	Form C-103
o Appropriate	Energy, Minerals, and Natural Resources Department		Revised 1-1-89
District Office			
DISTRICT I	OIL CONSERVATION DIVISION		WELL API NO.
P.O. Box 1980, Hobbs, NM 88240	P.O. Box 2088		30-021-20060
DISTRICT II	Santa Fe, New Mexico 875	504-2088	5. Indicate Type of Lease
2.O. Drawer DD, Artesia, NM 88210			STATE FEE
DISTRICT III			6. State Oil & Gas Lease No.
000 Rio Brazos Rd., Aztec, NM 87410			o. State on & Gas Beast 110.
SHNDRY	NOTICES AND DEPORTS ON WI	=11 e	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"			7. Lease Name or Unit Agreement Name
(FORM C-101) FOR SUCH PROPOSALS.)			4
. Type of Well			BRAVO DOME CO2 GAS UNIT
OIL GA. WELL WE		002	
Name of Operator			8. Well No.
AMOCO PRODUCTION (COMPANY		2032-171K
. Address of Operator			9. Pool name or Wildcat
P.O. Box 303, AMISTA	.D, NEW MEXICO 88410		BRAVO DOME CO2 GAS UNIT
			Brown Bolling God Grad Gran
. Well Location Unit Letter K : 198	80 Feet From The South	Line and 1980	Feet From The West Line
	· · · · · · · · · · · · · · · · · · ·		
Section 17		· · · · · · · · · · · · · · · · · · ·	PM Harding County
	10. Elevation (Show wheth 4791.6	er DF, RKB, RT, GR, etc.) GR	
Check Appropriate Pay to Indicate Nature of Notice Papert, or Other Date			
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF I	INTENTION TO:	SUBSE	EQUENT REPORT OF:
'ERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
EMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING OPNS	PLUG AND ABANDONMENT X
ULL OR ALTER CASING		CASING TEST AND CEMENT	IOR I
THER:		OTHER:	
2. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.			
10/18/99			
MIRUSU.			
10/19/99			
Check casing pressure, 0 psi, NUBOP, run 2 3/8" workstring, tag existing CIBP at 2.175 feet, displace casing with fresh			
water and corrosion inhibited fluid, pressure test casing to 500 psi, ok. Cap CIBP with 5 sacks of Class C cement from			
2175' - 2101', pull workstring to 1.796 feet, spot 10 sacks of cement from 1796' - 1649', pull workstring to 30 feet, spot 5			
sacks of cement from 30' - 3'. NDBOP, cut off wellhead, install PXA marker, RDMOSU, cut off well anchors and clean			
location.		2/8	loo of Ref
		0-19	
nereby certify that the information above is true and complete to the best of my knowledge and belief			
(1)			DATE 40.26.00
GNATURE CONTROL		ieid Foreman	DATE 10-25-99
(PE OR PRINT NAME Danny J. Holor	dmc dmc		TELEPHONE NO (505) 374-3010
This space for State Use	Alle DIS	TRICT SUPERM	SC DATE 2/10/10
ONDITIONS OF APPROVAL, IF ANY	<u></u>	The same state is about a 12 to 12 to	-//