Submit 3 Copies	State of New Mexico	Form C-103
to Appropriate District Office	Energy, Minerals, and Natural Resources Department	Revised 1-1-89
- 1	OIL CONSERVATION DIVISION	WELL API NO.
P.O. Box 1980, Hobbs, NM 88240	P.O. Box 2088	30-021-20150
DISTRICT II P.O.:Drawer DD, Artesia, NM 8821	Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lease STATE FEE
DISTRICT III		6. State Oil & Gas Lease No.
1000 Rio Brazos Rd., Aztec. NM 87	410	
SUN	NDRY NOTICES AND REPORTS ON WELLS	
,	DRM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A ERENT RESERVOIR. USE "APPLICATION FOR PERMIT"	7. Lease Name or Unit Agreement Name
Dirre	(FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name of Onte Agreement Name
1. Type of Well		BRAVO DOME CO2 GAS UNIT
OIL WELL	GAS WELL OTHER CO2	
2. Name of Operator		8. Well No.
AMOCO PRODUC	TION COMPANY	1833-351G
3. Address of Operator		9. Pool name or Wildcat
1	MISTAD, NEW MEXICO 88410	BRAVO DOME CO2 GAS UNIT
4. Well Location		
Unit LetterG	: 1650 Feet From The North Line and 1650	Feet From The East Line
Section 35	Township 18N Range 33E NMI	PM Harding County
	10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4765 GR	
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data		
	** *	EQUENT REPORT OF:
l -		
PERFORM REMEDIAL WORK	PLUG AND ABANDON REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS COMMENCE DRILLING OPNS	PLUG AND ABANDONMENT X
PULL OR ALTER CAS NG	CASING TEST AND CEMENT	JOB
OTHER:	OTHER:	
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.		
11/6/99		
MIRUSU, kill well with fresh water, NUBOP, release packer, lay down production tubing and packer, run cast iron bridge		
plug with wireline, set CIBP at 2,518 feet, run workstring, tag CIBP at 2,518 feet, displace casing with fresh water and		
corrosion inhibitor, pressure test casing to 500 psi, held ok. Cap CIBP with 5 sacks of Class C cement from 2518' - 2470',		
pull workstring to 1,991 feet, spot 10 sacks of cement from 1991' - 1895', pull workstring to 30 feet, spot 5 sacks of cement from 30' - 3, NDBOP, cut off wellhead, install PXA marker, RDMOSU, cut off well anchors and clean location.		
	cut off weilifiead, install PAA marker, RDIVIOSO, cut off weil and	lors and clear location.
		1/2
		a/7/00 OK RES
		or ry
I hereby certify that the information SIGNATURE	Labove is true and complete to the best of my knowledge and belief TITLE Foreman	DATE 11-8-99
TYPE OR PRINT NAME Danny	7. Holcomb	TELEPHONE NO (505) 374-3050
(This space for State Uye)	PASSIRICT SUPERMI	508 2/10/20
APPROVED BY CONDITIONS OF APPROVAL, IF AN	TITLE	DATE $\alpha/10/00$
	V	