

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-021-20231
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	L 5852
7. Lease Name or Unit Agreement Name WEST BRAVO DOME CDG UNIT	
8. Well No.	20
9. Pool name or Wildcat	WEST BRAVO DOME

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER CO2 SUPPLY WELL	
2. Name of Operator Amerada Hess Corporation	
3. Address of Operator P. O. Box 840, Seminole, Texas 79360-0840	
4. Well Location Unit Letter <u>F</u> : <u>1650</u> Feet From The <u>NORTH</u> Line and <u>1650</u> Feet From The <u>WEST</u> Line Section <u>32</u> Township <u>19N</u> Range <u>30E</u> NMPM <u>HARDING</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4416'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

09-19-97 THRU 10-06-97

MIRU WELL-CO SVCS. ND WELLHEAD & NU BOP. ATTEMPTED TO RELEASE PKR. NO SUCCESS. GOT OFF ON-OFF TOOL & TOH W/TBG. FOUND THREADS CROSSED ON BTM. CHROME SUB & TOP SUB OFF ON-OFF TOOL. STAR FIBERGLASS INSPECTED TBG. & FOUND TBG. IN GOOD CONDITION. MI 2-3/8" STEEL WORKSTRING. REPLACED TOP OF ON-OFF TOOL & TIH W/WORK STRING. LATCHED ONTO ON-OFF TOOL ON PKR. & RELEASED PKR. PU 3 MORE JTS. & TIH TO TAG FILL @ 1,894'. TOH W/3 JTS. & CI. PUMPED 50 BBLS. KCL DWN. CSG. TO KILL WELL. PUMPED ADDITIONAL 75 BBLS. TO TRY TO EST. CIRC. WELL WOULD NOT CIRC. TOH & LAID DWN. WORKSTRING & PKR. ND BOP & NU FRAC VALVE. CI. RDMO PU. RUPU AGAIN ON 09-23-97. MAKEUP FULL LUBRICATOR TO 6" 3,000# FRAC VALVE. POURED NEW ROPE SOCKET. PULLED UP 3.5" SAND PUMP & TAGGED FILL TO 1,870'. WORKED THRU BRIDGE TO 1,975'. CLEANED OUT WELLBORE TO 1,985'.
(CONTINUED)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Terry L. Harvey TITLE SR. STAFF ASSISTANT DATE 10/07/97
TYPE OR PRINT NAME TERRY L. HARVEY TELEPHONE NO. 915 758-6778

(This space for State Use)

APPROVED BY R. E. Johnson TITLE DISTRICT SUPERVISOR DATE 10/20/97
CONDITIONS OF APPROVAL, IF ANY: