Submit 3 Copies To Appropriate District State of New Mexico Form C-103 Office Energy, Minerals and Natural Resources Revised May 08, 2003 District I WELL API NO. 1625 N. French Dr., Hobbs, NM 87240 District II 30.015.21828 OIL CONSERVATION DIVISION 1301 W. Grand Ave., Artesia, NM 88210 5. Indicate Type of Lease 1220 South St. Francis Dr. District III STATE X FEE \square 1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe. NM 87505 District IV 6. State Oil & Gas Lease No. 1220 S. St. Francis Dr., Santa Fe, NM 87505 E-5313 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name: (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A EMPIRE ABO UNIT 'L' DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 8. Well No. RECEIVED 1. Type of Well: Oil Well X Gas Well Other 131 AUG 1 0 2004 9. OGRID Number 2. Name of Operator BP America Production Company 000778 CONTRACTESIA 10. Pool name or Wildcat 3. Address of Operator EMPIRE ABO P.O. Box 1089 Eunice NM 88231 4. Well Location 100 100 Unit Letter feet from the line and feet from the line **NMPM** Section Township **18**S Range County EDDY 11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3529.2' GR 12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data SUBSEQUENT REPORT OF: NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK REMEDIAL WORK ALTERING CASING PLUG AND ABANDON **TEMPORARILY ABANDON CHANGE PLANS** COMMENCE DRILLING OPNS. PLUG AND X **ABANDONMENT CASING TEST AND MULTIPLE PULL OR ALTER CASING CEMENT JOB** COMPLETION OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. TD: 6210' PBD: 6127' PERFS: 5718-5734' (COVERED BY CIBP) 06.30.04: MIRUPU. NDWH. NUBOP. RIH W/TBG O.E. TAGGED CIBP @ 5693'. CIRC HOLE W/9.5# MUD. SPOT 10 SXS CMT ON TOP OF CIBP @ 5693' UP TO 5690'. POH W/TBG TO 3715'. PRESSS TEST TO 300# PSI. SPOT 35 SXS CMT. POH W/TBG. WOC. TAG CMT @ 3409'. POH W/TBG TO 1067'. SPOT 35 SXS CMT. WOC. TAG CMT @ 787'. POH W/TBG TO 561'. SPOT 35 SXS CMT. 07.02.04: RIH W/TBG. POH W/TBG. WOC. TAG CMT @ 242'. POH W/TBG. NDBOP. RAN 60' OF TBG. CIRC CMT TO SURF. WELL P&A'D.



NEW MEXICO ENERGY, MINERALS and NATURAL RESOURCES DEPARTMENT

FAX-Kent 08.18.04 NERALS and

1912		
BILL RICHA Governor	RDSON PA Palane DICTO 04 AUG 18 2004	Joanna Prukop Cabinet Secretary Acting Director Oil Conservation Division
	13 August 2004	RECEIVED
	BP America Production	OCT 1 5 2004
12 x 2 x 3	P.O. Box 1089	OCD:ARTERIA
	Eunice, New Mexico 88231	
	Form C-103 Report of Plugging for your Empire Abo Unit "L" # 131 M-2-18-27 API 30-015-21828 Cannot be approved until an NMOCD representative has made an inspection of the location and found it to be cleared to comply with OCD rules and regulations. Please check each item in the space provided to indicate that the work has been accomplished and the location is ready for final inspection.	
	1: All pits have been filled and leveled.	
· .	2. Rat hole and cellar have been filled and leveled.	
en e	3. A steel marker 4" in diameter and approximately 4' above mean ground level he concrete to mark the exact location of the plugged well. (Marker must have operator newell number and location including quarter/quarter section or unit letter, section, towns well ID number permanently welded, stamped or otherwise engraved into the metal marker 4" in diameter and approximately 4' above mean ground level he concrete to mark the exact location of the plugged well. (Marker must have operator new level) and location including quarter/quarter section or unit letter, section, towns well ID number permanently welded, stamped or otherwise engraved into the metal marker 4" in diameter and approximately 4' above mean ground level he concrete to mark the exact location of the plugged well. (Marker must have operator new level) and the concrete to mark the exact location of the plugged well.	ame, lease name, ship, range and API
:	4. The location has been leveled as nearly as possible to original top ground conto cleared of all junk and equipment.	our and has been
	5. The dead men and tie downs have been cut and removed.	
	6. If a one well lease or last remaining well on lease, the battery and burn pit locat leveled and cleared of all junk & equipment.	ions have been
ga sana	7. All environmental concerns have been addressed as per OCD guidelines.	
	The above are minimum requirements and no plugging bond will be cancelled until all plugged and abandoned wells have been inspected and Form C-103 approved.	locations for
	When all of the work outlined above has been done, please notify this office by complereturning this letter to us so that our representative will not have to make more than on	
	I certify that the above work has been done and the above-mentioned lease is ready for approval.	OCD inspection and

Van Barton Field Rep. II