

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-03

DISTRICT I
P.O. Box 1940, Hobbs, NM 87240

DISTRICT II
P.O. Drawer 00, Artesia, NM 87210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
30-015-26798

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER

2. Name of Operator
Southwest Royalties, Inc.

3. Address of Operator
P.O. Box 11390, Midland, TX 79702

4. Well Location
Unit Lease P : 560 Feet From The East Line and 560 Feet From The South Line
Section 33 Township 23S Range 28E NMPM Eddy County

10. Elevation (Show whether DF, RCB, RT, GR, etc.)
3063.9 GR

7. Lease Name or Unit Agreement Name

Witt

8. Well No. 1

9. Pool name or Wildcat
Loving East (Delaware)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. 10-07-03. MIRU. Pick up & GIH w/ 6050' of tbq. Spot 25 sx cmt. WOC.
2. 10-08-03 Tag TOC @ 5750', circ. well w/ 140 bbls. of 10# MLF, test csg. 500#.
3. 10-08-03 Pull tbq. to 2650', spot 50 sx cmt. WOC & tag @ 2202'.
Okay w/ NMOCD to combine plugs 2650' & 2480', 25 + 25 = 50 sx.
4. 10-08-03 Pull tbq. to 1080', spot 25 sx cmt. WOC & tag @ 850'.
5. 10-08-03 Pull tbq. to 605', spot 25 sx cmt. WOC.
6. 10-09-03 Tag TOC @ 437'.
7. 10-09-03 Pull tbq. to 153', spot 25 sx cmt. to circulate cmt. to surface.
LD tbq. and top fill well.
8. 10-09-03 RDMO. Cut off wellhead, install dry hole marker, & clean location.

I hereby certify that the information above is true and correct to the best of my knowledge and belief.

SIGNATURE Randall Minear Agent DATE 10-14-03
TYPE OR PRINT NAME Randall Minear TELEPHONE NO. 432-530-0907

(This space for State Use)

APPROVED BY [Signature] Field Supervisor DATE 10-24-03

CONDITIONS OF APPROVAL, IF ANY: