

Submit 1 Copy To Appropriate District  
Office  
District I - (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II - (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III - (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV - (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM  
87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised August 1, 2011

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-22904
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other Injection Well <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator <b>Alamo Permian Resources, LLC</b>		6. State Oil & Gas Lease No. B-8318
3. Address of Operator <b>415 W. Wall Street, Suite 500, Midland, TX 79701</b>		7. Lease Name or Unit Agreement Name SPURCK
4. Well Location Unit Letter I : 2310 feet from the S line and 330 feet from the E line Section 24 Township 17S Range 27E NMPM County EDDY		8. Well Number 004
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number <b>274841</b>
		10. Pool name or Wildcat EMPIRE; YATES-SR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS ☐ P AND A ☐  
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHED

NM OIL CONSERVATION  
ARTESIA DISTRICT  
AUG 25 2014

CONDITIONS OF APPROVAL ATTACHED

Approval Granted providing work is  
Completed by 9-2-2015

RECEIVED

Approved for plugging of well bore only.  
Liability under bond is retained pending receipt  
of C-103 (Subsequent Report of Well Plugging)  
which may be found at OCD Web Page under  
Forms, [www.cmnrd.state.nm.us/oed](http://www.cmnrd.state.nm.us/oed).

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Carie Stoker TITLE Regulatory Affairs Coordinator DATE 08/21/2014

Type or print name CARIE STOKER E-mail address: carie@stokeroilfield.com PHONE: 432.664.7659

APPROVED BY: [Signature] TITLE Dist II Supervisor DATE 9-2-14

Conditions of Approval (if any):

\* See Attached COA's -

## ALAMO PERMIAN RESOURCES, LLC

### SPURCK #004 -- PLUG & ABANDONMENT PROCEDURE

08/20/2014

1. NOTIFY ~~MIRU~~ 24 hours prior to rigging up pulling unit on well to P&A.
2. MIRU pulling unit, install BOP, & pull out of hole with tubing and downhole equipment in well. Provide detailed description of what is pulled out of hole on Morning Report for records.
3. Run in hole with 2-7/8" tubing string and muleshoe bottom joint to check for fill in well. TD is approximately 540'.
4. Circulate hole with produced water using vacuum truck in preparation to set Cement Plug in well.
5. Circulate & set 260-sack Cement Plug from TD at approximately 540' to the surface inside 10-3/4" production casing and open hole from 429'-540'. Pull tubing string up slowly while setting plug and fill casing to surface with cement once tubing is out of the hole.
6. WOC & Tag TOC. If TOC is not at surface in casing – Top off Cement in casing as necessary. WOC.
7. Remove BOP. Get approval from ~~IRU~~ before Rigging Down pulling unit.
8. Notify ~~MIRU~~ 4 hours prior to cutting off wellhead. (Wellhead should be cut off within 10 days of plugging job).
9. Cut off wellhead. Weld Cap on casing. Install P&A Marker at surface.
10. Reclaim wellsite location.

Solid Cement Plug From 540' to Surface


H. Patrick Seale  
August 20, 2014

ALAMO PERMIAN RESOURCES, LLC

**WELLBORE DIAGRAM**

Lease/Well No.: **SPURCK No. 004** ELEVATION, GL: 3,514 ft  
 Location: 2,310' FSL & 330' FEL  
 UL: I, SEC: 24, T: 17-S, R: 27-E FIELD: **EMPIRE; YATES, SEVEN RIVERS**  
 EDDY County, NM  
 LEASE No.: NM - B-8318 Spudded: 5/1/1979  
 API No.: **30-015-22904** Drlg Stopped: 6/13/1979  
 Completed: 6/14/1979

**CABLE TOOLS**

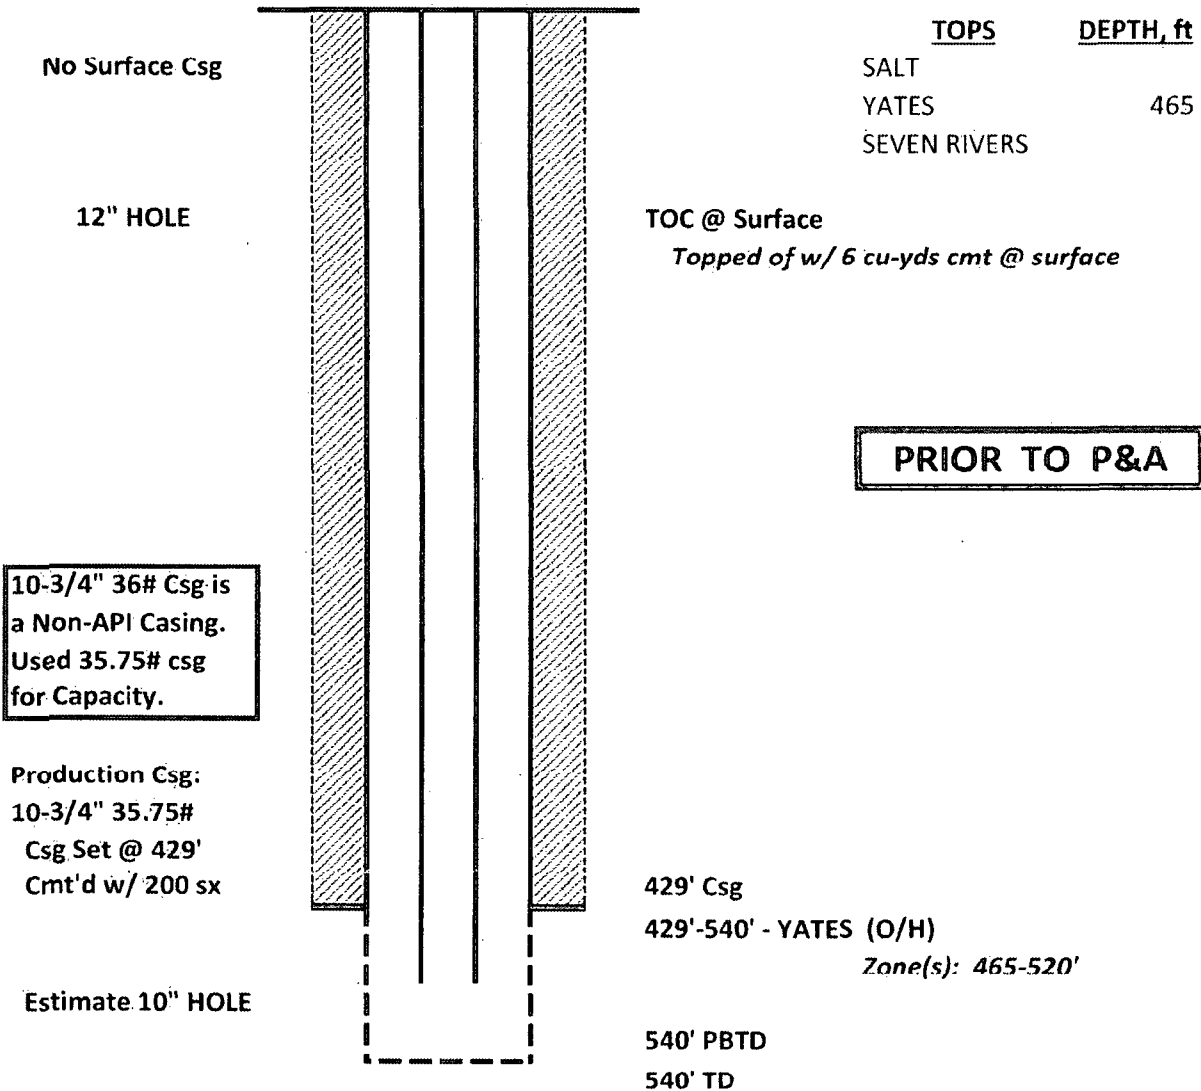

Well Drilled by Latch Operations in 1979 as the SPURCK #4.  
 Top of Yates/7R @ 465' - broken pay to 520'. Hole filled with oil.  
 NATURAL COMPLETION: 96 BOPD + 1 MCFD + 0 BWPD - Flowing.  
 NO RECORD OF WELL EVER BEING STIMULATED.


HPS: 08/20/2014

ALAMO PERMIAN RESOURCES, LLC

**WELLBORE DIAGRAM**

Lease/Well No.: **SPURCK No. 004** ELEVATION, GL: 3,514 ft  
 Location: 2,310' FSL & 330' FEL  
 UL: I, SEC: 24, T: 17-S, R: 27-E FIELD: **EMPIRE; YATES, SEVEN RIVERS**  
 EDDY County, NM  
 LEASE No.: NM - B-8318 Spudded: 5/1/1979  
 API No.: **30-015-22904** Drlg Stopped: 6/13/1979  
 Completed: 6/14/1979

**CABLE TOOLS**

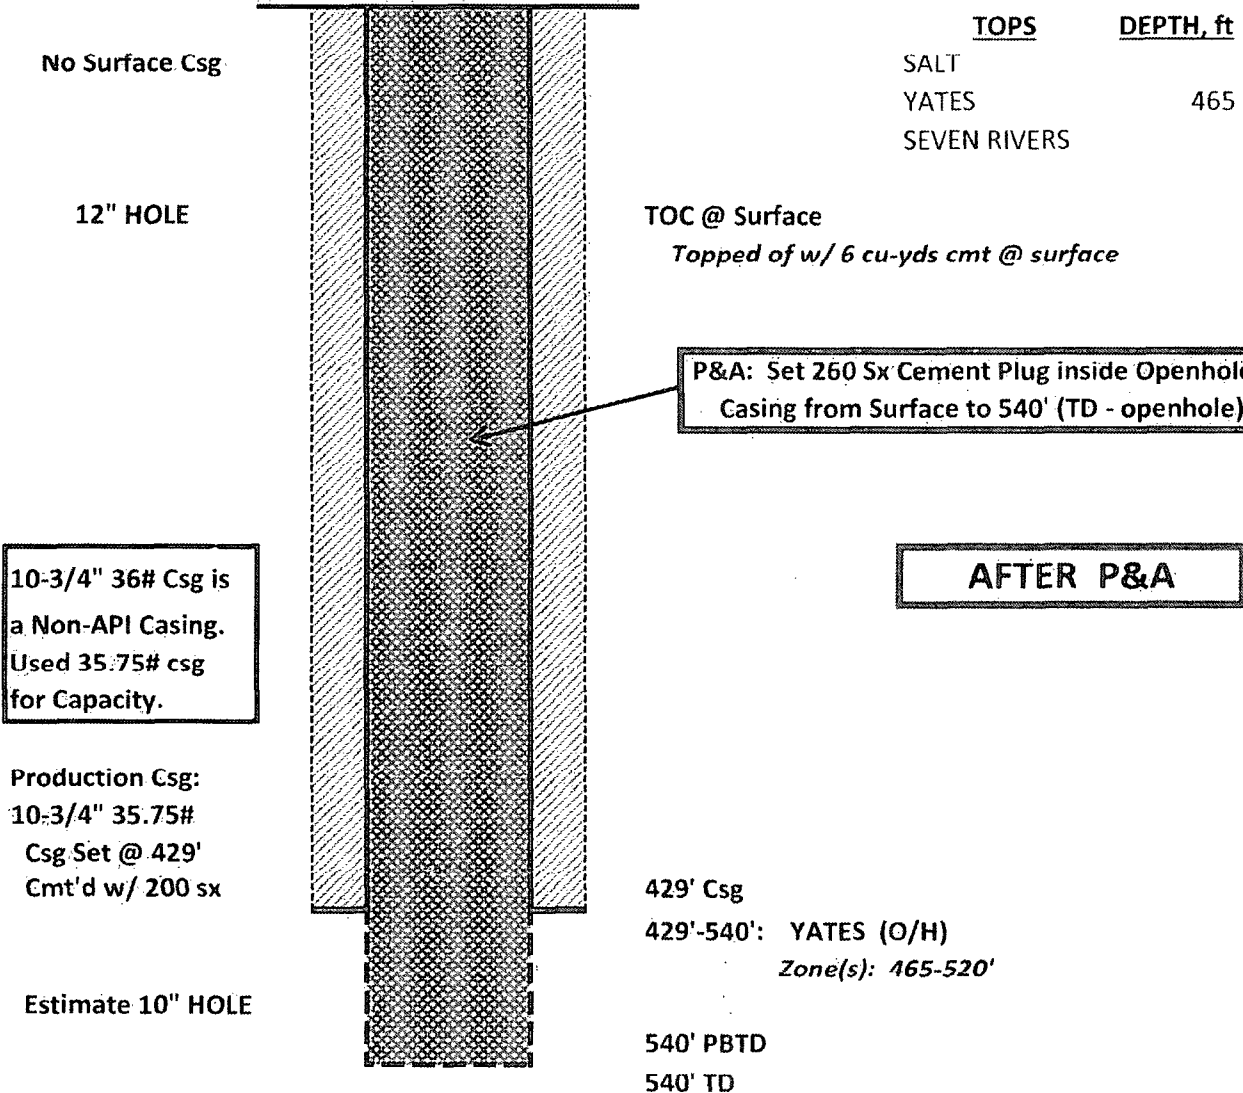

Well Drilled by Latch Operations in 1979 as the SPURCK #4.  
 Top of Yates/7R @ 465' - broken pay to 520'. Hole filled with oil.  
 NATURAL COMPLETION: 96 BOPD + 1 MCFD + 0 BWPD - Flowing.  
 NO RECORD OF WELL EVER BEING STIMULATED.

HPS: 08/20/2014

NEW MEXICO OIL CONSERVATION DIVISION  
DISTRICT 2 OFFICE  
811 S. FIRST STREET  
ARTESIA, NM 88210  
(575)748-1283

**CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT**

Operator: Alamo

Well Name & Number: Spuck # 4

API #: 30-015 - 22904

1. Produced water will not be used during any part of the plugging & abandonment operation.
2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
4. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
6. If work has not begun within 1 year of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
7. Every attempt must be made to clean the well bore out to below the perms, before any plugs can be set, by whatever means possible.
8. Cement Retainers may not be used.

9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
10. Plugs may be combined after consulting with and getting approval from NMOCD.
11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: 9-2-14

APPROVED BY: *FLD*

## GUIDELINES FOR PLUGGING AND ABANDONMENT

### DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stub plugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
  - Fusselman
  - Devonian
  - Morrow
  - Wolfcamp
  - Bone Spring
  - Delaware
  - Any Salt Section (Plug at top and bottom)
  - Abo
  - Glorieta
  - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).