

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO.
30 015 23975

5. Indicate Type of Lease
STATE ☐ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:
Superior Federal

8. Well No.
5

9. Pool name or Wildcat
Burton Flat Strawn, East

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
3293' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Tom Brown, Inc.

3. Address of Operator
P O Box 2608, Midland, TX 79702

4. Well Location
Unit Letter K : 1980 feet from the south line and 1980 feet from the west line
Section 5 Township 20 S Range 29 E NMPM County Eddy

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
MULTIPLE COMPLETION <input type="checkbox"/>	OTHER: <input type="checkbox"/>
OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- 12-21-2001 ND wellhead - NUBOP - pick up 1 jt tbg & tag top of plug @ 3780' - spot 30 sx cement @ 3780' - POOH - WOC - RIH & tag @ 3536' - circ 10# mud - POOH - SWI.
- 12-26-2001 Open well - ND BOP - weld on pull nipple - cut casing @ 2806' - not free per BLM Jim Amos - OK to cut @ 2784' - lay down casing - RIH with tbg & spot 40 sx @ 2839' - POOH - WOC.
- 12-27-2001 RIH with tubing & tag @ 2683' - POOH & spot 35sx @ 405' to 300' - POOH & spot 35 sx @ 100' to surface. Rig down - cut off wellhead, install dry hole marker - level pit & cellar - move out.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Laura Clepper TITLE Regulatory Analyst DATE 1-14-2002
Type or print name Laura Clepper Telephone No. 915 688-9439
(This space for State use)

Accepted for record
only JAN 30 2002

TITLE _____ DATE _____