Submit I Copy To Appropriate District Office	State of New Me		Form C-103		
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natu	iral Resources	Revised July 18, 2013 WELL API NO.		
<u>District II</u> – (575) 748-1283	OIL CONSERVATION	DIVISION	30-015-32944		
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178	1220 South St. Fran		5. Indicate Type of Lease		
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	Santa Fe, NM 87		STATE FEE 6. State Oil & Gas Lease No.		
1220 S. St. Francis Dr., Santa Fe, NM	,		o. State on & das Zease No.		
87505 SUNDRY NOT	ICES AND REPORTS ON WELLS		7. Lease Name or Unit Agreement Name		
	SALS TO DRILL OR TO DEEPEN OR PL CATION FOR PERMIT" (FORM C-101) FO				
PROPOSALS.)	H B 2 State 8. Well Number 6				
1. Type of Well: Oil Well 2. Name of Operator	9. OGRID Number				
DEVO	6137				
3. Address of Operator	10. Pool name or Wildcat				
333 W	CEDAR CANYON; BONE SPRING				
4. Well Location Unit LetterF : 1980	feet from the North line and	l1980feet	from the West line		
Section 2		ange 29E	NMPM Eddy, County New Mexico		
	11. Elevation (Show whether DR				
	3080' GR	·			
12. Check	Appropriate Box to Indicate N	lature of Notice,	Report or Other Data		
NOTICE OF IN	ITENTION TO:	SUB	SEQUENT REPORT OF:		
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WOR			
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRI			
PULL OR ALTER CASING DOWNHOLE COMMINGLE	MULTIPLE COMPL	CASING/CEMEN	T JOB 📙		
CLOSED-LOOP SYSTEM					
OTHER:	lated energians (Clearly state all	OTHER:	d give pertinent dates, including estimated dat		
	ork). SEE RULE 19.15.7.14 NMA		npletions: Attach wellbore diagram of		
Devon Energy Production C	ompany, LP respectfully requests to	run an MIT on the ro	eferenced well per attached procedures.		
Devon respectfully requests	a five year TA status on this well.				
TA'ing well to bring well int	o OCD compliance, until well can be	evaluated.			
	TA status may be gr	anted after a			
		is performed.			
	Contact the OCD to so it may be witness	schedule the test	NM OIL CONSERVATION		
	ADTECIA DICTRICT				
	LASTPRO	0 10/1/20	JUN 18 2015		
Attached: Procedures and C	Current and Proposed Wellbore Sche	matics.	RECEIVED		
I hereby certify that the information	7	_			
SIGNATURE CONTRACTOR	TITLE Res		e Associate DATE 06/12/2015		
Type or print name Rebecca Deal For State Use Only	E-mail address: Rebecca.deal@	@dvn.com	PHONE: (405)228-8429		
APPROVED BY: Conditions of Approval (if any):	NEW TITLE COM	iterating of	FILER DATE 6/19/15		

DVN: H B 2 State 6

API #30-015-32944

SL: 1,980' FNL & 1,980 FWL Sec 2-T24S-R29E

Eddy County, NM 6/9/2015

WBS#

Purpose: Temporarily Abandon Wellbore

GLM: 3,080'

KBM: 3,098

KB:

18' AGL

Well spud -9/20/2003

T.D. – 8,400°

Casing and Tubing Data:

Size	Wt. lb/ft	Grade	Interval	(80% S.F.) Collapse	(80% S.F.) Burst	Drift	Capacity (bbls/ft)
13-3/8"	48	H-40	0 – 583'	-	-	-	-
8-5/8"	32	J-55	0 – 3,130'	2,024	3,144	7.796	0.0609
5-1/2"	17/15.5	J-55	0 - 8,400'	3,232	3,848	4.767"	0.0236
2-7/8"	6.4	J-55	0 -8,210'	6,144	5,808	2.347"	0.0058

^{2-7/8&}quot; x 5-1/2", 15.5# csg capacity: 0.01577 bbl/ft

TOC outside 5-1/2" csg @ $\sim 2,220$ ' (CBL confirmed 10/8/2003)

Existing Production string (top down):

246 Jt, 2-7/8", 6.4#, J-55 tbg

1, 2-7/8" tbg TAC (7,911)

10 jts, 2-7/8", 6.4#, J-55 tbg (313')

- 1, Blast Jt (3')
- 1, Seat Nipple (1.1')
- 1, 3-1/16" Mud Anchor (21')

Bone Spring Perfs

8,156' - 8,169',

8,211' - 8,218'

Safety:

All personnel will wear hard hats, safety glasses with side shields, and steel toed boots while on location. Assess wellhead working height for safety. If needed, use work platform or man-lift for fall protection. Tailgate safety meetings are to be held each morning prior to beginning work and prior to change in operations.

H B 2 State 6 Temporary Abandonment

Procedure:

- 1. Test and/or install and test anchors. MIRU WSU. Spot all necessary equipment. Record pressures on tbg and csg. Top kill tbg (if required) with 2% KCL
- 2. Install rod rams and TOOH w/ rods recording location and type of rod break. Fish remaining rods and pump.
- 3. ND wellhead. NU 5K BOPE with blind rams and 2-7/8" pipe rams. Test BOPE per Devon Guidelines
- 4. Release TAC (7,911') and TOOH w/ tbg. Record any wear and any paraffin/scale issues along with their location in the string.
- 5. Pick up 5-1/2" CIBP TIH to 8,106' (50' above top perf) and set CIBP. Sting out of CIBP, pressure test csg to 500 psi for 5 min to ensure CIBP is holding.

Note: Notify State representative and Devon Engineer prior to setting CIBP with set depth.

- 6. Rig up cement truck, break circulation and spot 30 sacks of Class "H" cement on top of CIBP. Pick up 10 stands, reverse circulate 1-1/2 times tubing volume. WOC
- 7. RIH and tag cement plug. Load and test casing to 500 psi for 10 min with chart recorder.

 Report back to State rep and Devon engineer with tag depth and pressure test.
- 8. Circulate/roll hole with corrosion inhibiter as per Baker's recommendation.
- 9. ND BOPE, NU wellhead, RDMO WSU



