Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR OIL CONSERVATION BUREAU OF LAND MANAGEMENT RY NOTICES AND DECEMBER ARESIDANT

Form 3160-5 (August 2007) DI B	FORM APPROVED OMB NO. 1004-0135 Expires: July 31, 2010 5. Lease Serial No. NMNM54998 6. If Indian, Allottee or Tribe Name				
SUNDRY Do not use th abandoned we					
SUBMIT IN TR	PLICATE - Other instruc		ECEIVED	7. If Unit or CA/Agre	ement, Name and/or No.
Type of Well ☐ Gas Well ☐ Ot		:		8. Well Name and No. STATELINE FED	
2. Name of Operator RKI EXPLORATION & PROD	Contact: PUCTIONE-Mail: hbrehm@r	HEATHER BREHM kixp.com		9. API Well No. 30-015-24479	
3a. Address 210 PARK AVENUE, SUITE OKLAHOMA CITY, OK 7300	700 3	3b. Phone No. (include area Ph: 405-996-5769 Fx: 405-996-5772	ı code)	10. Field and Pool, or BRUSHY DRAV	Exploratory V
4. Location of Well (Footage, Sec., 7	T., R., M., or Survey Description)		11. County or Parish,	and State
Sec 35 T26S R29E Mer NMP	NWNW 740FNL 330FWL	<u> </u>		EDDY COUNT	/, NM
12. CHECK APP	ROPRIATE BOX(ES) TO) INDICATE NATURE	OF NOTICE, R	EPORT, OR OTHE	R DATA
TYPE OF SUBMISSION		· TY	PE OF ACTION		
Notice of Intent ■ Notice of Intent Notice of	☐ Acidize	☐ Deepen	Produc	tion (Start/Resume)	☐ Water Shut-Off
☐ Subsequent Report	☐ Alter Casing	☐ Fracture Treat /	☐ Reclam	nation	■ Well Integrity
	☐ Casing Repair	□ New Construction		•	☐ Other
☐ Final Abandonment Notice	Change Plans	☑ Plug and Aband		rarily Abandon	•
13. Describe Proposed or Completed Op	Convert to Injection	Plug Back /	☐ Water 1	<u> </u>	
If the proposal is to deepen direction Attach the Bond under which the wo following completion of the involved testing has been completed. Final Al determined that the site is ready for f	ally or recomplete horizontally, rk will be performed or provide doperations. If the operation re- bandonment Notices shall be file	give subsurface locations and the Bond No. on file with BLI sults in a multiple completion	measured and true v M/BIA. Required su or recompletion in a	ertical depths of all pertinus ibsequent reports shall be new interval, a Form 316	ent markers and zones. filed within 30 days 0-4 shall be filed once
please cancel ET#301789 a	nd replace with this P&A	Intent			
RKI RESPECTFULLY REQUIPROCEDURE.	ESTS TO STOP THE CUI	RRENT TA PROCEDUR	E AND CONTIN	UE WITH A PLUG &	ABANDON
THE SUBJECT WELL WAS A DISCOVERED THAT THE PR THE PROJECTED FUTURE A RE-COMPLETIONS ON THIS	REVIOUS WELL OPERAT ZONE (DELAWARE). RKI	OR HAD ALREADY CO	MPLETED UNR	EPORTÉD PERFS (
P&A PROCEDURE TO INCLU	IDE:	1/25-	SEE	ATTACHED F()R
set CIBP @ 2930', 35 sx cmt	@ 2925'-2700', 35 sx cmt		CON	DITIONS OF A	PPROVAL
14. I hereby certify that the foregoing is	Electronic Submission #3	01818 verified by the BLI TION & PRODUCTION, s	# Well Information	n SysteRECLAMATION	N PROCEDURE Ched
Name (Printed/Typed) HEATHER	RBREHM	Title RE	GULATORY AN	ALYST	
Signature (Electronic S	lubmission)	Date 05,	15/2015	ACONDARI AD MI	ior 1900rd 300 7/21/201 5
	THIS SPACE FO	R FEDERAL OR STA	TE OFFICE U	SE	
Approved By Some's	O. amos_	Title	SPET		7-15-15 Date
Conditions of approval if any, are attached certify that the applicant holds legal or equivalent which would entitle the applicant to condu	itable title to those rights in the	not warrant or subject lease Office	CFO.		
Title 8 U.S.C Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it a catalements or representations as	crime for any person knowing to any matter within its jurisdi	y and willfully to me ction.	ake to any department or	agency of the United

Additional data for EC transaction #301818 that would not fit on the form

32. Additional remarks, continued

@ 800'-350', and 20 sx cmt @ 70'-surface.

At ext-off verify ent to surf. all annelses

RKI Exploration & Production, LLC Stateline Federal #1

NM OIL CONSERVATION

ARTESIA DISTRICT

JUL 21 2015

RECEIVED

Plug and Abandonment Procedure

Brushy Draw.

Section 35 T26S R29E Eddy County, NM

API # 30-015-24479 Property No. 158800

Spud Date: 6/4/83

Comp Date: 8/8/83

Producing Formations: Brushy Canyon 4,935'-5,892' OA

 KB Elev:
 2,900'

 GL Elev:
 2,890'

 TD:
 6,750'

PBTD: 4,350'

Marker Jt: DV tool @ 4,406' per report

CASING SUMMARY:

Safety Factor = 80% of new applied to burst, collapse and tension parameters in table.

Size	Depth (ft)	Weight (#/ft)	Grade psi	Connection Type	Capacity (bbls/ft)	ID (in)	Drift (in)	Burst (psi)	Collapse (psi)	Tension (lbs)
13 3/8"	455'	54.5/61/68	J-55	BT&C	0.1546	12.515	12.359	2,200	900	412,000
8 5/8"	2,901'	24/32	J-55	ST&C	0.0637	8.097	7.972	2,360	1,100	195,000
5½"	6,756'	17#	J-55	ST&C	0.0232	4.892	4.767	4,200	3,950	169,000

Surface:

13 3/8" 54.5/61/68# J-55 BTC: 0'-455' - TOC @ surface

Intermediate: 8 5/8" 24/32# J-55 STC: 0'-2,901'- TOC @ surface

Production: 5 1/2" 17# J-55 STC: 0' - 6,756'; TOC @ surface per calculation

COMPLETION HISTORY TO DATE: Brushy Canyon 4,935'-5,892' OA. CIBP set @ 4,900' w/35 sx cmt on top of

plug (4/30/15). TOC @ 4,350'. Brushy Canyon 6,442'-6,565', sqz'd w/ 150 sx cmt (7/83).

OBJECTIVE: Plug and abandon.

RKI REQUIRES THAT HARD HATS, STEEL TOE BOOTS, FIRE RETARDANT CLOTHING, AND SAFETY GLASSES BE WORN ON LOCATION

<u>HOLD SAFETY MEETING PRIOR TO COMMENCING PERFORATING, WIRE LINE AND PUMPING OPERATIONS</u>

NO IGNITION SOURCES WITHIN 100 FT OF THE WELLHEAD, FLOWBACK TANKS OR MANIFOLD.

PROCEDURE:

- 1) Test safety anchors.
- 2) MI RU Service Unit. Set frac tank & lay flowline.
- 3) ND WH, NU 3K# BOP.

- 4) TOH w/ 2-7/8" 6.5# J-55 EUE tubing.
- 5) MI RU wireline unit. RIH w/ JB/GR to 3,000'. RIH and set 10K# CIBP @ 2,930' (do not set CIBP in casing collar). RD MO wireline unit.
- TIH w/ tubing to 2,920'.
- 7) MI RU cementers. Pump 60 bbls heavy mud. Spot 35 sx Class C cement (14.8 ppg, 6.3 gps, 1.32 cfs yield), flush with 15 bbls heavy mud. POH w/ 10 stds tubing. WOCT. RIH and tag plug (maximum tag depth 2,700').
- 8) ROH, LD 1,800' tubing, EOT @ 1,125'.
- 9) Spot 35 sx Class C cement (14.8 ppg, 6.3 gps, 1.32 cfs yield), flush with 5 bbls heavy mud. POH w/ 10 stds tubing. WOCT. RIH and tag plug (maximum tag depth 900').
- 10) LD 3 jts. tubing.
- 11) Spot 50 sx Class C cement (14.8 ppg, 6.3 gps, 1.32 cfs yield), flush with 1½ bbls heavy mud. POH w/ tubing. WOCT. RIH and tag plug (maximum tag depth 350').
- 12) TOH, LD tubing.
- 13) ND BOP. Remove tubinghead.
- 14) RIH w/2 jts. Tubing. Spot 20 sx Class C cement (14.8 ppg, 6.3 gps, 1.32 cfs yield) from 70' to surface.

15) RD MO cementers. RD MO service unit.

At ent-off verity conf Suit all annula

- 16) Cut-off casinghead. WO cap with well name/number, operator name, date. Set from top of casing to minimum 4' above ground level, install a minimum 4" in diameter marker with WO cap with operator, well name/number and date.
- 17) Remove all equipment, safety anchors, clean up and reclaim surface location.

RKI Contact List:

RKI	Title	Office	Cell .
Ken Fairchild	Production Manager	405-996-5764	469-693-6051
Gene Thompson	Production Superintendent	575-885-1313	817-908-9219
Paul Munding	Permian Production Manager	405-996-2140	405-820-2825
Jaime McAlpine	Engineering Consultant	405-996-5741	405-850-6685

Emergency Contacts - New Mexico:

Hospital:

Carlsbad Medical Center

(575) 887-4100

2430 W. Pierce St., Carlsbad, NM 88220

Sheriff's Office:

Lea County Sheriff Dept

(575) 396-3611

Eddy County Sheriff Dept

(575) 887-7551

Emergency Contacts – Texas:

Hospital:

Reeves County Hospital

(432) 447-3551

2323 Texas St, Pecos TX 79772

Sheriff's Office:

Reeves County Sheriff Dept

(432) 445-4901

Loving County Sheriff Dept

(432) 377-2411

RKI Exploration and Production, LLC

Stateline Federal #1
Section 35 T26S R29E
Eddy County, NM
API No. 30-015-24479

API No. 30-015-24479 PROPOSED KB - 2,900'5/13/15; JLM GL - 2,890'Tage to Redining Spot 20 sx Class C cmt @ 70' to surface. 13-3/8" 54.5/61/68# J-55 BTC @ 455' Spot 50 sx Class C cmt @ 800'-350'. Tag Plug. Rustler Salabo 1200-22 Cost, -2993 Del. 7893 Spot 35 sx Class C cmt @ 1,125'-900'. Tag Plug. Toc. ? Set CIBP @ 2,930'. Spot 35 sx Class C 8 5/8" 24/32# K-55 STC @ 2,901' cmt @ 2,925'-2,700'. Tag Plug. Delaware 2,960'-2,996' 5 1/2" TOC @ surface by calculation DV Tool @ 4,406' CIBP @ 4,905' w/ 35 sx cmt (4/30/15) Brushy Canyon 4,935'-5,892' OA Brushy Canyon 6,442'-6,565' OA sqz'd w/ 150 sx PBTD 4,350' 5½" 17# J-55 STC @ 6,756' ~ TD 6,750' TOC?

RKI Exploration and Production, LLC

Stateline Federal #1
Section 35 T26S R29E
Eddy County, NM
API No. 30-015-24479

API No. 30-015-24479 CURRENT KB - 2,900'GL - 2,890'4/23/15; JLM 13-3/8" 54.5/61/68# J-55 BTC @ 455' Tubing Top to Btm: 92 jts 2-7/8" 6.5# J-55 EUE Tbg @ 2,867'. 8 5/8" 24/32# K-55 STC @ 2,901' Ramsey 2,960'-2,996' 5%".TOC @ surface by calc DV Tool @ 4,406' CIBP @ 4,905' w/ 35 sx cmt Brushy Canyon 4,935'-5,892' OA Brushy Canyon 6,442'-6,565' OA sgz'd w/ 150 sx PBTD 4,350' 5½" 17# J-55 STC @ 6,756' TD 6,750'

NM OIL CONSERVATION

ARTESIA DISTRICT

JUL 21 2015

BUREAU OF LAND MANAGEMENT Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972

RECEIVED

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

- 6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.
- The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation procedure.

J. Amos 3/6/11



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm

TAKE PRIDE"

In Reply Refer To: 1310

RECEIVED

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909, 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Linda Denniston Environmental Protection Specialist 575-234-5974

Henryetta Price Environmental Protection Specialist 575-234-5951

Dara Glass
Environmental Protection Specialist
575-234-5924

Shelly Tucker Environmental Protection Specialist 575-234-5979 Cody Layton Supervisory Multi Resources 575-234-5959

Trishia Bad Bear Natural Resource Specialist 575-393-3612

Jeffery Robertson Natural Resource Specialist 575-234-2230