Conditions of Approval, if any:

## **B&B #9 T&A Procedure**

Notify OCD of intent to TA wellbore.
1) MIRU PU. ND WH NU BOP.
2) POH laying down Rods. POH w/tbg (see attached tbg detail ?? well pumping under a pkr??).
3) RU JSI to RIH w/ 5.8" gauge ring & JB w/ CCL to 7800'. PU & RIH w/7" CIBP and set @ +/-7700'. Dump 35' cmt on CIBP. RD JSI.
4) PU & RIH w/2-7/8" tbg to pbtd. Circulate inhibited fluid to surface.
5) Pressure test csg to 500# for 30 min with OCD witness.
6) If test fail identify casing leak w/BP & pkr.
Clean location and notify OCD of change in status.
Well has uphole potential in the Glorieta/Yeso.