Submit 3 Copies To Appropriate District	State of N						Form C-1	
Office District I	Energy, Minerals and	d Natura	l Resources	TYPET AN	1310	Revise	d May 08, 20	003
1625 N. French Dr., Hobbs, NM 87240 District II	OH GOMGERM	A ET CONT	DILHOLON	WELL AP	1 NO. 30-015-348	854		
1301 W. Grand Ave., Artesia, NM 88210 1220 South St. Francis Dr.					5. Indicate Type of Lease			
District III 1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe,			i	TE 🛛	FEE		
District IV	•	, IVIVI O7.	505		il & Gas Lea			
1220 S. St. Francis Dr., Santa Fe, NM 87505				o. State O	n & Gas Lee			
SUNDRY NOTIC (DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVOIR. USE "APPLIC PROPOSALS.)	ES AND REPORTS O DSALS TO DRILL OR TO DE CATION FOR PERMIT" (FOR	EEPÉN OF	R PLUG BACK TO A	1625 STA		t Agreen	nent Name:	
1. Type of Well: Oil Well Gas Well X	Other (S	3 ←	7.27 INFO RTES		ımber 218885			
2. Name of Operator		77		9. OGRID	Number			
LCX Energy, LLC	\	ંડેયુ	_ 6 8		91			
3. Address of Operator				10. Pool r	ame or Wild	lcat		
110 N. Marienfeld, Ste. 20 4. Well Location	<u>10, Midland, TX 79701</u>	L	Fararake, C.					_
4. Well Location		.,						
Unit Letter M :	560 feet from the	WEST	line and	760	feet from th	eS0	OUTH lis	ne
Section 9			tange 25E	NMPM	C	ounty	EDDY	
	11. Elevation (Show w		R, RKB, RT, GR, 2' GR	etc.)	:			
12 Check A	appropriate Box to In			Report o	r Other Da	ata		
NOTICE OF INTI	** *	Idicate 1		BSEQUEN			•	
PERFORM REMEDIAL WORK	PLUG AND ABANDON	· 🗆	REMEDIAL WORK	·			G CASING	
TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DRIL	LING OPNS.		LUG AN		
PULL OR ALTER CASING	MULTIPLE	m 1,	CASING TEST AN	,	\neg "	RANDO	NMENT	
FOLL ON ALTEN CASING	COMPLETION		CEMENT JOB	•	lul			
OTHER:			CEMENT JOB	-				X
	COMPLETION ed operations. (Clearly s	state all po	OTHER: FRAC ertinent details, and	give pertinen			imated date	
OTHER: 13. Describe proposed or complet of starting any proposed work). or recompletion. 12/22/06 - 01/02/07 MIRU	ed operations. (Clearly s SEE RULE 1103. For I PULLING UNIT. NU BO DLLAR AT 8665' AND 19 5 1/2" CASING SCRAPER D AROUND. PUMP AND SPACE OUT. PRESSURE I (10H), 7982' (9H) AI	otate all pomultiple (1) OPS. RIF 5' OF FI R AND 2 SPOT 500 UP ON TI ND 7760	OTHER: FRAC ertinent details, and Completions: Atta H W/ 4 3/4" BIT LOAT SHOE, PBTD 7/8" TUBING TO DO GALS 15% HCL JBING AND FIRE (8H). START	AND 2 7/8" AT 8680'. 8675'. TES ACID AT PB	WORK STRI CIRCULATE ST CASING TD. POOH T HOLES AS	NG. TAHOLE OTO 5000 W/ TUBIFOLLOW	imated date ompletion GAT CLEAN. #, OK. NG. RIH IS: 8672' S ACID	
OTHER: 13. Describe proposed or complet of starting any proposed work). or recompletion. 12/22/06 - 01/02/07 MIRU 8663'. DRILL OUT FLOAT COPOOH. RIH W/ 4 3/4" BIT, PUMP 1000 GALS PICKLE ACTI W/ TCP GUN ASSEMBLY AND SI (12H), 8440' (11H), 8205' SPOT 21.3 BPM AT 4336 PSI TUBING, RDMO. CONTINUED	ed operations. (Clearly s SEE RULE 1103. For I PULLING UNIT. NU BO DILAR AT 8665' AND 19 5 1/2" CASING SCRAPED O AROUND. PUMP AND SPACE OUT. PRESSURE I (10H), 7982' (9H) AN ISDP 900 PSI. FLOW	ops. RIH 5' OF FL R AND 2 SPOT 500 UP ON TL ND 7760' W WELL E	CEMENT JOB OTHER: FRAC ertinent details, and Completions: Atta H W/ 4 3/4" BIT LOAT SHOE, PBTD 7/8" TUBING TO DO GALS 15% HCL JBING AND FIRE (8H). START BACK. POOH AND	AND 2 7/8" AT 8680'. 8675'. TES ACID AT PB SUNS. SHOOTACID JOB, PI LAY DOWN TO	WORK STRII CIRCULATE ST CASING TD. POOH T HOLES AS JMP AWAY 5 CP GUNS, A	NG. TA HOLE O TO 5000 W/ TUBI FOLLOW 000 GAL LL GUNS	imated date ompletion G AT CLEAN. #, OK. NG. RIH IS: 8672' .S ACID FIRED. LI	D
OTHER: 13. Describe proposed or complet of starting any proposed work). or recompletion. 12/22/06 - 01/02/07 MIRU 8663'. DRILL OUT FLOAT COPOOH. RIH W/ 4 3/4" BIT, PUMP 1000 GALS PICKLE ACTIV/ TCP GUN ASSEMBLY AND SI (12H), 8440' (11H), 8205' SPOT 21.3 BPM AT 4336 PSI TUBING, RDMO. CONTINUED I hereby certify that the information above SIGNATURE Type or print name KANICIA CARRI	ed operations. (Clearly s SEE RULE 1103. For I PULLING UNIT. NU BO DILAR AT 8665' AND 19 5 1/2" CASING SCRAPED O AROUND. PUMP AND SPACE OUT. PRESSURE I (10H), 7982' (9H) AN ISDP 900 PSI. FLOW	ops. RIH 5' OF FL R AND 2 SPOT 500 UP ON TL ND 7760' W WELL E	OTHER: FRAC ertinent details, and Completions: Atta H W/ 4 3/4" BIT LOAT SHOE, PBTD 7/8" TUBING TO 100 GALS 15% HCL JBING AND FIRE (8H). START BACK. POOH AND	AND 2 7/8" AT 8680'. 8675'. TES ACID AT PB GUNS. SHOOT ACID JOB, PI LAY DOWN TO	WORK STRII CIRCULATE ST CASING TD. POOH T HOLES AS JMP AWAY 5 CP GUNS, A	NG. TA HOLE O TO 5000 W/ TUBI FOLLOW 000 GAL LL GUNS	imated date ompletion G AT CLEAN. #, OK. NG. RIH IS: 8672' S ACID S FIRED. LI	D
OTHER: 13. Describe proposed or complet of starting any proposed work). or recompletion. 12/22/06 - 01/02/07 MIRU 8663'. DRILL OUT FLOAT COMPOOH. RIH W/ 4 3/4" BIT, PUMP 1000 GALS PICKLE ACTION W/ TCP GUN ASSEMBLY AND SIGNATURE Type or print name KANICIA CARRICTHIS SPACE FOR STATE OF THE	ed operations. (Clearly s SEE RULE 1103. For I PULLING UNIT. NU BO DILAR AT 8665' AND 19 5 1/2" CASING SCRAPED O AROUND. PUMP AND SPACE OUT. PRESSURE I (10H), 7982' (9H) AN ISDP 900 PSI. FLOW	state all pomultiple (COPS. RIFEST OF FLEST OF F	CEMENT JOB OTHER: FRAC ertinent details, and Completions: Atta H W/ 4 3/4" BIT LOAT SHOE, PBTD 7/8" TUBING TO DO GALS 15% HCL JBING AND FIRE H (8H). START BACK. POOH AND The provided of the state of t	AND 2 7/8" AT 8680'. 8675'. TES ACID AT PB GUNS. SHOOT ACID JOB, PI LAY DOWN TO	WORK STRII CIRCULATE ST CASING TD. POOH T HOLES AS JMP AWAY 5 CP GUNS, A	NG. TA HOLE OF TO 5000 W/ TUBI FOLLOW 000 GAL LL GUNS	imated date ompletion G AT CLEAN. #, OK. NG. RIH IS: 8672' .S ACID FIRED. LI	.D