

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
SUNDRY NOTICES AND REPORTS ON WELLS

OCD-ARTESIA
S

FORM APPROVED
OMB NO. 1004-0135
EXPIRES: March 31, 2007

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals

SUBMIT IN TRIPLICATE

1a. Type of Well ☒ Oil ☐ Gas Well ☐ Other _____ DEC 10 2008
2. Name of Operator
DEVON ENERGY PRODUCTION COMPANY, LP
3. Address and Telephone No.
20 North Broadway, Oklahoma City, OK 73102 405-235-3611
4. Location of Well (Report location clearly and in accordance with Federal requirements)*
1980 FNL 1980 FEL SEC 26 T23S R31E

5. Lease Serial No.
NMNM0405444-A
6. If Indian, Allottee or Tribe Name
7. Unit or CA Agreement Name and No.
8. Well Name and No.
Todd 26G Federal 1
9. API Well No.
30-015-20242
10. Field and Pool, or Exploratory
Atoka
Ingle Wells, Delaware
11. County or Parish State
Eddy NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other Run casing
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13 Describe Proposed or Completed Operation Clearly state all pertinent details, including estimated starting date any proposed work and approximate duration thereof. If the proposal deepen directionally or recomple horizontally, give subsurface location and measured and true vertical depths of all pertinent markers and zones Attach the Bond under which the work will be performed or provide the Bond No on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection

Run Casing and restore production in Atoka Bank.

8/22/08 -11/23/08

OWU. RIH to fish, tag up. Press 1500#. POOH w/ tbg, BHA, WP & shoe. BTM 95% worn; 1/4" into shoe. RIH w/ tbg to TOF. POOH w/ tbg, BHA & box tap 2 pieces mtr housing inside tap & btm skirt, split. RIH w/ new 6" shoe w/ 6 1/4" smooth OD & mesh ID, 6" WP, BHA & tbg. Tag Fish 10' above cut & wash dn. CHC. TOF tag 1' deeper split. CHC & rec iron & cuttings. Pull 82 jts tbg. OWU. RIH w/ tbg to TOF, PU swivel & tag. Mill & made 4" hole. CHC. RD bgl line to CO. POOH. Tbg parted. BHA & 5 jts tbg in hole. POOH w/ KS & RIH w/ 5 3/4" OS w/ 3 1/16" graphel, BS, Jars, 2 DC's. LO to fish @ 13,230' & free. POOH w/ tbg & LD OS & BHA. Pull 5 jts tbg & WP BHA. Crown on shoe 10% worn, beveled toward ID of shoe @ btm, mesh ID of shoe worn 70%. RIH w/ new shoe, WP BHA & 40 jts tbg. Tag @ 13,555.5'. EOM @ 13,557'. Press to 400#. Circ btms & rec curly metal cuttings. RD swivel. RIH. TOF & tag @ 13,557.5'. Mill & rec 1/2 g iron cuttings. Show torque, stalled out. POOH. Shoe catching on csg collars. Run perf below SM. Tag @ 4864'. PU, torque up & stuck. WP 30 mins, free, CHC. Mill 10% worn. Run 4' perf sub, String Mill, Jars, 2 - 4 3/4" DC's & tbg. Tag @ 4875' & start milling. Light torque, moderate & extreme torque. CHC. RD swivel & POOH w/ Mill worn dn, CHC rec chunks cmt. TOOH w/ SM found less than 6 1/2" OD. Shoe would not come up into patch. LD DC's. CHC. RIH w/ shoe. Tag @ 13,555'. EOM @ 13,557'. POOH w/ tbg & start jarring on fish until free. WP & shoe stuck top of csg. RIH & DO CIBP. Model D pkr @ 13,760' w/ cmt on top. Btm producing perfs are 13,713'. Dump 20/40 sd plug. Tag @ 13,404'. CO sd plug to 13,520'. CO WH. MIRU BASIC #34 drlg rig & run 5 1/2" csg. Tag csg patch @ 4898'. Could not work through. LD csg. RIH w/ SM to ream out tight spot. RIH w/ csg & landed @ 12,513'. Cmt w/ 495 sx, RDMO Basic 34. Ran CBL & TOC @ 3200'. MIRU Service unit. Found 1600# on 5 1/2" annulus. CO to 13,736' (20' below perfs). RIN w/ BHA. NU tree. Swab. Acidize w/ 5000 g 15% HCL & 75 BS. RU & RIH w/ swab. Pump 50 bbls 2% KCL wtr dn tbg. Rise pkr. RIH w/ 14 jts 2 7/8" N-80 tbg, TA & 380 jts 2 7/8" N-80 tbg. ND BOP. Set TA. Flange WH. CO to run rods. RIH w/ rods and pump. LH w/ 33 bbls wtr. RD PU. POP.

ACCEPTED FOR RECORD

14. I hereby certify that the foregoing is true and correct

Name
Signed *Judy A. Barnett*

Name
Title Judy A. Barnett
Regulatory Analyst

Date
DEC 10 2008
12/2/2008

Gerry Guye, Deputy Field Inspector
NMOCD-District II ARTESIA
Date

Approved by _____ Title _____

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Note to U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations to any matter within its jurisdiction.

*See Instruction on Reverse Side

ACCEPTED FOR RECORD

DEC 7 2008
J. Barnett
BUREAU OF LAND MANAGEMENT
CARLSBAD FIELD OFFICE