Submit 3 Copies To Appropriate District Office	State of New Mexico				Form C-103
District I	Energy, Minerals	and Natu	ral Resources	WELL ABINO	Revised May 08, 2003
625 N. French Dr., Hobbs, NM 88240				WELL API NO.	
<u>District II</u> 1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION DIVISION			30-015-32898	
District III				5. Indicate Type of Lease STATE FEE	
1000 Rio Brazos Rd., Aztec, NM 87410 Sonta Fo. NIM 87505			STATE [6. State Oil & G		
District IV 1220 S. St. Francis Dr., Santa Fc, NM				[
87505				E	3-8096
SUNDRY NOTICES AND REPORTS ON WELLS				7. Lease Name of	or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A				TDC 8 State	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)				100	3 0 State
1. Type of Well:				8. Well Number	
Oil Well Gas Well Other				1	
				0. OCPID Number	
2. Name of Operator Threshold Development Company				9. OGRID Number 23032	
				10. Pool name or Wildcat	
3. Address of Operator 777 Taylor St Penthouse 2 - Ft. Worth, TX 76102				Und. Queen-Grayburg-San Andres	
4. Well Location					
	4050	Caudh		220	Wost
Unit Letter :	1650 feet from the	South	line and	330 feet fro	m the West line
Section 8	Township	19S R	ange 29E	NMPM Eddy	Country
Section 8					County
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3375' GR					
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data					
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:					
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING					
FERFORIN REINEDIAL WORK	FLUG AND ABANDON	`	REMEDIAL WOR	` <u> </u>	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS		COMMENCE DRI	LLING OPNS	PLUG AND
				_	ABANDONMENT
PULL OR ALTER CASING	MULTIPLE		CASING TEST AN	4D	
	COMPLETION		CEMENT JOB		
OTHER:			OTHER: Perfora	te, acidize & frac	V
13. Describe proposed or comp	leted operations. (Cle	arly state a	Il pertinent details,	and give pertinent o	dates, including estimated date
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion					
or recompletion.					
8-21-2003 - Cleaned location	on and set anchors	Moved in	nulling unit		
8-21-2003 - Cleaned location and set anchors. Moved in pulling unit. 8-22-2003 - Rigged up pulling unit. Nippled up BoP. Unloaded tubing. RIH with bit, scraper and tubing and					
tagged up at 2889'. Pumped 350 gallons 15% acid down tubing followed with 42 bbls fresh water. Pumped 70					
bbls 2% KCL water down backside, circulating fresh water and acid to pit. Left well loaded with 2% KCL water.					
POOH with tubing, scraper and bit. Shut well in for night.					
8-23-2003 - Rigged up wireline and ran CBL log. RIH and perforated 2271-2306' w/70 .42" holes (2 SPF -					
Penrose Sand). TOOH and rigged down wireline. RIH with packer, tubing and 2 joints of tailpipe. Set with					
tailpipe at 2241'. Seating nipple at approximately 2169'. Swabbed. Shut well in for weekend.					
8-26-2003 - Unset packer a	nd TOOH. Rigged u	p wireline	. RIH and perfora	ted 2190-2250' w	 //49 .42" holes as
follows: 2190-2210' and 22	23-2250' (1 SPF). T	OOH and	riaged down wire	line. RIH with pa	cker and tubing and
set packer at 2258'. Swabb					
·					
	CONTINUE	ON NEX	(T PAGE:		
I hereby certify that the information at	ove is true and comple	te to the b	est of my knowledge	e and belief.	
$V \leftarrow V $,		, ,		
SIGNATURE THE SIGNATURE	'un	TITLE	Agent		_DATE_11/2/03
Type or print name Rusty Klein					740 0450
	<u></u>			Telepl	none No. 748-2159
(This space for State use)					mma 4 7 0000
APPPROVED BY	r records (DNITA			DEC 17 2003
Conditions of approval, if any:					
continuing of approval, it ally.					

THRESHOLD DEVELOPMENT COMPANY TDC 8 State #1 Section 8-Tl9S-R29E Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

8-27-2003 – Swabbed. Acidized perforations 2190-2250' with 1000 gallons 15% acid and ball sealers. Swabbed. Shut well in for night.

8-28-2003 – Swabbed. Unset packer and TOOH. RIH with packer and RBP. Set RBP at 2265' and packer at 2257'. Pressure tested packer and plug to 2000 psi, OK. Unset packer. Loaded hole and spotted 2 bbls 15% acid. Pulled packer up and set at 2089'. Acidized perforations 2190-2250' with 3000 gallons 15% acid and ball sealers. Swabbed. Shut well in for night.

8-29-2003 – Swabbed. RIH and unset packer and RIH to catch RBP. Circulated balls off RBP. Latched onto RBP and released. POOH with tools. RIH with tubing and POOH. Nippled down BOP and wellhead. Shut wel in for night.

8-30-9-2-2003 - Prep to frac on 9-2-2003.

9-3-2003 – Frac'd perforations 2190-2306' (Penrose Sand) via 5-1/2" casing with 73500 gallons 25# Borate Viking crosslinked gel and 151500# 16-30 Brady sand. Flowed well back for cleanup. Shut well in for night. Prep to clean out to PBTD.

9-4-2003 – Nippled down frac valve and nippled up BOP. TIH with notched collar and tubing and tagged sand at 2791'. Circulated and washed sand to 2890' (PBTD). TOOH. TIH with production equipment as follows: 1 joint of 2-7/8" tubing with bull plug on bottom, 2-7/8" x 3' perforated nipple, seating nipple at 2008', 64 joints 2-7/8" tubing . RIH with rods and pump. Spaced out.

9-5-2003 – Built base for pumping unit. Began beam pumping to frac tank.

Rust Klein

Agent

November 2, 2003