Submit 3 Copies To Appropriate District Office	State of Energy, Minerals	f New Mexi			Form C-103 June 19, 2008
1625 N. French Dr., Hobbs, NM 88240 District II				WELL API NO. 30-005-63654	
1301 W. Grand Ave., Artesia, NM 88210 District III 1000 Rio Brazos Rd., Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505			5. Indicate Type STATE 6. State Oil & G	☐ FEE ⊠	
		EPEN OR PLUG RM C-101) FOR		Barnard 3B	or Unit Agreement Name
1. Type of Well: Oil Well Gas Well Other		RECEIVED		8. Well Number #1 9. OGRID Number	
2. Name of Operator Sovereign Eagle, LLC		APR 1 9 2010		263940	
3. Address of Operator PO Box 968, Roswell NM 88202-09	968 .	NMOCD	ARTESIA	10. Pool name o Wildcat	r Wildcat
4. Well Location Unit Letter B :	_660'feet from th		line and _19		om the <u>East</u> line
Section 3	Township		nge 29E	NMPM	County Chaves
	11. Elevation (Show w 4354' GR	neiner DR, R	KB, K1, GK, eic.,		
12. Check A	ppropriate Box to In	ndicate Nat	ure of Notice,	Report or Other	Data
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING DOWNHOLE COMMINGLE	FENTION TO: PLUG AND ABANDOI CHANGE PLANS MULTIPLE COMPL		SUB REMEDIAL WOR COMMENCE DRI CASING/CEMEN	LLING OPNS.	PORT OF: ALTERING CASING ☐ PAND A
OTHER:			OTHER:	NEW CONT	
13. Describe proposed or complete of starting any proposed wor or recompletion.					
SEE ATTACHMENT					
Spud Date: 04/28/04	Rig	Release Date:	05/15/04		
I hereby certify that the information a	bove is true and comple	ete to the best	of my knowledge	e and belief.	
SIGNATURE Trans Front S. Mars	TIT		r of Operations		ΓΕ <u>04/15/10</u>
Type or print name Frank S. Morga For State Use Only	<u>ш</u> Е-п		fmorgan@strata		NE: 575-622-1127
APPROVED BY: Conditions of Approval (if any):	Mi TITI	LE Liability of C-103 which ma	d for plugging of well under bond is retaine (Subsequent Report iv be found at OCD V ww.cmnrd.state.nm.u	of Well Plugging) Web Page under	TE 4/19/2010

SOVEREIGN EAGLE, LLC TULE FIELD BARNARD 3B #1 WORKOVER REPORT SECTION

ROOSEVELT CO, NEW MEXICO

API#

Elevation KB

TD PBTD

1-20-10-	Meet w/ Mayo Marr's representative on location to begin plugging Operations. Notified OCD Artesia to commence operations.
1-21-10-	MI water tank and equipment.
1-22-10-	MI Service rig and equipment. Prepare to RU weather permitting.
1-25-10-	Continue moving equipment to location.
1-26-10-	RU Mayo Marr's Unit. Flow well down. ND well-head and NU BOP. Start out of hole w/ tbg. Prep. To PU work string and TIH. Notified OCD Artesia.
1-27-10-	TIH w/ 4" Notched collar. Tag up @ 850'. Turn on top of plug for 5 Hrs. TOH w/ notched collar. PU Pkr and TIH. Set Pkr @ 120'. Pressure to 1000# for 10 minutes. No decrease in pressure. Rel. Pkr and TOH. SISD. Witnessed by OCD Artesia.
1-28-10-	WO OCD.
1-29-10-	SISD due to weather.
1-30-10-	SISD due to weather.
1-31-10-	SISD due to weather.
2-1-10-	Set cement plug from 850' back to 305'. WOC 4 hrs. TIH and tag TOC @ 305'. TOH and lay down work string. RU & TIH w/ CIBP. Set CIBP @ 300'. TOH w/ wire-line. TIH w/ guns. Perf 18 .42 holes for water well. TOH w/ guns. RU and pressure csg to 750#. Break back to 100#. Pump 2 BPM @ 80#. Prep to rig down. Prep to Trench Bury Pit. Rel. Mayo Marr's. Release well to Barnard Ranch. Water We //