

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals & Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P. O. Box 1980, Hobbs, NM 88240
DISTRICT II
P. O. Drawer DD, Artesia, NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P. O. Box 2088
Santa Fe, NM 87504-2088

WELL API NO. 30-015-05172
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-2613

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1 Type of Well: OIL <input checked="" type="checkbox"/> GAS <input type="checkbox"/> WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	RECEIVED MAR - 8 2004
2. Name of Operator The Wiser Oil Company	8. Well No. 3
3. Address of Operator P.O. Box 2568 Hobbs, New Mexico 88241 (505) 392-9797	9. Pool name or Wildcat Grayburg Jackson
4. Well Location Unit Letter <u>P</u> : <u>660</u> Feet From The <u>South</u> Line and <u>660</u> Feet From The <u>East</u> Line Section <u>16</u> Township <u>17S</u> Range <u>31E</u> NMPM <u>Eddy</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3843' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <u>Clean Out</u> <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11/14/03 MIRU Eunice Well Service. ND WH. RU BOP. RIH w/6-1/8" cone bit, DC's & 2-7/8" work string to 1948'. Could not move. Pull loose @ 20,000# over tbg. wt. POH w/2-7/8" work string, DC's & bit.

11/15/03 RU reverse unit. RIH w/6-1/2" cone bit, DC's & 2-7/8" work string to 1948'. Could not drill. POH w/tbg., DC's & bit. RIH w/2-3/8" notch collar, 2 jts. 2-3/8" tbg., crossover & 2-7/8" tbg. Stacked out @ 2010'. POH w/2-7/8" tbg. LD 2-3/8" tbg.

11/18/03 RIH w/6-1/8" tapered mill w/guide extention, DC's & 2-7/8" tbg. Tag @ 1948'. Mill to 2040'. Tag @ 2080'. Mill to 2100'. Tbg. plugging off. RIH w/6-1/8" cone bit, DC's & 2-7/8" tbg. to 1800'.

11/19/03 Tag @ 2050'. Drill to 2290'. Lost circulation. POH w/tbg. LD DC's & tools. RIH w/2-7/8" notched collar & 2-7/8" tbg. Tag @ 2300'. Would not work down. POH. LD all 2-7/8" work string & tools. RD BOP. NU WH. Left open to flowline. RDMO. Waiting on orders.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE January 29, 2004
TYPE OR PRINT NAME Mary Jo Turner TELEPHONE NO. (505) 392-9797

(This space for State Use)

APPROVED BY

TITLE DATE

CONDITIONS OF APPROVAL, IF ANY: