

State "FW" No. 1  
Redlake Queen, Grayburg, San Andres  
Eddy County, New Mexico  
Plug and Abandonment Procedure

1. Rig up service unit.
2. Spot a 150-foot, 40 sack Class "H" cement plug in the 7-inch casing 1300'-1450' across the top of the Queen formation (1405').
3. Spot 10-sack plug to surface and weld on cap.
4. Erect plug and abandonment marker with location description as follows:

State "FW" No. 1  
Unit J, Section 31, T-17-E, R-28-E

5. Clean up location and restore ground to contour.

Note: 1. Leave mud laden fluid between plugs.

2. Check and make sure the 7-inch annulus is not open at the surface. If open, it will be necessary to spot a 20 sack cement plug to surface in the annulus also.