

30-015-03824

36°4' N / 1650 E - 2-16-30

Salado OP. L.L.C.

E. Henshaw Ut Tr. 9 #7

Before

1. Run & set CIBP w/ 35' cement @ 2862'.
or Run tubing to 2862'.
Set 25 sx cement Plug @ 2862'-2762'. TAG

2. Circulate brine gel.

3. Perforate 2 7/8" casing @ 1500'.

4. Run in hole with packer.

Squeeze 100' cement Plug inside & outside 2 7/8" csg. TAG

5. Set tubing @ 500'.

Circulate cement to surface inside & outside 2 7/8" casing.
Pull tubing and top off cement to surface.

6. Erect dry hole marker,

cut & level all pits, cut deadmen
& clear location of junk.

TOC @
1955'

Perfs - 2962'-72'

2 7/8" hole

2 7/8" casing

set @ 3005'

cemented w/ 250 sx

1" from 500' to surface.

Temp. survey TOC

cement 3002'-1955', 518'-surface