

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. OIL

SUBMIT IN TRIPLICATE *
(Other Instructions on
reverse side.)

Budget Bureau No. 1004-0135
Expires August 31, 1985

CISF

SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT - " for such proposals.)		5. BASE DESIGNATION AND SERIAL NO. LC-029419-A	
1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/> WIW - P & A		7. UNIT AGREEMENT NAME Skelly Unit	
2. NAME OF OPERATOR The Wiser Oil Company		8. WELL NO. 42	
3. ADDRESS OF OPERATOR P.O. Box 2568 Hobbs, New Mexico 88240 (505) 392-9797		9. API WELL NO. 30-015-05356	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FNL & 1880' FEL Unit B		10. FIELD AND POOL, OR WILDCAT Grayburg Jackson 7-Rivers-QN-GB-SA	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 22-T17S-R31E	
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3875' DF	12. COUNTY OR PARISH Eddy County	13. STATE NM

16. Check Appropriate Box to indicate Nature of Notice, Report, or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT * <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	(Other) <input type="checkbox"/>
(Other) <input type="checkbox"/>		(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS: (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Wiser Oil respectfully request approval to plug and abandon the well by the procedure listed below.

Surface Casing: 8-5/8" set @ 616'. Production Casing: 4-1/2" set @ 3764' 11.60#

Perfs: 3188'-3606' 2283'-2400' CIBP @ 2100' & 3106' w/40 cement on plug

1. Spot 50' plug on CIBP @ 2100'.
2. Perforate csg. @ 1700'. Place 100' of cement @ 1600'-1700' inside & outside of 4-1/2" csag. Tag cmt.
3. 9# mud.
4. Perforate casing @ 670'. Circulate cement to surface. Leave a 100' plug @ 570'-670'.
5. Tag cement.
6. Spot 60' cement plug to surface.
7. Install dry hole marker.
8. Clean location.

APPROVAL SUBJECT TO
GENERAL REQUIREMENTS AND
SPECIAL STIPULATIONS ATTACHED

18. I hereby certify that the foregoing is true and correct.

SIGNED Mike Jones TITLE Superintendent DATE November 7, 2002

(This space for Federal or State office use)

APPROVED BY (ORIG. SGD.) ALEXIS C. SWOBODA PETROLEUM ENGINEER DATE NOV 14 2002

CONDITIONS OF APPROVAL, IF ANY:

Accepted for Instruction On Reverse Side