

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND NUMBER

LC 055958

6. IF INDIAN ALLOTMENT

MAY 26 1986

O. C. D.

7. UNIT AGREEMENT NAME
Grayburg Jackson (San Andres)

8. FARM OR LEASE NAME

GJSAU

9. WELL NO.

32

10. FIELD AND POOL, OR WILDCAT

Grayburg Jackson GB/SA

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

13-T17S-R30E

12. COUNTY OR PARISH

Eddy

13. STATE

NM

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER Water Injection Well
2. NAME OF OPERATOR
Burnett Oil Co., Inc.
3. ADDRESS OF OPERATOR
1500 InterFirst Tower, Fort Worth, TX 76102
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
Unit Letter "D", 660' FNL, 660' FWL, Sec. 13, T17S, R30E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3727 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Unsuccessful casing repairs necessitated this well to be plugged & abandoned.
Intention to plug was approved 3/17/86. Plugging and abandoning was as follows:

4/29/86 Set Cast Iron Bridge Plug @ 3244', with cement plug to 3200'. Loaded hole with 9# gelled water. Set packer @ 2253', attempted to pump into leaky casing; not successful @ 2000 psi. As per Joe Mirabal of BLM, set cement retainer @ 2253' with 32 sk continuous cement plug from 2253'-1800'.

4/30/86 Tag cement @ 1795'. Perforated 4½" casing @ 1300', 2 holes. Set cement retainer @ 1188'. BJ Titan squeezed base of salt with 150 sks. Cl C, 2% CaCl₂. Left 5' cement on retainer. Perforated 4½" casing @ 444'. Broke circulation down 4½" casing and out 8-5/8" surface pipe.

5/ 1/86 BJ Titan cemented 444' to surface with 130 sks. Cl C and 25 sks. Cl C, 2% CaCl₂. Circulated 15 sks. to pit. Did not displace cement from 4½" casing. Installed permanent 4" X 6' marker.

5/ 5/86 Ripped road & location, covered pits, reseeded as per BLM specs.
Location ready for inspection.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Production Superintendent

DATE 5/6/86

(This space for Federal or State office use)

Orig. Sgd. _____

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

5-22-86

*See Instructions on Reverse Side

Post FD-2
6-6-86
14A

