

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

CISK
OP


DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

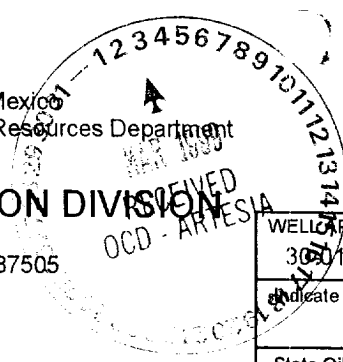

WELL API NO.
300104555

Indicate Type of Lease
STATE FEE

State Oil & Gas Lease No.
E-2211

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

Lease Name or Unit Agreement Name
(Yates) State

Type of Well:
OIL WELL GAS WELL OTHER

Name of Operator
Jalapeno Corporation

Well No.
1

Address of Operator
P.O. Box 1608 Albuquerque, New Mexico 87103-1608

Pool name or Wildcat
Benson Queen Garayburg North

Well Location
Unit Letter G : 1980 Feet From The North Line and 1980 Feet From The East Line
Section 32 Township 18S Range 30E NMPM Eddy County

Elevation (Show whether DF, RKB, RT, GR, etc.)
3422 GR

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK PLUG AND ABANDON
TEMPORARILY ABANDON CHANGE PLANS
PULL OR ALTER CASING
OTHER:

REMEDIAL WORK ALTERING CASING
COMMENCE DRILLING OPNS. PLUG AND ANBANDONMENT
CASING TEST AND CEMENT JOB
OTHER:

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 10-29-98--Inform OCD of intent to plug
- 10-30-98--MIRU, lay down rods, pooh w/tbg
- 11-03-98--RIH w/5 1/2 CIBP, set down @ 185', RIH w/bit and scraperto 2900', set CIBP @ 2887', mix and circ. 9.8# mud, would not circ., spot 60 sx C cement, POOH
- 11-04-98--Tag plug @ 2281', cut csg @ 1429'
- 11-05-98--P/U on csg, not free, pull 40,000# on csg, cut csg, still not free, talk to OCD, E.L.Gonzales, okayed to spot 20 sx plug, spot 20 sx cement from 1485'
- 11-06-98--Tag cement @ 1367'
- 11-09-98--Perf 4 holes @ 440', set packer @ 235', sqz 50 sx cement, displace to 275', WOC 4 hrs Tag cement @ 270', set 20 sx cement from 60' to surface, Fluid level dropped to 27', SION
- 11-10-98--Tag surface plug @ 25', Spot cement to surface, Cut off well head, install dry hole marker cut off anchors, clean location, RDMO

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Russ Light TITLE Manager, Key Energy Services, P&A DATE 11-30-98

TYPE OR PRINT NAME Russ Light TELEPHONE NO. (915) 523-5155

(This space for State Use)

APPROVED BY [Signature] TITLE Wild Dog ID DATE JUL 15 2002

CONDITIONS OF APPROVAL, IF ANY: