

Operator Ready Oil & Gas Mngt.
Well Turner Federal #7
Unit 0 Section 13 Township 20 Range 28
API # 30-015-02361

TOPS

Solade ~ 475'
B Salt ~ 650'
gases ~ 750'

← 60' surface Plug.

- * Contact OCD 24 hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.

2
0
No Casing Records
Procedure May
change.

← 475' Cement Plug Inside & Outside Casing. TAG
Shoe Plug / Top Salt Plug.

← Cement Plug from TD - 650'. Shoe Plug / Base Salt Plug. TAG

MS