	DFPARTM	Eise OF THE		OR verse side)			ITERU No. 42-R14	
		EOLOGICAL SU		VI Verse Bide)		NM-05143		
SUND (Do not use this for	DRY NOTIO	CES AND RE		DN. WELLS Back to a different test Doir. roposala.)			TTEE OR TRIBE WAS	
1. GA8 G. 1975					7.	7. UNIT AGREEMENT NAME		
2. NAME OF OPERATOR						8. FARM OR LEASE NAME		
Morris R. Antweil \mathcal{V} O. C. C.						Western Reserves F		
8. ADDRESS OF OPERATOR			AR	TEBIA, UFFICE		WELL NO.		
		os, New Me			2			
4. LOCATION OF WELL (Rej See also space 17 below	port location clea	arly and in accordan	ce with any	State requirements.*		FIELD AND POOL		
At surface 2932' FNL & 1980' FEL Sec. 4-T21S-R26E						Avalon-Strawn 11. BEC., T., R., M., OR BLK. AND		
47JL	END & T	700 FEL (Sec. 4.	-1215-K20E		-T21S-R2	REA	
14. PERMIT NO.		15. ELEVATIONS (She	w whether DF	, RT, GR, etc.)	12.	COUNTY OR PAR	ISH 13. STATE	
		3190'	GR		E	ddy	New Me	
16.	Check Ann	ropriate Roy To	Indicate N	lature of Notice, Report,		Date		
20	TICE OF INTENT		manuale IN			REPORT OF:		
	r					ABPORT OF:	·1	
TEST WATER SHUT-OFF		LL OR ALTER CASING	·	WATER SHUT-OFF		REPAIRIN		
FRACTURE TREAT Shoot or acidize		ULTIPLE COMPLETE		FRACTURE TREATMENT SHOOTING OR ACIDIZING		ALTERING ABANDON		
REPAIR WELL		IANGE PLANS		(Other) Repair			X	
(Other)	ليب			(NOTE: Report r Completion or Re	esults of m	ultiple completi	on on Well	
TD 11,000 indicatin casing at	PBTD 9 g casing 3252'.	990' Teste 1eak. Lo Cemented	ed casi ocated with 1	t details, and give pertinent ions and measured and true ing above packe casing leak at .50 sx. Class ''	r set 3177 C ¹¹ Cer	at 9753 '. Perfenent. W	vers and zones per vorated OC	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	PBTD 9 g casing 3252'. Drilled with 200 cement.	990' Teste leak. Lo Cemented out cement sx. Class Test cas	ed casi ocated with 1 t. Wou s "C" c Sing w/	ing above packe casing leak at 50 sx. Class " 11d not pressur ement w/3#/sx. 1500 psi for 2	r set 3177 C" Cer e-test salt. 0 mins	at 9753 '. Perfenent. W t. Squee WOC 36	vers and zones per orated OC eze brs	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	PBTD 9 g casing 3252'. Drilled with 200 cement.	990' Teste leak. Lo Cemented out cement sx. Class Test cas	ed casi ocated with 1 t. Wou s "C" c Sing w/	ing above packe casing leak at .50 sx. Class "	r set 3177 C" Cer e-test salt. 0 mins	at 9753 '. Perfenent. W t. Squee WOC 36	vers and zones per orated OC eze brs	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	PBTD 9 g casing 3252'. Drilled with 200 cement.	990' Teste leak. Lo Cemented out cement sx. Class Test cas	ed casi ocated with 1 t. Wou s "C" c Sing w/	ing above packe casing leak at 50 sx. Class " 11d not pressur ement w/3#/sx. 1500 psi for 2	r set 3177 C" Cer e-test salt. 0 mins	at 9753 '. Perfenent. W t. Squee WOC 36	vers and zones per orated OC eze brs	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	PBTD 9 g casing 3252'. Drilled with 200 cement.	990' Teste leak. Lo Cemented out cement sx. Class Test cas	ed casi ocated with 1 t. Wou s "C" c Sing w/	ing above packe casing leak at 50 sx. Class " 11d not pressur ement w/3#/sx. 1500 psi for 2	r set 3177 C" Cer e-test salt 0 mins etion	at 9753 '. Perfenent. W t. Squee WOC 36 s w/no do	vers and zones per orated OC eze hrs. ecline	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	PBTD 9 g casing 3252'. Drilled with 200 cement.	990' Teste leak. Lo Cemented out cement sx. Class Test cas	ed casi ocated with 1 t. Wou s "C" c Sing w/	ing above packe casing leak at 50 sx. Class " 11d not pressur ement w/3#/sx. 1500 psi for 2	r set 3177 C" Cer e-test salt 0 mins etion	at 9753 '. Perfenent. We t. Squee WOC 36 s w/no do	vorated OC eze hrs. ecline	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	PBTD 9 g casing 3252'. Drilled with 200 cement.	990' Teste leak. Lo Cemented out cement sx. Class Test cas	ed casi ocated with 1 t. Wou s "C" c Sing w/	ing above packe casing leak at 50 sx. Class " 11d not pressur- ement w/3#/sx. 1500 psi for 2 15 Strawn Compl	r set 3177 C" Cer salt salt o mins etion	at 9753 '. Perfenent. We t. Squee WOC 36 s w/no do CEIVE R 1 1 1975	vorated OC eze hrs. ecline	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	PBTD 9 g casing 3252'. Drilled with 200 cement.	990' Teste leak. Lo Cemented out cement sx. Class Test cas	ed casi ocated with 1 t. Wou s "C" c Sing w/	ing above packe casing leak at 50 sx. Class " 11d not pressur- ement w/3#/sx. 1500 psi for 2 15 Strawn Compl	r set 3177 C" Cer e-test salt 0 mins etion RE AP	at 9753 '. Perfenent. We t. Squee WOC 36 s w/no do	kers and zones per orated OC eze hrs. ecline	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out	' PBTD 9 g casing 3252'. Drilled with 200 cement. re. Pre	990' Teste leak. Lo Cemented out cement sx. Class Test cas p to proce	ed casi ocated with 1 t. Wou sing w/ eed wit	ing above packe casing leak at 50 sx. Class " ild not pressur- ement w/3#/sx. 1500 psi for 2 h Strawn Compl	r set 3177 C" Cer e-test salt 0 mins etion RE AP	at 9753 '. Perfenent. We Squee WOC 36 WOC 36 w/no de CEIVE R 1 1 1975 CGICAL SUR NEW MEXIC	vorated OC eze hrs. ecline	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out in pressu	PBTD 9 g casing 3252'. Drilled with 200 cement. re. Pre	990' Teste leak. Lo Cemented out cement sx. Class Test cas p to proce	ed casi ocated with 1 t. Wou sing w/ eed wit	ing above packe casing leak at 50 sx. Class " 11d not pressur- ement w/3#/sx. 1500 psi for 2 15 Strawn Compl	r set 3177 C" Cer e-test salt 0 mins etion RE AP	at 9753 '. Perfenent. We Squee WOC 36 WOC 36 w/no de CEIVE R 1 1 1975 CGICAL SUR NEW MEXIC	vorated OC eze hrs. ecline	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out in pressu	PBTD 9 g casing 3252'. Drilled with 200 cement. re. Pre	990' Teste 1 eak. Lo Cemented out cement sx. Class Test cas p to proce	ed casi ocated with 1 T. Wou S''C'' c Sing w/ eed wit	ang above packe casing leak at 50 sx. Class " ald not pressur- ement w/3#/sx. 1500 psi for 2 th Strawn Comple	r set 3177 C" Cer e-test salt 0 mins etion RE AP	at 9753 '. Perfenent. We Squee WOC 36 WOC 36 w/no de CEIVE R 1 1 1975 CGICAL SUR NEW MEXIC	kers and zones per orated OC eze hrs. ecline	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out in pressu 18. I hereby certify that the SIGNED	PBTD 9 g casing 3252'. Drilled with 200 cement. re. Pre	990' Teste 1 eak. Lo Cemented out cement sx. Class Test cas p to proce	ed casi ocated with 1 t. Wou sing w/ eed wit	and measured and true v and above packe casing leak at 50 sx. Class " ald not pressur- ement w/3#/sx. 1500 psi for 20 th Strawn Comple th Strawn Comple sent	r set 3177 C" Cer e-test salt 0 mins etion RE AP	at 9753 '. Perfenent. We Squee WOC 36 WOC 36 w/no de CEIVE R 1 1 1975 CGICAL SUR NEW MEXIC DATE APR 1	Kers and zones per orated OC eze hrs. ecline ED EVEY CO 7 April 1	
TD 11,000 indicatin casing at 36 hrs. cemented Drill out in pressu	PBTD 9 g casing 3252'. Drilled with 200 cement. re. Pre	990' Teste 1 eak. Lo Cemented out cement sx. Class Test cas p to proce	ed casi ocated with 1 t. Wou sing w/ eed wit	and measured and true v and above packe casing leak at 50 sx. Class " ald not pressur- ement w/3#/sx. 1500 psi for 20 th Strawn Comple th Strawn Comple sent	r set 3177 C" Cer e-test salt 0 mins etion RE AP	at 9753 '. Perfenent. We Squee WOC 36 WOC 36 w/no de CEIVE R 1 1 1975 CGICAL SUR NEW MEXIC DATE APR 1	Kers and zones per orated OC eze hrs. ecline ED EVEY CO 7 April 1	

.

.

.

. . . .

-

1