

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-27463
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-3070
7. Lease Name or Unit Agreement Name Wagon AOG State
8. Well No. 1
9. Pool name or Wildcat Wildcat Yeso

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER TITE HOLE <input type="checkbox"/>	RECEIVED JUN 16 '94 C. C. D.
2. Name of Operator YATES PETROLEUM CORPORATION	
3. Address of Operator 105 South Fourth Street - Artesia, NM 88210	
4. Well Location Unit Letter G : 1980 Feet From The North Line and 1980 Feet From The East Line Section 32 Township 22S Range 23E NMPM Eddy County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4283' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
6-16-94 - NOTE: Notified NMOCD of plug and abandonment on June 14, 1994.
TIH w/2-7/8" tubing to 1908'. Mixed and circulated casing full of 9 ppg salt gel mud. Pull up to 1277'. Mix and spot 60 sacks Class "C" 4% CaCl2. Pulled up to 700' and wait 1 hour. Drop down and tag plug at 1133'. Pull up to 416'. Mix and spot 40 sacks Class "C" Neat. Pull up to 64'. Mix and circulate 20 sacks "C" Neat to surface. Pull out of hole with 2-7/8" tubing. Removed BOP and nipped down casing head. Cut off casing head. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 6-15-94.

NOTE: Plugging witnessed by NMOCD.

Post ID-2
7-15-99
PKA

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Production Clerk DATE 6-16-94
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505-748-1471

(This space for State Use)

APPROVED BY Mick S. Wilkfield TITLE Field Rep. DATE Dec. 13-94