State of New Mexico Energy, Minerals and Natural Resources Department

submit 3 Copies

Appropriate

and Office			•
STRICTI	OIL CONSERVATIO	N DIVISION	WELL API NO.
O. Box 1980, Hobbs, NM 88240	P.O. Box 2088		30-015-27559
STRICTII O. Drawer DD, Arlesia, NM 88210	Santa Fe, New Mexico FEB	37504-2088 1 8 1397	5. Indicate Type of Lease STATE X FEE
STRICT III 00 Rio Brazos Rd., Aziec, NM \$7410	2 × t ₂ − <u>π</u> ÷	ujo. Div.	6. State Oil & Gas Lease No. V708
DO NOT USE THIS FORM FOR PR DIFFERENT RESE	TICES AND REPORTS ON WELL OPOSALS TO DRILL OR TO DEEPEN RVOIR. USE "APPLICATION FOR PEF \$-101) FOR SUCH PROPOSALS.)	OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
Type of Well: Oil Qus WELL X WELL) on (EX		"EV" STATE
Name of Operator			8. Well No.
LOUIS DREYFUS NATUR	AL GAS CORP.		#2
Address of Operator			9. Pool name or Wildcat
14000 Quail Springs	Parkway, #600, OKC, OK	73134	Happy Valley (Delaware)
Well Location			Took
Unit Lener H : 210	00 Feet From The North	Line and660	
Section 32	Township 22S R	ange 26E	NMPM Eddy County
	10. Elevation (Show whether 3319)	DF, RKB, RT, GR, etc.)	
Check	Appropriate Box to Indicate	Nature of Notice, I	Report, or Other Data
		I SUI	BSEQUENT REPORT OF:
NOTICE OF IN	ITENTION TO:		
	AND 4541001		ALTERING CASING
RFORM REMEDIAL WORK	PLUG AND ABANDON L	REMEDIAL WORK	
	CHANGE PLANS	COMMENCE DRILLIN	NG OPNS. PLUG AND ABANDONMENT
MPORARILY ABANDON		COMMENCE DRILLIN	NG OPNS. PLUG AND ABANDONMENT
MPORARILY ABANDON ULL OR ALTER CASING		COMMENCE DRILLIN	NG OPNS. PLUG AND ABANDONMENT
MPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING CASING TEST AND COTHER: Run ca	NG OPNS. PLUG AND ABANDONMENT
MPORARILY ABANDON THER: 2 Describe Proposed or Completed Opwork) SEE RULE 1103. 1/21/96 Run 9 jts. 7' (8123.20'). Float stool @ 3768'. Cement w/70 BW & 316 bbl. stool @ 3768'. Tight in w/27/96. Tight in w/27/96. Tight in w/27/96.	crations (Clearly state all perinent details, or 26# N-80 LT&C csg. (39 shoe @ 10,466.94', float nt 1st stage: cement w/mud. Cement w/43 bbs1.	COMMENCE DRILLING CASING TEST AND CONTHER: Run ca O.78') & 194 it collar @ 10,41 305 sx Class Houtside & 22 bb y. Tail w/100 a 72 bb1. slur	PLUG AND ABANDONMENT Sing Sing Sing Sing Starting any proposed S. 7" 23# L-80 LT&C Rg 3 csg. 9.44', DV tool @ 8606' & DV & 65 bbl. slurry. Displace Plus inside csg. 2nd stage: Sx "H" in 21 bbls. slurry. Stry - no cement to surface.
MPORARILY ABANDON JLL OR ALTER CASING THER: 2 Describe Proposed or Completed Opwork) SEE RULE 1103. 11/21/96 Run 9 jts. 7' (8123.20'). Float : tool @ 3768'. Cemer w/70 BW & 316 bbl. : cement w/405 sx 35/ 11/22/96 Tial in w/27/ 11/23/96 Bull head sq	crations (Clearly state all perinent details, or 26# N-80 LT&C csg. (39% shoe @ 10,466.94', float nt 1st stage: cement w/mud. Cement w/43 bbsl. 65 poz in 148 bbl. slurr 0 sx selfstress 10/10 in ueeze top of 7" csg. w/4	COMMENCE DRILLING CASING TEST AND CONTHER: Run can O.78') & 194 it collar @ 10,41 305 sx Class H outside & 22 bb y. Tail w/100 a 72 bbl. slur 00 sx Calss "H"	PLUG AND ABANDONMENT Sing Sing Sing Sing Starting any proposed S. 7" 23# L-80 LT&C Rg 3 csg. 9.44', DV tool @ 8606' & DV & 65 bbl. slurry. Displace Plus inside csg. 2nd stage: Sx "H" in 21 bbls. slurry. Stry - no cement to surface.
11/21/96 Run 9 jts. 7' (8123.20'). Float : tool @ 3768'. Cemer w/70 BW & 316 bbl. n cement w/405 sx 35/ 11/22/96 Tial in w/27/ 11/23/96 Bull head sq	CHANGE PLANS " 26# N-80 LT&C csg. (39% shoe @ 10,466.94', float nt 1st stage: cement w/mud. Cement w/43 bbs1. 65 poz in 148 bb1. slurr 0 sx selfstress 10/10 in	COMMENCE DRILLING CASING TEST AND CONTHER: Run can Contain the pertinent dates, income and give pertinent dates.	PLUG AND ABANDONMENT CEMENT JOB Sing Si
EMPORARILY ABANDON JLL OR ALTER CASING THER: 12 Describe Proposed or Completed Opwork) SEE RULE 1103. 11/21/96 Run 9 jts. 7' (8123.20'). Float : tool @ 3768'. Cemer w/70 BW & 316 bbl. in cement w/405 sx 35/ 11/22/96 Tial in w/27/ 11/23/96 Bull head sq	crations (Clearly state all perinent details, or 26# N-80 LT&C csg. (39% shoe @ 10,466.94', float nt 1st stage: cement w/mud. Cement w/43 bbsl. 65 poz in 148 bbl. slurr 0 sx selfstress 10/10 in ueeze top of 7" csg. w/4	COMMENCE DRILLING CASING TEST AND CONTHER: Run can Contain the pertinent dates, income and give pertinent dates.	PLUG AND ABANDONMENT Sing Sing Sing Sing Starting any proposed S. 7" 23# L-80 LT&C Rg 3 csg. 9.44', DV tool @ 8606' & DV & 65 bbl. slurry. Displace Plus inside csg. 2nd stage: Sx "H" in 21 bbls. slurry. Stry - no cement to surface.

ORIGINAL SIGNED BY TIM W. GUM

AFTROVED BY-

FEB 21 1997 _ DATE -

DISTRICT II SUPERVISOR

_ TITLE -