

BOGLE FLATS UNIT 5 #1107/15/95

TMD: 7500 TVD: 7500 PBTMD: 0 PBTVD: 0
FTIH TO 7080'/ DO CMT 7080-7117'/ CIRC HOLE CLEAN/ TEST CSG TO 1000#/ CONT
TIH TO 7380'/ CIRC CLN/ TOH/ TIH W/6-1/8" RB, 7" CS ON 3-1/2" TBG/ DRESS OFF
DV TOOL @ 7113'/ DISP HOLE W/2% KCL/ SDFN/

07/16/95

TMD: 7500 TVD: 7500 PBTMD: 0 PBTVD: 0
OPN PERFS: BOGLE FLATS UNIT 5 #11
6940 - 7040 - CISCO
TOH/ SCHLUMBERGER RAN CET/ CBL 7370 TO 5800'/ POOR BOND 7070-7120'/ NO CMT
7120-7230'/ TIH W/4" HEGS GUN & PERF 6940-66', 6970-86', 7012-16' & 7030-40'
W/4 SPF, 90 DEG PHASED 32 GC/ JC @ 8:15 PM/ SDFN/

07/17/95

TMD: 7500 TVD: 7500 PBTMD: 0 PBTVD: 0
OPN PERFS: BOGLE FLATS UNIT 5 #11
6940 - 7040 - CISCO
TIH W/HOWCO PPI TOOL, MECH COLLAR LOC, SN & 3-1/2" TBG/ ACDZ CISCO PERFS
6940-7040' W/7000 GALS 15% NEFE HCL THRU PPI TOOL W/2' SPACING USING 125
GAL/FT/ FLUSH W/2% KCL/ RETR FCV/ TOH/ SDFN/

07/18/95

TMD: 7500 TVD: 7500 PBTMD: 0 PBTVD: 0
OPN PERFS: BOGLE FLATS UNIT 5 #11
6940 - 7040 - CISCO
TIH W/7" PERMA LACH PKR, SN & 3-1/2" TBG TO 6880'/ ND BOP/ CONN TREE/ PUMP
181 BBLS 2% KCL + CORR INHIB DOWN ANN/ SET PKR @ 6880' W/15K COMP/ NU TREE/
TEST CSG & PKR TO 1000#/ SWAB 23 BLAW/ FL 4800-6000'/ NO GAS/ SDFN/

07/19/95

TMD: 7500 TVD: 7500 PBTMD: 0 PBTVD: 0
OPN PERFS: BOGLE FLATS UNIT 5 #11
6940 - 7040 - CISCO
SITP 730#/ BLED TO 0#/ MADE 2 SWAB RUNS & WELL KICKED OFF FLOWING/ F 2 HRS
TO TANK/ REC 25 BLW FROM SWAB & FLOW/ TIED WELL TO TEST UNIT/ F 18 HRS/ 3/4"
CHK/ FTP 400#/ 2812 MCFD RATE, 0 BC, 352 BLW/

07/20/95

TMD: 7500 TVD: 7500 PBTMD: 0 PBTVD: 0
OPN PERFS: BOGLE FLATS UNIT 5 #11
6940 - 7040 - CISCO
F 5-1/2 HRS THRU TEST UNIT/ 3/4" CHK/ FTP 400#/ 2812 MCFD RATE, 0 BC, 40
BLW/ SWI/ RD RR ON 7-19-95/ WO CONNECTION/

07/21/95

TMD: 7500 TVD: 7500 PBTMD: 0 PBTVD: 0
OPN PERFS: BOGLE FLATS UNIT 5 #11
6940 - 7040 - CISCO
WAITING ON CONNNECTION/