



Amoco Production Company

ENGINEERING CHART

SHEET NO. _____ OF _____

FILE _____

APPN _____

DATE 1-6-76

BY DJC

SUBJECT Plug and Abandonment Procedure

OLD INDIAN DRAW UNIT NO. 17
INDIAN DRAW DELAWARE FIELD
LOBLY COUNTY, NEW MEXICO

1. Rig up service unit and run tubing.
2. Load hole with mud laden fluid
3. Spot 100 foot (45 sacks) Class "H" neat cement plug at the top of the Indian Draw Delaware Sand Interval (3230'-3330')
4. Spot 100 foot (45 sacks) Class "H" neat cement plug at the top of the Delaware Sand Interval (2840'-4000')
5. Spot 100 foot (65 sacks) Class "H" neat cement plug in and out of the 8-5/8" casing. (250-400')
6. Spot 10 sack plug to surface and yield on cement.
7. Erect plug and abandonment marker with location description as follows:

OLD INDIAN DRAW UNIT NO. 17
UNIT C, SEC 28, T-22-S, R-35-E

8. Clean up location and restore ground to contour.

Note: 1. Leave mud laden fluid between plugs.