

5. MU top half on-off tool, 1 jt tbg, 1.81" bored SN & tubing. Hydrotest tbg to 8000 psi below slips while RIH to packer. Circulate hole w/2% KCl packer fluid. Latch into on-off tool. ND BOPE, NU wellhead.
6. RU swab unit and swab tubing to 10000'. Stake down flowline to pit. Secure area, and drop bar to fire guns.
7. Flow well to clean up and unload. Test FTP and rate.
8. Consult with Division office regarding additional testing.

Engineering contact: Brad Cross
Senior Engineer
(915) 686-6655 (ofc), (915) 659-7538 (pgr)