

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

FORM APPROVED
OMB No. 1004-0135
Expires November 30, 2000

Lease Serial No. ROW
NM 29881
If Indian, Allottee or Tribe Name

If Unit or CA/Agreement, Name and/or No.

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other

2. Name of Operator

Bill & Patsy Rich

3a. Address

2401 MARTIN LANE NW

3b. Phone No. (include area code)

(505) 887-3928

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

SEC 13, T-25S, R-24E
1980 FNL & 1980 FNL

8. Well Name and No.

Sulphate Sister #1

9. API Well No.

30-015-21029

10. Field and Pool, or Exploratory Area

11. County or Parish, State

Eddy

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☒ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☐ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recomplete	☐ Other
	☐ Change Plans	☒ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☐ Plug Back	☐ Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

See Attached

RECEIVED
FEB 10 43
FIELD OFFICE

14. I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

Bill Rich

Title

Owner

Signature

Bill Rich

Date

2/22/02

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

ORIC

Title

Date

2/22/2002

Conditions of approval if any are attached. Approval of this notice does not warrant or certify that it which would be subject lease

Office

CFO

Accepted for record

Title 18 U.S.
States any fal

only

FEB 22 2002

ime for any person knowingly and willfully to make to any department or agency of the United ny matter within its jurisdiction.

Bill + Patsy Rich
Sulfate Sister #1 SWD
SEC 13, T-25S, R-26E
1980' FNL + 1980 FWL
Eddy County, NM

P+A Procedure

1. MIRU PU NU BOP Load csg w/wtr
2. ATTEMPT TO release Guiberson UNI PL PACKER
3. IP Tbg PANTS CLEAN OUT FB Tbg TO PACKER TOP @ 1900'
4. SET CIBP ON TOP OF PACKER + CAP W/35' CMT
5. TIH W/Tbg + Circ hole clean w/ 10# SALT gel.
6. ND BOP + Free Point csg CUT csg 50' ABOVE
Free Point, POOH W/csg + Lay down.
7. TIH W/Tbg + SET 25 SX STUB PLUG 50' ABOVE
+ below STUB — T_{12}
8. SET 25 SX shoe plug 50' ABOVE + below shoe
9. SET 10 SX surface plug
10. CUT OFF well head + erect P+A MARKER 4' PIPE
4' ABOVE ground level w/well data as
required as well as P+A DATE.
11. CLEAN location rip + seed as required

* 25 SX
plug 25 SX
OR
1690' 100' plug
1590' plug
Tm

60'
Surface

Bill + Patsy Rich
Sulfate Sister #1 SWD
SEC 13, T-25S, R-26E
1980' FNL & 1980 FWL
Eddy County, NM

P+A Procedure

1. MURPU NU BOP Load csg w/wtr
2. ATTEMPT TO release Guiberson UNI PL Packer
3. IF Tbg PARTS CLEAN OUT FB Tbg TO PACKER TOP @ 1900'
4. SET CIBP ON TOP OF PACKER & CAP W/35' CMT
5. TIH w/Tbg & Circ hole clean w/ 10[#] SALT gel.
6. ND BOP & Free Point csg CUT csg 50' Above
Free Point, POOTH w/csg & Lay down.
7. TIH w/Tbg & SET 25 SX STUB Plug 50' Above
& below STUB
8. SET 25 SX shoe Plug 50' Above & below shoe
9. SET 10 SX surface Plug
10. CUT OFF well head & erect P+A MARKER 4' Pipe
4' Above ground Level w/well data as
required as well as P+A DATE.
11. CLEAN LOCATION RIP & seed as required

Sulfate Sifter #1 20X
 Sec 13, T-25S, R-26E
 1980' FNL + 1980 FNL
 Eddy County, NM

105X surface
 Plug

50' minimum

255X shoe plug

50' Above & below
 shoe

WCC + tag, plug

17 1/2" hsk

13 3/8 72" @ 447'
 CNT air

255X STUB PLUG

50' Above & below
 CUT OFF

WCC & tag, plug

TOC @ 1670 by IRL

OPEN hole
 1962' TO 2049'

CIBP
 capped
 w/35' cnt

4 1/2 9.5" CSG @ 1962' CNTW/150 SX
 TO 2049