submitted in lieu of Form 3160-5



## **UNITED STATES** DEPARTMENT OF THE INTERIOR RUPEAU OF LAND MANAGEMENT 2014 MAR 19 AM 9: 55

		SUREAU OF LAN						
	હ	Sundry Notices a	and Repo			p. 64 .1		
	<u> </u>			<u>070</u> Farmir				
					5.	Lease Nun		
	•••				_	14-20-603		
1. Typ	pe of Well				6.	If Indian, A		
	WIW				_	Tribe Nam		
				<del>,</del>	7.	Unit Agree	ment Name	
	me of Operator							
H	art Oil & Gas, Inc.				•	344.11.51	D.M	
0 44	days 9 Phone No. of Open	-4		<del></del>	8.		& Number	
3. Address & Phone No. of Operator					0	Navajo #0	• •	
PO Box 307, Farmington, NM 87499 (505) 326-1163				9. <b>API Well No.</b> 30-045-11472				
Locatio	on of Well Footage Sec. T	PM		<del>,</del>	10.	Field and I		
Location of Well, Footage, Sec., T, R, M					10.	Mesa Gal		
17	'00' ENL and 685' EEL Secti	on 15 T-32-N R-	18_W		11.		•	
1700' FNL and 685' FEL, Section 15, T-32-N, R-18-W,				•	• • • •		County, NM	
						oun ouun	Ocurry, ruin	
12. CH	ECK APPROPRIATE BOX T	O INDICATE NAT	TURE OF	NOTICE, REPORT, OT	HER C	ATA		
	oe of Submission	Type of Actio		•		و الما و المارين		
	Notice of Intent	X Abandonmei		Change of Plans				
		Recompletion		New Construction		AN A		
	X Subsequent Report	Plugging Ba		Non-Routine Fract	uring			
		Casing Repa	air	Water Shut off	_	MAR.	2004	
	Final Abandonment	Altering Cas	ing	Conversion to Inject	ction	Issue 1	Jada i ki	
		Other -				te mico		
						K-65 2010	<u> </u>	
13. De:	scribe Proposed or Comple	•						
	Hart Oil & Gas plugged a	ind abandoned t	his well c	on February 10, 2004.		X 21 11	or a lipe	
						Tel II	<u>ULO 2000</u>	
2-06-04	MOL & RU. TOH and LD 39 jo	oints tubing with 4-1/	/2" AD-1 pa	acker. Shut in well.				
2-09-04	2-09-04 PU 2-3/8" workstring and TIH. Tag at 1257'. Establish circulation out the 4-1/2" casing with 30 bbls water. Plug #1							
	with 46 sxs cement to fill the G	allup perforations fr	om 1257' t	o 662'. TOH and LD tubir	g. Shu	t in well.		
2-10-04	RU wireline and tag cement at				-			
	is at 4' from surface. WOO. J	•		•		_		
				• • •	_			
	holes at 50'. RIH with 4-1/2" B			<del>-</del>	•	•		
	with packer at 23' and 24 sxs of			=				
	outside the casing; 2 <sup>nd</sup> TOH wi	ith packer and run 1	joint open	ended tubing; 3 <sup>rd</sup> pump 1:	2 sxs ce	ement down		
	the tubing to circulate cement	out the casing valve	; 4 <sup>th</sup> LD 1 j	oint tubing and WOC. ND	BOP a	nd cut off		
	wellhead. Found cement down	n 4' in 4-1/2" casing	Mix 16 s	s cement to fill 4-1/2" cas	ng and	install P&A		
	marker. RD and MOL. Wallac	-			-			
	markor. No and Mot. Wand	o rionicy, marajo m		rais / D. i recinari, rvavajo	LI A OII	iocation.		
14. I he	ereby certify that the forego	oing is thue and c	orrect					
		, ,						
Signed	Man a VM	and Title	Vice P	resident		Date _	2/28/04	
•	Gina M. Saied							
(This s	pace for Federal or State Off	ice use)						
	OVED BY	Title				_ Date		
CONDI	TION OF APPROVAL, if any	•					BECOR	

AR 2 2 2004