Form 3160-5 (August 2999)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0135 Expires: November 30, 2000

5. Lease Serial No. JIC105

6.	If Indian,	Allottee	or	Tribe	Nan

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use thi	is form for proposals to	drill or to re-enter an	1 2 3 7 N			
abandoned we	6. If Indian, Allott	If Indian, Allottee or Tribe Name JICARILLA APACHE				
SUBMIT IN TRI	PLICATE - Other instruc	ctions on reverse side.	2003 - T. If Unit or CA/A	greement, Name and/or No.		
1. Type of Well			8. Well Name and JICARILLA A	No. 14		
Oil Well Gas Well Oth 2. Name of Operator		DEBORAH MARBERRY	9. API Well No.	17		
CONOCO INCORPORATED	Contact.	E-Mail: deborah marberry@co	nocophillips.com 30-039-2062			
3a. Address 3315 BLOOMFIELD HIGHWA FARMINGTON, NM 87401	Y	3b. Phone No. (include area co Ph: 832.486.2326 Fx: 832.486.2688	BLANCO /	10. Field and Pool, or Exploratory BLANCO MV WILD HORSE GALL		
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)		11. County or Parish, and State		
Sec 24 T26N R4W NENE			RIO ARRIBA	A COUNTY, NM		
12. CHECK APPE	ROPRIATE BOX(ES) TO	O INDICATE NATURE O	F NOTICE, REPORT, OR OTI	HER DATA		
TYPE OF SUBMISSION	OF ACTION					
☐ Notice of Intent	☐ Acidize	□ Deepen	☐ Production (Start/Resume)) Water Shut-Off		
_	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	■ Well Integrity		
Subsequent Report Subsequent Re	☐ Casing Repair	■ New Construction	☐ Recomplete	Other		
☐ Final Abandonment Notice	☐ Change Plans	☐ Plug and Abandon	☐ Temporarily Abandon			
	☐ Convert to Injection	☐ Plug Back	□ Water Disposal			
following completion of the involved testing has been completed. Final Abdetermined that the site is ready for final fin	operations. If the operation re- pandonment Notices shall be fil- inal inspection.) ell as per the following: nt, Road rig an equipment eeting. SICP 120#. SITP ever plunger. EL. RDWH, RUBOP, RU f g, tally out. Total 239 join meeting. SICP 260#, RIH on trailer. Dug up around meeting, SICP 260#, Try	sults in a multiple completion or red only after all requirements, income to location. Roads muddy 250#. Rig up rig an equipm loor, Test BOP, PU an remots, 7580' an packer. SWI, I with 5 1/2" scraper, tag up I well head, Need to change	nent. Lock an tag out ove tbg hanger. PU an Orain up at 7570'. POOH with e out tbg. hanger	3160-4 shall be filed once		
	Electronic Submission # For CONOCO		Vell Information System e Rio Puerco s on 03/10/2003 (03AMJ0300SE) MITTING CONTACT			
Signature (Electronic S	Submission)	Date 03/07	7/2003			
	THIS SPACE FO	OR FEDERAL OR STAT				
_Approved_By_ACCEPT		W DAVIS N OF MULTI-RESOURCES	Date 03/30/2003			
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to conduct to conduct the applicant the applicant to conduct the applicant the appli	uitable title to those rights in the		uerco			

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Additional data for EC transaction #19345 that would not fit on the form

32. Additional remarks, continued

tbg hanger spool. RIH with 5 1/2" RBP an tbg , set at 3970'. PU tbg, load hole from bottom up, 190 Bbls of fluids, Circalate 10 bbls out, Test plug to 300#, Held okay. POOH with tbg. RD floor, RDBOP, unbolt tbg hanger spool an remove, Will have to add about 4" of csg , for new spool. Set back old spool , Sl. SDFN 1/14/2003 00:00 JSA, Safety meeting, SICP,0#. Open well , test with gas sniffer, Load an top of csg. Spot in welder. Safety meeting, RDWH, Add 4.5" of 7 5/8" csg to stub up. Set down new csg spool, pack off an test to 2000#. held okay. RD an release welder. RUBOP, RU floor. IH with 2000' of tbg with retrieving head. RD air unit, unload csg. Shut down air, RIH to 3940' with tbg an retrieving head. RU air unit, unload csg. Recovered 190 bbls of fluids. Shut down air , SWI, SDFN 1/15/2003 00:00 JSA, Safety meeting. SICP, 260#, Blow well down, RIH with tbg , tag up RBP, latch on release. POOH an lay down 3 joints of tbg. PROBLEM WITH RIG. CALL MECHANIC OUT, RIGHT ANGLE SHAFT BEARING OUT. SHT DOWN FOR REPAIRS. SWI. 1/16/2003 00:00 JSA, Shut down for repairs. 1/17/2003 00:00 JSA, Shut down for repairs. 1/17/2003 00:00 Day off. 1/19/2003 00:00 JSA, safety meeting. SICP 250#. Start rig, Finish repairing rig, POOH with tbg, work rig for two hours, started to heat up, (Bearing housing) Shut down, call out mechanic. Had to re shimmy bearing. SDFN 1/20/2003 00:00 Jsa Safety meeting, SICP 260#, Finish up repairing rig at 10:00 am. Blow well down, POOH with tbg an RBP. RIH with 1211' of 2 1/16" tbg, packer an 1800' of tbg. SWI, SDFN 1/21/2003 00:00 JSA, safety meeting. SICP 260#. Blow well down, RIH with tbg, tally pick up an drift in. Set packer, Baker 5 1/2" LOK-Set (8000# tension), land tbg. 7540'. seat nipple on bottom, 1.7 ID. Total joint run, 234. set BPV, RD Floor, NDBOP, NU off set spool, change out rams. NUBOP. Rig up floor. SWI, SDFN 1/22/2003 00:00 JSA, Safety meeting. SICP 230#. Blow well down, RIH with mule shoe guide, seat nipple (ID 1.7") an 174 joints of 2 1/16" tbg. Pick up an drift in. Landed at 5