

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
OMB No. 1004-0135  
Expires November 30, 2000

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.*

**SUBMIT IN TRIPLICATE - Other instructions on reverse side**

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other *W I W*

2. Name of Operator

*BCED OPERATING, INC.*

3a. Address

*P.O. Box 1680, Hobbs, NM*

3b. Phone No. (include area code)

*505-397-3972*

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

*K, 1335' FSL, 1325' FWL, Sec. 6, T17N, R8W*

5. Lease Serial No.

*NM-052931*

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

*Hanson Fed. #19*

9. API Well No.

*30-031-20157*

10. Field and Pool, or Exploratory Area

*HOSPAN UPPER Snd*

11. County or Parish, State

*McKinley, NM*

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☐ Acidize

☐ Alter Casing

☐ Casing Repair

☐ Change Plans

☐ Convert to Injection

☐ Deepen

☐ Fracture Treat

☐ New Construction

☒ Plug and Abandon

☐ Plug Back

☐ Production (Start/Resume)

☐ Reclamation

☐ Recomplete

☐ Temporarily Abandon

☐ Water Disposal


☐ Water Shut-Off

☐ Well Integrity

☐ Other

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

*Please see Attachment.*

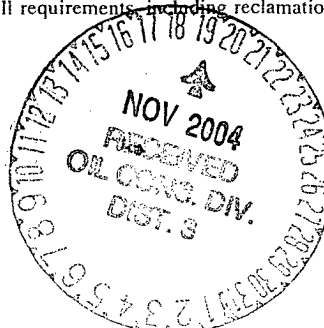

*8/3*

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

*Donnie Hill*

Title

*President*

Signature

*Donnie Hill*

Date

*11/8/2004*

**THIS SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

**ACCEPTED FOR RECORD**

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

**NOV 16 2004**

**NMOC**

**FARMINGTON FIELD OFFICE**  
BY *SW*

**HANSON FEDERAL NO. 19**

**30-031-20157**

**K, SEC. 06, T17N, R08W**

**SUMMARY OF PLUGGING OPERATIONS**

JULY 20, 2004

MIRU PLUGGING EQUIPMENT, CONDUCT SAFETY MEETING, INSTALL BOP, RLS AD-1 PKR., POOH AND LAY DN. 2 3/8" TBG. AND PKR, PU AND TIH WITH 2 7/8" WORK STRING, TAG TD @ 1606.95' (PERFS @ 1524' - 1600'), SDFN

JULY 21, 2004

CREW TO LOCATION, CONDUCT SAFETY MEETING, LOAD HOLE W/ WATER AND CIRCULATE TO REVERSE PIT TO CLEAN UP WELL, MIX AND PUMP 50 SXS. CLASS "B" CMT @ 15.9#/GAL, SPOT BALANCED PLUG @ 1606' - 1000', WASH UP EQUIPMENT, POOH W/ WORK STRING, SECURE WELL SIWOC.

BLM= VIRGIL & CLIFF  
NEPA= LEEROY LEE

JULY 27, 2004

CREW TO LOCATION, CONDUCT SAFETY MEETING, MIRU WIRELINE TRUCK, TIH W/ WIRELINE, TAG TOC @ 951', POOH W/ WIRELINE, NIPPLE UP WELL HEAD, PRESSURE TEST CSG TO 500 PSIG, WOULD NOT HOLD, RLS. PRESSURE, PU AND TIH W/ 4 1/2" PKR AND 2 7/8" TBG, SET PKR @ 951', LOAD TBG/CSG ANNULUS, ATTEMPT TO PRESSURE, WOULD NOT HOLD, RLS PKR, RESET PKR @ 915', PRESSURE TEST CSG BELOW 915' TO 500 PSIG, HELD OKAY, RLS PKR AND CONTINUE TESTING TO LOCATE BAD CSG @ 511', POOH W/ TBG, REMOVE PKR, TIH W/ TBG TO 545', BREAK CIRCULATION, MIX AND PUMP 30 SXS CLASS "B" NEAT CEMENT @ 15.9#/GAL., SPOT BALANCED PLUG @ 545' - 170', POOH W/ TBG, HOLE STABLE, SECURE WELL SIWOC.

BLM= VIRGIL & CLIFF  
NEPA= LEEROY LEE

**HANSON # 19 (cont.)**

JULY 28, 2004

CREW TO LOCATION, CONDUCT SAFETY MEETING, MIRU WIRELINE, TRUCK, TAG TOC @ 459', PERF. SQUEEZE HOLE @ 170', RIG DOWN AND RLS. WIRELINE TRUCK, TIH W/ TBG TO 458', BREAK CIRCULATION, MIX AND PUMP 22 SXS. CLASS "B" NEAT CMT. @ 16.2 #/GAL., SPOT BALANCED PLUG @ 458' - 180', POOH W/TBG TO 175', CIRCULATE HOLE CLEAN TO ASSURE SQUEEZE HOLE IS CLEAR OF SLURRY, POOH W/ TBG, SECURE WELL, SIWOC

BLM= VIRGIL & CLIFF

NEPA= LEEROY LEE

JULY 29, 2004

CREW TO LOCATION, CONDUCT SAFETY MEETING, TIH W/ TBG, TAG TOC @ 276', BREAK CIRCULATION, MIX AND PUMP 9 SXS CLASS "B" NEAT CMT. @ 15.6 #/GAL, SPOT BALANCED PLUG @ 276' - 175', POOH TO 180', BREAK CIRCULATION, CIRCULATE HOLE CLEAN TO ASSURE SQUEEZE HOLES @ 170' ARE CLEAR OF SLURRY, POOH W/ TBG. SECURE WELL, SIWOC

BLM= VIRGIL & CLIFF

NEPA= LEEROY LEE

AUGUST 3, 2004

CREW TO LOCATION, CONDUCT SAFETY MEETING, TIH W/ TBG, TAG TOC @ 185', POOH AND LAY DOWN TBG, NIPPLE UP ON CSG, BREAK CIRCULATION ON BRADEN HEAD FROM 170', CIRCULATE HOLE CLEAN, MIX AND PUMP 48 SXS CLASS "B" NEAT CEMENT @ 16.0 #/GAL., DID NOT CIRCULATE, MIX AND PUMP ADDITIONAL 42 SXS CLASS "B" NEAT CMT @ 16.0 #/GAL, CIRCULATE SLURRY TO LINED EARTH PIT, HOLE STABLE, RIG DN AND MOVE ALL EQUIPMENT.

WELL IS PLUGGED.

WILL INSTALL P&A MARKER AND RESTORE LOCATION AS REQUIRED.