

**UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT**

Sundry Notices and Reports on Wells

1. **Type of Well**
GAS

2. **Name of Operator**

BURLINGTON

RESOURCES OIL & GAS COMPANY

3. **Address & Phone No. of Operator**

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. **Location of Well, Footage, Sec., T, R, M**

1500'FNL, 790'FWL, Sec. 24, T31N, R9W, NMPM

5. **Lease Number**

SF-078505

6. **If Indian, All. or
Tribe Name**

7. **Unit Agreement Name**

8. **Well Name & Number**

Seymour 2C

9. **API Well No.**

30-045-30174

10. **Field and Pool**

Blanco MV/Basin DK

11. **County and State**

San Juan Co, NM

12. **CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA**

Type of Submission

Type of Action

☐ Notice of Intent

☐ Abandonment

☐ Change of Plans

☒ Subsequent Report

☐ Recompletion

☐ New Construction

☐ Final Abandonment

☐ Plugging Back

☐ Non-Routine Fracturing

☐ Casing Repair

☐ Water Shut off

☐ Altering Casing

☐ Conversion to Injection

☐ Other - P&A Dakota formation

JAN 13 2005

FARMINGTON FIELD OFFICE

13. **Describe Proposed or Completed Operations**

11/29/04 MIRU. Run lead block. Wait on Slickline. Run magnet, no recovery. SDFN.
11/30/04 RU slickline. RIH w/1 1/4" beveled rod, wedge into grapple. TOOH.
Recovered grapple. RIH to TOF @ 2328'. Engage fish @ 2328', pulled off fish.
TOOH, rods hanging up. Overshot split, left grapple in hole. Waiting overshot.
TIH, engage fish, pulled off fish. TOOH, left grapple in hole. SDFN.
12/1/04 TIH, engage fish. Screw box tap over pin, turned 75 rnds. TOOH, pulled
out of box tap. TIH, engage fish, turn to left. Screw on fish. SDFN.
12/2/04 RU hot oil unit, pump 100 bbls hot wtr down csg. Turn rods to left 110
rnds, work rods. Box tap cam loose, attempt to screw back in, not able. TOOH.
Recovered 1 7/8" rod. RIH on sandline, recovered one grapple broken into pieces
in four runs. TIH w/7/8" rods to TOF, attempt to screw into box, unable. SDFN.
12/3/04 POOH w/rods. Kill well. ND WH. Strip on BOP. RU WL. RIH, cut 2 3/8" tbg @
2320', TOR @ 2329'. TOOH w/ 2 3/8" tbg. SDFN.
12/4/04 Kill well w/40 blls wtr. TIH w/washpipe, outside cutter to TOF @ 2320'.
Work over fish. Make outside cut on 2 3/8" tbg @ 2364'. TOOH. TIH w/ 7/8" rods @
2329'. Catch fish. POOH, recovered one 7/8" rod w/box on both ends. TIH, engage
Fish @ 2354'. Work overshot over fish. POOH. SDFWE.
12/6/04 RU to pull rods. POOH w/rods. TIH on 2 7/8" tbg to TOF @ 2363'. Latch
fish @ 2363'. Work stuck pipe. Move fish downhole, unable to work free. RU WL.
Cut 2 3/8" tbg @ 5004', TOR @ 5014'. POOH. TIH on 2 7/8" tbg to 3100'. SDFN.
12/7/04 Make outside cut on 2 3/8" tbg @ 5018'. TOOH. TIH to top of 3/4" rods,
engage fish. Work stuck rods, unable to work free. TOOH, recovered one 3/4" rod w/box
on bottom. SDFN.
12/8/04 TIH to TOF @ 4958'. Work over fish. TOOH. SDFN.
12/9/04 TIH, engage fish @ 5131'. Work over fish. Make cut on 2 3/8" tbg @ 5207'.
TIH, engage 2 3/8" tbg @ 5207'. Cut 2 3/8" tbg. PUH to 4000'. SDFN.
12/10/04 TOOH w/remainder of tbg 1200'. Did not pick up fish. TIH w/cutter for
2 3/8" tbg body catch to 5207'. Work over fish. TOOH w/tbg & cutter. Top of
2 3/8" fish @ 5301'. SDFN.
12/11/04 TIH w/overshot, engage rods. Latch fish. TOOH w/fish, recovered two
3/4" rods. TIH, cut tbg @ 5364'. TOOH, recovered 63' tbg. TIH to 5300'. SDFWE.

12/13/04 TIH, engage rods. POOH, recovered three ¾" rods. Cut 2 3/8" tbg @ 5457'. TOOH. Kill well w/30 bbls wtr. SDFN.

12/14/04 TIH to top of rods. Engage fish. POOH with three ¾" rods. TIH, engage top of tbg. Cut 2 3/8" tbg @ 5520'. TOOH w/fish. TIH w/overshot, engage fish @5457'. SDFN.

12/15/04 POOH, no recovery. TIH w/overshot, engage fish. POOH, no recovery. TIH, engage rods. Latch fish. POOH, recovered 2 ¾ ¾" rods. TIH to 5457'. Latch fish. SDFN.

12/16/04 POOH. TIH to TOF @ 5520'. Cut 2 3/8" tbg @ 5582'. POOH. TIH to top of rods. SDFN.

12/17/04 POOH. TIH to TOF @ 5582'. Work over fish. Cut 2 3/8" tbg @ 5707'. POOH. TIH, engage rods. SDFN.

12/18/04 POOH. TIH, work over fish. Cut 2 3/8" tbg @ 5770'. TOOH. TIH w/2 3/8" overshot. Latch fish, could not pull fish. Unlatch fish. TOOH w/overshot. SDFWE.

12/20/04 TIH, w/overshot. TOOH w/overshot, recovered three ¾" rods. SDFN.

12/21/04 TIH, cut tbg @ 5834'. TOOH w/tbg, recover 2 jts 2 3/8" tbg. TIH w/overshot, engage rods. TOOH, top of rods now @ 5842'. TIH, cut tbg @ 5929'. TOOH w/tbg. SDFN.

12/22/04 TOOH, recovered 3 jts 2 3/8" tbg. TIH to TOF @ 5929', engage rods. TOOH w/overshot, TOF-Rods now @ 5970'. TIH w/tbg & BHFA. Jar on fish @ 5929'. SDFN. **(Received verbal from Steve Mason, BLM, to abandon Dakota formation, since tbg & rods were stuck at 110' below btm P. Lookout formation. OK to set CR @ 5910', pump 1 ½ volume cmt, squeeze volume.)**

12/23/04 Jar on tbg, no movement. TOOH. Suspend fishing operations. Attempt to set CR @ 5910', would not set. TOOH w/tbg. SDF Holiday.

12/28/04 TOOH w/CR. TIH w/WL, set 5 ½" CR @ 5910'. POOH WL. Pump 120 sxs Type III cmt. Displace w/33 bbls wtr. SD. Sting out of retainer. Left 1 bbl cmt @ top of retainer. SDFN.

12/29/04 RU WL & free point tbg. 0% free @ 5150', 90% free @ 5125'. Attempt to cut off @ 5125'. RD WL. Pull on tbg, no movement. Run CBL inside 2 7/8" tbg. SDFN.

12/30/04 RU WL. TIH, cut tbg @ 5123'. TOOH w/tbg, recovered 165 jts. Left in hole 455' of fish from 5123' to 5578'. Btm of fish to top of C/R S/A-5910' is 332'. SDFN.

12/31/04 TIH w/2 3/8" tbg. TOOH w/tbg. ND BOP. NU WH. SDF New Years. (Will side track well at later date.) RD. Rig released.

14. I hereby certify that the foregoing is true and correct.

Signed Joni Clark Title Regulatory Specialist Date 1/4/04

(This space for Federal or State Office use)

APPROVED BY _____ Title _____ Date _____

CONDITION OF APPROVAL, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.