Form 3160-5 (November 1994)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

OM Exp 15 Lease Serial

FORM APPROVED OMB No 1004-0135 Expires July 31, 1996

SUNDRY NOTICES AND REPORTS ON WELLS

MINAI	0029'
/ V /VI I	(7() /, 9.

If Indian, Allottee or Tribe Name (7.ttllf\Unit or CA/Agreement, Name and/or No reativities Field agemen. Type of Well 8 Well Name and No Oil Well Gas Well Other Name of Operator FEDERAL 21-8-13 #4 API Well No. SG INTERESTS I LTD, c/o SAGLE, SCHWAB & McLEAN ENERGY RESOURCES Address Phone No (include area code) 30-045-34360 10. Field and Pool, or Exploratory Area (970) 259-2701 PO BOX 2677, DURANGO, CO 81302 Location of Well (Footage, Sec., T, R., M., or Survey Description) Basin Fruitland Coal 11. County or Parish, State Unit J: (NWSE) Sec13-T21N-R8W 1996' FSL, 1982' FEL San Juan County, NM 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION X Notice of Intent Deepen Production (Start/Resume) Water Shut-Off Acidize Fracture Treat Reclamation Well Integrity Alter Casing Other □ Subsequent Report New Construction Recomplete Casing Repair Change Plans Plug and Abandon Temporarily Abandon Convert to Injection Plug Back Water Disposal Describe Proposed or Completed Operations (clearly state all pertinent details, including estimated starting measured and true If the proposal is to deepen directionally vertical depths of all pertinent markers and zones recomplete horizontally, give Attach the Bond under which the work will be performed or provide the Bond No on file with BLM/BIA Following completion of the involved operations. If the operation results in a multiple completion or recomple Required subsequent reports shall be filed within 30 days Attach the Bond under which use work with the following completion of the involved operations of the operation results in a multiple completion of Testing has been completed. Final Abandonment Notices shall be filed only after all requirements, completion or recompletion in a new interval, a Form 3160-4 shall be filed once including reclamation, have been completed, and the operator has This well was spudded in August 2007, (TD 885' KB; PBTD 842' KB. This well has not been completed. SG intends to plug and abandon this well as per the P & A procedure attached as soon as weather and consultant availability allows. We anticipate having all work completed by April 1, 2012, if not before. RCVD FEB 16'12 Notify NMOCD 24 hrs OIL CONS. DIV. prior to beginning operations DIST.13 I hereby certify that the foregoing is true and correct Name (Printed/Typed) Title William (Tripp) Schwab, III Agent for SG Interests I Ltd Signatur February 9, 2012 THIS SPACE FOR FEDERAL OR STATE USE. Approved by Date Title Original Signed: Stephen Mason FEB 1 3 2012 Conditions of approval, if any, are attached Approval of this notice does not warrant or Office

Title 18 U S C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

certify that the applicant holds legal or equitable title to those rights in the subject lease

which would entitle the applicant to conduct operations thereon.

SG Interests I, Ltd.

Federal 21-8-13 #4

SE 1/4 Sec 13-T21N-R8W San Juan County, NM P&A Procedure February 2012 WS

Elevations:

GL: 6681'

KB:

5'

TD: PBTD: 885' KB 842' KB

Casing:

4-1/2", 10.5#, J-55, SA 881', cemented to surface

Tubing:

none

Pump & Rods:

none

Marker Jt:

451' KB to 471' KB

Current Production:

Not Completed

Well History:

8/07 - Spud Well

Objective:

Plug and abandon wellbore.

Directions:

Turn South at the intersection of SJ County Rd 7900 & NM State Hwy 550. Travel South on 7900 14.7 miles to the intersection of SJ County Rd 7900 and Access Rd. Turn Right at intersection and travel 0.8 miles to location.

Procedure:

BLM & NMOCD must be Notified 24 hrs in advance of P&A cementing operations.

Note Stipulations and notification requirements and comply with all safety and environmental regulations.


Do not dig cement pit. Use ½ tank from Lindrith Backhoe Service. Use sugar to keep waste cement from setting up. Set 400 Bbl Frac tank with fresh water.

Will need 29 jts 2-3/8" J-55 tubing for work string. Pull from SG Stock @ Cave.

There are no Anchors on location. If the rig needs anchors then they will need to be set.

- 1) Set working pit. MIRUSU. Record bradenhead, and casing. Report any problem pressures. Blow down and kill well as necessary.
- 2) RIH with notched collar, SN and work string. Drop Standing Valve and test tubing. Retrieve SV. POOH.
- 3) NDWH & NUBOP
- 4) PU 3-7/8" bit, scraper, and 2-3/8" workstring. TIH & CO to TOC or CO to 842' KB. Circulate casing clean with water. TOOH, LD bit and scraper.
- 5) TIH to PBTD. Mix 29 sx (46 cu ft) Type III cmt and spot plug from PBTD to 215 440' KB to cover Fruitland Goal (480' KB to 448' KB). POOH to 200' KB. Allow cmt to set.
- 6) Mix 29 sx (40 cu ft) Type III cmt w 2% CaCl. Spot Cmt to surface. Allow cmt to harden. LD tubing.
- 7) NDBOP and cut casing off below surface. Install P&A marker with cement to comply with regulations. RDMOSU.
- 8) Haul tubing to Cave for inspection.

Current Wellbore Diagram

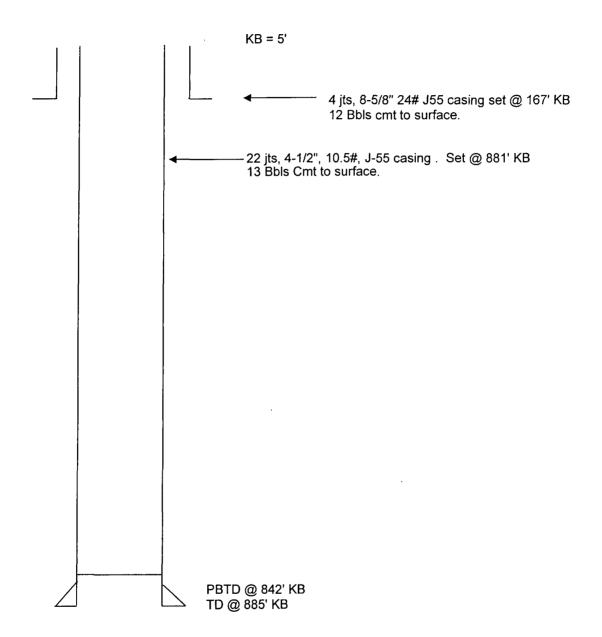

(

Federal 21-8-13 #4, P&A Procedure Page 4

Notification Schedule

Agency	Phone Number	Comments .
BLM	505-599-8907	
BLM	505-899-8900	Changes or questions Regarding approved plans or completion ops.
BLM	505-326-1248 505-334-1266 Adrienne Brumley Jim Lovato	Emergency program changes after normal business hours. Notify 24 hrs before Cmt.
NMOCD	505-334-6178 Monica Kuehling	Notify 24hrs before Cmt

Federal 21-8-13 #4, P&A Procedure Page 5

Vendor List:

Service or Material	Company or Contact	Phone Number	
Dirt Contractor	Bridge Dozer Robert Bridge	Home Cell	505-289-4048 505-249-6942
Pit Liner	see Dirt Contractor		
Anchors	Mote	Off Off	505-325-9711 505-325-1666
Fracturing	Halliburton Randy Schneider	Off	505-324-3500
Cementing	Baker Harry Mitchell	Off Cell	505-327-6222 505-330-0001
Wellhead Equipment	WSI Linda	Off	505-326-0308
Logging / Perforating	Blue Jet Danny Seip	Off	505-325-5584
Water Hauling	B&B Vac Dustin Bridge	Home Cell	505-289-4048 505-320-1211
Frac Tank & Heavy Hauling Trash basket	Lindrith Backhoe Doyle Post	Cell	505-320-5460
Light Trucking / Hotshot	Lindrith Backhoe Doyle Post	Cell	505-320-5460
Porta Johns	Cabannas Hal Stone	Off Cell	505-325-5835 505-330-7566
Roustabout	Lindrith Backhoe Doyle Post	Cell	505-320-5460
BOP Rental	TBD		
BOP Testing	Four Corners Testing Glen Davis	Off	505-360-2108

Federal 21-8-13 #4, P&A Procedure Page 6

Vendor List Continued:

Down hole Rod Pump	Energy Pump & Supply Leo Noyes	Off	505-564-2874
Down hole PC Pump	Weatherford ALS Cris Wulfert Noel Rogers	Off Cell Cell	505-564-8381 505-634-8447 505-486-5870
Slickline Services	Phoenix Services Jeff	Off	505-325-1125
Tubulars	Cave Enterprises Jim Cave	Off	505-325-3401
Completion Rig	JC Services		
Drywatch	Lindrith Backhoe Doyle Post	Cell	505-320-5460
	D&D Services Glen Davis	Cell	505-215-4600

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

1235 LA PLATA HIGHWAY FARMINGTON, NEW MEXICO 87401

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment Well: 4 Federal 21-8-13

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907.
- 3. The following modifications to your plugging program are to be made:
- a) Bring the top of the Fruitland plug to 275'.
- b) Place the Surface plug from 217' to surface.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.