UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO 1004-0135 Expires: July 31, 2010

| SUNDRY N | OTICES AND REPORTS ON WELLS | |
|-----------------|---|--|
| Do not use this | form for proposals to drill or to re-enter an | |
| handoned well | Hen form 3160-2 (APD) for such proposals | |

Lease Serial No. NMSF078095

| abandoned well. Use form 3160-3 (APD) for such proposals. | | | | e or Tribe Name | | |
|--|---|---|---|---------------------------------|--|--|
| SUBMIT IN TRI | 7 If Unit or CA/Ag | reement, Name and/or No. | | | | |
| Type of Well ☐ Oil Well | 8 Well Name and N MUDGE LS 23 | 8 Well Name and No MUDGE LS 23 | | | | |
| 2. Name of Operator BP AMERICA PRODUCTION | 9. API Well No. 30-045-11078 | 3 | | | | |
| 3a Address 200 ENERGY COURT FARMINGTON, NM 87401 | Phone No (include area code 1: 281-366-4632 | e) 10. Field and Pool, BASIN DAKO | 10. Field and Pool, or Exploratory BASIN DAKOTA | | | |
| 4 Location of Well (Footage, Sec., 7 | C., R., M., or Survey Description) | | 11. County or Paris | 11. County or Parish, and State | | |
| Sec 5 T31N R11W NWNE 10 | 30FNL 1555FEL | | SAN JUAN C | OUNTY, NM | | |
| 12. CHECK APPI | ROPRIATE BOX(ES) TO IN | IDICATE NATURE OF | NOTICE, REPORT, OR OTH | ER DATA | | |
| TYPE OF SUBMISSION | TYPE OF SUBMISSION . TYPE OF ACTION | | | | | |
| Notice of Intent | ₄ ☐ Acidize | □ Deepen | ☐ Production (Start/Resume) | □ Water Shut-Off | | |
| 1 | ☐ Alter Casing | ☐ Fracture Treat | ☐ Reclamation | ☐ Well Integrity | | |
| Subsequent Report | Casing Repair | ■ New Construction | Recomplete | Other | | |
| Final Abandonment Notice | ☐ Change Plans | Plug and Abandon | ☐ Temporarily Abandon | | | |
| BP | Convert to Injection | `□ Plug Back | ■ Water Disposal | | | |
| testing has been completed. Final Al determined that the site is ready for f BP America respectufily requesthis well and find no further positive. | bandonment Notices shall be filed or inal inspection.) ests permission to plug and a otential. Please see the attach | nly after all requirements, inclu- bandon the subject well. ned P&A procedure and v | vellbore | OCT 29'12 | | |
| & Extend Fru. | 10 2129 | OIL | CONS. DIV. | | | |
| X Extend Fau. X Extend Kint | land pluj down | t 1479 | 37 | DIST. 3 | | |
| H ₂ S POTENTIAL EXIST | | | | | | |
| 14. Thereby certify that the foregoing is | Electronic Submission #1557 | 46 verified by the BLM We JCTION COMPANY, sent t | ell Information System o the Farmington | | | |
| Name (Printed/Typed) RANAD A | Title AUTHO | RIZED REPRESENTATIVE | | | | |
| Signature (Electronic S | Submission) | Date 10/22/2 | 2012 | | | |
| 1 | THIS SPACE FOR I | EDERAL OR STATE | OFFICE USE | | | |
| Approved By | M M | Title | 10 | DD4=2 5 2012 | | |
| Conditions of approval, it any, are attache certify that the applicant holds legal or equ which would entitle the applicant to condu | uitable title to those rights in the subject operations thereon. | ject lease Office | ,°NU | | | |
| fitle 18 U S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent | U.S.C. Section 1212, make it a crimstatements or representations as to a | ne for any person knowingly and matter within its jurisdiction | d willfully to make to any department | or agency of the United | | |

BP - San Juan Wellwork Procedure

MUDGE LS 023-DK 30-045-11078-00

Unit letter Unit B - Sec 05 - T31N - R11W San Juan, NM

DK

OGRID Number: 0778 P&A date - January 2013

Basic Job Procedure:

- 1. Kill well. Circulate well clean with fresh water.
- 2. POOH rods and rod pump.
- 3. POOH with tubing.
- 4. RIH with bit and scrapper to 7,550 ft
- 5. RIH and set CIBP ~7,450 ft Fill up well with water and PT to 1000 psi.
- 6. RIH with CBL check TOC on the 5.5" casing
- 7. Balance cement plug from CIBP to 4500 ft
- 8. RIH and set CIBP at 3400 ft and balance a plug from CIBP to 2800 ft Cut 5.5" csg 200 ft above the TOC and POH with 5.5" casing
- 10. RIH with CBL and log 7 5/8" casing to find TOC
- 11. Perforate 100 ft below surf csg shoe ~315 ft


- Place a coment plug across the 51/2 casing soub


Place a coment plug across the Kircland top from 1454' 12. Set a cement retainer~275 ft

- 13. RIH with pipe and cement stinger and circulate cement to surface
- 14. Cut off well head and install well marker and identification plate per regulatory requirements. RD MO

- Fruirland plus 2703' - 2603'
Chaca plus 3801' - 3701'

Current Wellbore Diagram

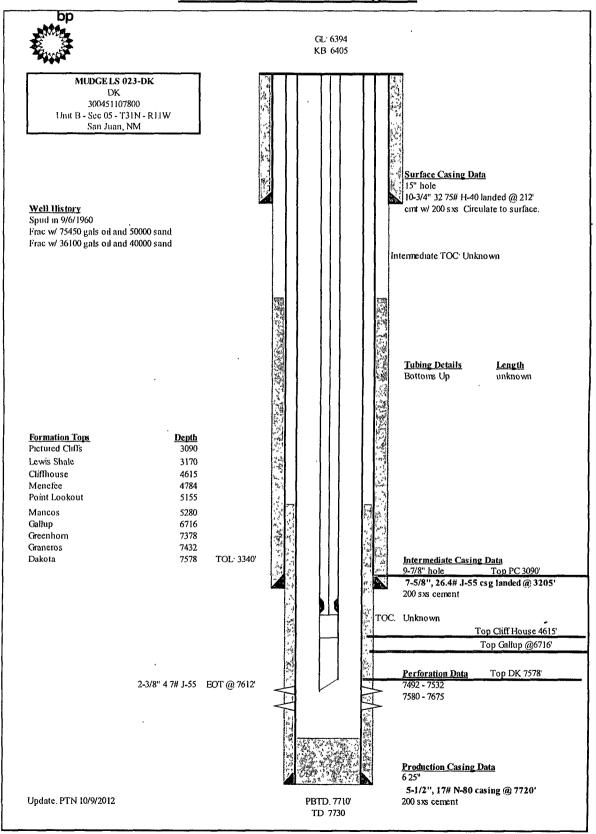

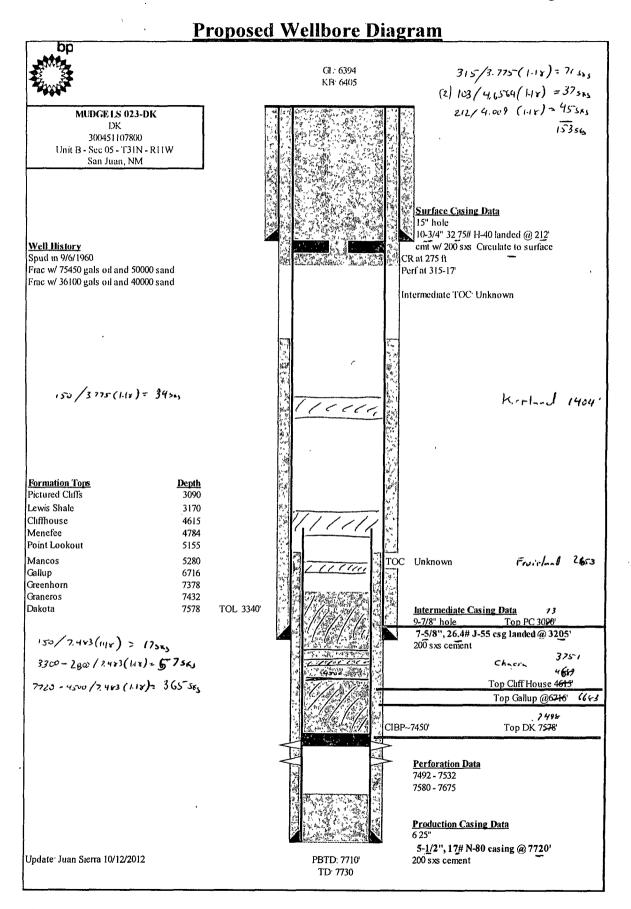

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Attachment to notice of Intention to Abandon:

Re: Permanent Abandonment

Well: 23 Mudge LS

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.
- 3. The following modifications to your plugging program are to be made:
- a) Place a cement plug from 3801' 3701' to cover the Chacra top.
- b) Place the Fruitland plug from 2703' 2603'.
- c) Place a 100' cement plug across the 5 1/2" casing stub.
- d) Place the Kirtland plug from 1454' 1354'.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.