

PN

Submit 3 Copies To Appropriate District Office  
District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
1301 W. Grand Ave., Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources  
**OIL CONSERVATION DIVISION**  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

Form C-103  
Revised May 08, 2003


<b>WELL API NO.</b> 30-045-09481
<b>5. Indicate Type of Lease</b> STATE <input type="checkbox"/> FEE <input type="checkbox"/>
<b>6. State Oil &amp; Gas Lease No.</b>
<b>7. Lease Name or Unit Agreement Name</b> Fannie Ward
<b>8. Well Number</b> #001
<b>9. OGRID Number</b>
<b>10. Pool name or Wildcat</b>

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
<b>1. Type of Well:</b> Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	
<b>2. Name of Operator</b> Southwest Production (NM OCD)	
<b>3. Address of Operator</b> 1000 Rio Brazos, Aztec, NM 87403	
<b>4. Well Location</b> Unit Letter _____ : 1800 feet from the south line and 1520 feet from the west line Section 18 Township 30N Range 11W NMPM County San Juan	
<b>11. Elevation</b> (Show whether DR, RKB, RT, GR, etc.)	

<b>12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data</b>	
<b>NOTICE OF INTENTION TO:</b> PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>	<b>SUBSEQUENT REPORT OF:</b> REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>

**13. Describe proposed or completed operations.** (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

See Attachment

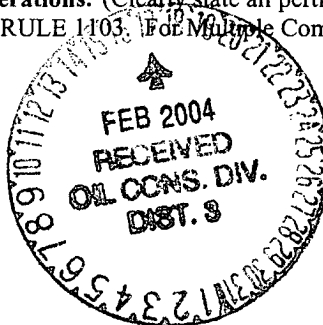

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Randy Blackmon TITLE P&A Supervisor DATE 2/13/04

Type or print name Randy Blackmon

Telephone No. 327-4935

(This space for State use)

APPROVED BY Deputy TITLE DEPUTY OIL & GAS INSPECTOR, DIST. 9 DATE MAY 11 2005

Conditions of approval, if any: 5/11/05

**KEY ENERGY SERVICES  
P&A OPERATION  
CEMENT SERVICE REPORT**

**WELL NAME: FANNIE WARD #1**

**TOTAL PLUGS: 5**

**DATE STARTED: 3-15-02**

**TOTAL SACKS: 480**

**DATE COMPLETED: 3-22-02**

**WITNESS: HENRY VILLENUEVA  
OCD**

MOL & RU. BLEED DOWN TBNG & CSNG. MASTER VALVE STRIPPED OUT. PUMP 70 BBLS DOWN CSNG & 80 BBLS DOWN TBNG. RETURNED DRILLING MUD. ND WELL HEAD. NU BOP. TALLY OOH. TIH W/KILL STRING. TOOH W/KILL STRING. PU LUBRICATOR. RIH W/GAUGE RING TO 3955'. TIH TO 6385'.

PLUG #1: 6385'-5372'. 76 SX. PULL 32 STANDS TO 4393'. REVERSE CIRCULATE. TIH & TAG @ 5341'. PRESS TEST NO GOOD. POOH TO 3457'. LD TBNG. PERF @ 3490'. RIH W/RET SET @ 3457'. PRESS TEST 500 PSI OK.

PLUG #2: 3490'-3322'. 52 SX. (42 SX BELOW RET & 10 SX ABOVE). POOH TO 1868' LD TBNG PERF @ 1923'. NO INJECTION RATE. TIH TO 1993'.

PLUG #3: 1993'-1773'. 16 SX. POOH TO 1183'. LD TBNG. PERF @ 1275'. GOOD INJECTION. RIH W/RET SET @ 1214'.

PLUG #4: 1275'-1099'. 52 SX. (44 SX BELOW RET & 8 SX ABOVE). POOH. PERF @ 545'.

PLUG #5: 545'-SURFACE. 284 SX.

DIG CELLAR. CUT OFF WELL HEAD. INSTALL DRY HOLE MARKER.

A handwritten signature in black ink, reading "Randy Blackmon", with a horizontal line underneath the signature.

RANDY BLACKMON  
P&A SUPERVISOR