Submit 3 Copies To Appropriate District Office District 1 1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Ave., Artesia, NM 88210 District III 1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505 Form C-1 March 4, 2 WELL API NO. 30-045-22140 5. Indicate Type of Lease STATE FEE X 6. State Oil & Gas Lease No.	
The state of the	
1301 W. Grand Ave., Artesia, NM 88210 District III 1000 Rio Brazos Rd., Aztec, NM 87410 District IV OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505 5. Indicate Type of Lease STATE FEE X 6. State Oil & Gas Lease No.	
District III 1000 Rio Brazos Rd., Aztec, NM 87410 District IV 1220 South St. Francis Dr. Santa Fe, NM 87505 5. Indicate Type of Lease STATE FEE x 6. State Oil & Gas Lease No.	
1000 Rio Brazos Rd., Aztec, NM 87410 District IV Santa Fe, NM 87505 SIATE FEE X 6. State Oil & Gas Lease No.	
U. State Off & Cas Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM	
87505	
SUNDRY NOTICES AND REPORTS ON WEDLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BYCK TO/A 7. Lease Name or Unit Agreement Nam	ie
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-10 DEOCS UC) Valentine Cas Com. B	
PROPOSALS.)	
1. Type of Well: Oil Well Gas Well X Other	
2. Name of Operator BP America Production Company 9. OGRID Number 000778	
BP America Production Company 3. Address of Operator 10. Pool name or Wildcat	
P O Box 3092 Houston, TX 77253 Attn: Mary Corley Rm 19.171 Blanco Mesaverde	
4. Well Location	-
T. Well Boulion	
Unit Letter A: 1140 feet from the North line and 1140 feet from the East line	,
Section 32 Township 32N Range 10W NMPM San Juan County	Challes and a ser
11. Elevation (Show whether DR, RKB, RT, GR, etc.)	1
5989' GL Pit or Below-grade Tank Application (For pit or below-grade tank closures, a form C-144 must be attached)	100
Pit Location: ULSectTwpRngPit typeDepth to GroundwaterDistance from nearest fresh water well	
Distance from nearest surface water Below-grade Tank Location ULSectTwpRng;	
feet from theline andfeet from theline	
	\rightarrow
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:	П
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON SUBSEQUENT REPORT OF: REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND	_
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND	_
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT	_
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND	_
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE COMPLETION CEMENT JOB OTHER: OTHER:	X
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDON ABANDON ABANDON CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated)	date
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDON COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE COMPLETION CASING TEST AND CEMENT JOB OTHER: OTHER:	date
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completed operation.	date
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12	date
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3rd plug @ 1484' - 13	date etion
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug 1734' - 1599' w/12 SXS CMT. PU & spot 3rd plug 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT 21488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT 21590' w/12 SXS CMT. TOH. RU wireline, TIH & tag CM	date etion
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3nd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT. @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT.	date etion
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3nd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker.	date etion
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3nd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT. @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT.	date etion
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3rd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker. 06/22/2004 RDMOSU. Surface location turned over to environmental group for surface reclamation.	date etion
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3nd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker.	date etion
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3nd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CM 21230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker. 06/22/2004 RDMOSU. Surface location turned over to environmental group for surface reclamation.	date etion 999, MT
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3rd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker. 06/22/2004 RDMOSU. Surface location turned over to environmental group for surface reclamation.	date etion 999, MT
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2st plug @ 1734' - 1599' w/12 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1488' TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CMT @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker. 06/22/2004 RDMOSU. Surface location turned over to environmental group for surface reclamation. I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or be grade tank has been/will be poststructed or closed according to NMOCD guidelines a general permit or an (attached) alternative OCD-approved plan SIGNATURE	date etion 999, MT
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completor recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2nd plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3nd plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CM 21230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker. 06/22/2004 RDMOSU. Surface location turned over to environmental group for surface reclamation.	date etion 999, MT
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed complet or recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2st plug @ 1734' - 1599' w/12 SXS CMT. PU & spot 3st plug @ 1484' - 13 w/6 SXS CMT. RU wireline, TIH & tag CMT @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CM @ 1488'. TOH. RU & pumped 2 SXS CMT. TOH. RU wireline, TIH & tag CM @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off welthead & CSG. Installed PXA marker. 06/22/2004 RDMOSU. Surface location turned over to environmental group for surface reclamation. Thereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or be grade tank has been/will be anstructed or closed according to NMOCD guidelines , a general permit or an (attached) alternative OCD-approved plan SIGNATURE	date etion 999, MT
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING MULTIPLE CASING TEST AND CEMENT JOB OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed complet or recompletion. 06/18/2004 MIRUSU. Blow down well. NDWH. NU BOP. TOH w/2 3/8" TBG. TIH & spot 1st plug @ 2882' - 2733' w/12 SXS CMT to isolate the Pictured Cliffs. PU & spot 2st plug @ 1734' - 1599' w/12 SXS CMT. TOH. RU wireline, TIH & tag CM @ 1230'. RU & perf @ 300' w/4 JSPF. TOH. TIH to 399' & CMT SQZ w/100 SXS CMT. CMT to surface w/12 SXS CMT. ND BOP. Cut off wellhead & CSG. Installed PXA marker. 06/22/2004 RDMOSU. Surface location turned over to environmental group for surface reclamation. I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or be grade tank has been/will be poststructed or closed according to NMOCD guidelines a general permit or an (attached) alternative OCD-approved plan SIGNATURE	date etion 999, MT