ONTIL	رم سد	.ALD	0	
DEPARTMENT	OF T	HE	INTERIOR	
BUREAU OF	LANI	) MA	NAGEMENT	,

	2006 JAN 9 AM 8 1 Hease Number
. Type of Well	6. If Indian, All. or
GAS	RECEIVED Tribe Name
	070 FARMINGTON HM 7. Unit Agreement Name
. Name of Operator	(01112)77 ·
BURLINGTON	60 10 11 12 13 14 15 25 25 25 25 25 25 25 25 25 25 25 25 25
RESCURCES OIL & GAS	COMPANY
	JAN 2006 🔗 Well Name & Number
. Address & Phone No. of Operato	r RECENED S Hudson #5B
PO Box 4289, Farmington, NM	87499 (505) 325-9000 CONS. DIV. 3. API Well No.
	DIST. 3 30-045-31728
. Location of Well, Footage, Sec 1105' FSL, 665'FWL, Sec. 17, T	
1105 FSE, 005 FWE, Sec. 17, 1	Blanco Mesaverde/Basin Dako
	11. County and State
	San Juan Co, NM
2. CHECK APPROPRIATE BOX TO INDI	CATE NATURE OF NOTICE, REPORT, OTHER DATA
Type of Submission	Type of Action
Notice of Intent	Abandonment Change of Plans
	Recompletion New Construction
X Subsequent Report	Plugging Back Non-Routine Fracturing
Final Abandonment	Casing Repair Water Shut off Altering Casing Conversion to Injection
I IIIdI /Ibdildoiliidii	Other - Completion
13.Describe Proposed or Comple	
-	ted Operations
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. nt, no blow or gas on backside. Cmted w/150 s:	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. nt, no blow or gas on backside. Cmted w/150 s: 2/9/05 MIRU. Test W/H seal to 4000 psi by W	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'.  nt, no blow or gas on backside. Cmted w/150 s: 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'.  nt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'. 'SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'.  nt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'. 'SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. nt, no blow or gas on backside. Cmted w/150 s: 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'. 'SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 s: 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from ent on vacuum.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'. 'SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from ent on vacuum.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'. (SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from tent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'.  nt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from tent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.  @ 5467'. Test MV.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @ 2/28/05 TOOH w/RBP. EOT @ 7194'. TIH w/RBP.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'. (SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from tent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @ 2/28/05 TOOH w/RBP. EOT @ 7194'. TIH w/RBP.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from tent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.  @ 5467'. Test MV.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @ 2/28/05 TOOH w/RBP. EOT @ 7194'. TIH w/ID BOP. NU WH. RDMO.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from vent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.  @ 5467'. Test MV.  / 230 jts of 2 3/8" 4.7# J-55 EUE 8rd tbg set @ 7194'.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @ 2/28/05 TOOH w/RBP. EOT @ 7194'. TIH w/ID BOP. NU WH. RDMO.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from ent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.  @ 5467'. Test MV.  230 jts of 2 3/8" 4.7# J-55 EUE 8rd tbg set @ 7194'.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'. mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'. fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @ 2/28/05 TOOH w/RBP. EOT @ 7194'. TIH w/ID BOP. NU WH. RDMO.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  1'. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from vent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.  @ 5467'. Test MV.  / 230 jts of 2 3/8" 4.7# J-55 EUE 8rd tbg set @ 7194'.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'.  mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'.  fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @ 2/28/05 TOOH w/RBP. EOT @ 7194'. TIH w/D BOP. NU WH. RDMO.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  ''. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from ent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.  @ 5467'. Test MV.  / 230 jts of 2 3/8" 4.7# J-55 EUE 8rd tbg set @ 7194'.  Title Regulatory Specialist Date CEPTED FOR RECORD.
1/6/05 RU Blue Jet. TIH w/CIBP set @ 4160'.  mt, no blow or gas on backside. Cmted w/150 st 2/9/05 MIRU. Test W/H seal to 4000 psi by W 2/12/05 TIH, tag cmt @ 3560'. Mill out to 384 2/13/05 Run GR/CBL/CCL from 4160' to 2900 250' to 3150'. PT 7" csg, no pressure, 7" csg w 2/14/05 PT 7" csg to 200 psi/15 min, OK. 2/15/05 Perf /Frac Lewis formation. 2/16 - 12/18/05 Flow well back. 2/19/05 TIH w/mill. Mill out CIBP S/A 4160'.  fill out CIFP. Blow well. 2/20-12/27/05 Alternate blow/flow well. 2/27/05 Test entire wellbore. TIH w/RBP, set @ 2/28/05 TOOH w/RBP. EOT @ 7194'. TIH w/D BOP. NU WH. RDMO.	Perf 1 squeeze hole @ 3800' (verbally approved by A. Brumley, BLM). Pumped 120 bbls xs Type III cmt (209 cu ft). Displace w/wiper plug w/59 bbls to 3700'.  SI. SDFWE.  1'. CO to CIBP @ 4160'.Circ well clean. PT to 1000 psi/15 min. OK.  ''. TOC @ 3100'. (7" shoe @ 3047') 100% bond from 4160' to 3675'. 80% bond from ent on vacuum.  TIH to 4600', tag bottom of CIBP & sand. CO sand to 4750'.  @ 5467'. Test MV.  / 230 jts of 2 3/8" 4.7# J-55 EUE 8rd tbg set @ 7194'.  Title Regulatory Specialist Date CEPTED FOR RECORD.