Form 3160-5 (September 2001)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED

	 OM B No. 1004-0135 Expires: January 31, 200
Y	 CLINI

☐ Water Shut-Off

Well Integrity

Other CHANGE OUT TUB

SUNDRY	NOTICES	AND	REPORTS	έOΝ	WELLS
--------	---------	-----	---------	-----	-------

Acidize

Alter Casing

Casing Repair

determined that the site is ready for final inspection.)

BUREA SUNDRY NOTI Do not use this form abandoned well. Use	/5. Lease Serial No. SF 078476  6. If Indian, Allottee or Tribe Name		
SUBMIT IN TRIPLICATE- Other instructions on reverse side.			7. If Unit or CA/Agreement, Name and/or No.
1. Type of Well Gas W	8. Well Name and No.		
2. Name of Operator PHOENIX HYDROCARBONS OPERATING CORPORATION			FEDERAL I #1  9. API Well No.
Ba. Address POBOX 3638, MIDLAND, TEXAS 7	79702	3b. Phone No. (include area code) 432-686-9869	30-045-20425
4. Location of Well (Footage, Sec., T., R., M.,	10. Field and Pool, or Exploratory Area  MESAVERDE/DAKOTA		
790' FSL & 1450' FWL; SEC 15, T27N	11. County or Parish, State		
			SAN JUAN, NM
12. CHECK APPROPR	RIATE BOX(ES) TO	INDICATE NATURE OF NOTICE,	REPORT, OR OTHER DATA
TYPE OF SUBMISSION		TYPE OF ACTION	
		<del></del>	

Production (Start/Resume)

Reclamation

Recomplete

✓ Subsequent Report Change Plans **STRING 1-1/2" TO** Plug and Abandon Temporarily Abandon Final Abandonment Notice Plug Back Convert to Injection 2-3/8" 13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has

New Construction

Deepen

Fracture Treat

4/23/06 RU PHOENIX WIRELINE; RUN 1.516 GAUGE RING TO & SET DOWN; POH & RUN 1.25 IMPRESSION BLOCK TO 6639' & ELEV; POH & RIH W/1.516 SWEDGE & COULD NOT GET THROUGH TIGHT SPOT; POH; RD WIRELINE; SWI

4/26/06 MI RIG

Notice of Intent

4/27/06 SET ANCHORS; RU RIG & EQUIP; BLOW WELL DOWN; PUMP 15 BBLS 2% KLL DOWN DAKOTA STRING & NU BOP & PULL'SHORT STRING 139 JTS 1-1/2", IJ SN & PERF SUB; ND BOP PULL DON; NU BOP; RU WIRELINE SPECIAL & FREE POINT 1-1/2" LONG STRING; PIPE FREE TO PKR; POH & RUN 1.23 JET CUTTER & CUT 1-1/2" @ 6410'; POH & RD WIRLINE; WORK TBG FREE; POH LD 1-1/2" LONG STRING; PULL 104 JTS 1-1/2"; SWI

4/28/06 TP=70; CP=70; FINISH OUT OF HOLE W/LONG STRING; 197 JTS 1-1/2" TOTAL LD; TOTAL 336 JTS 1-1/2", RUN 2-3/8" MULE SHOE, 1 25/32" SN & 196 JTS 2-3/8" NEW J-55 TBG; EOT W/ELV 6388'; ND BOP & NU WH; RU SWAB & MADE 5 RUNS 6000' TO 6386', REC 5 BBLS; SWI.

OVER					$\tilde{\mathcal{L}}_{\tilde{\mathcal{L}}}$				
A2T-1899			<i>N</i>						
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)		38							
BILLY J SNEED Title CONSULTING ENGINEER					$C_{\Sigma}$				
Signature Sall Mudd	Date	05/17/2006			္သ				
THIS SPACE FOR FEDERAL OR STATE OFFICE USE									
Approved by		Title	Date						
Conditions of approval, if any, are attached. Approval of this notice does not warrancertify that the applicant holds legal or equitable title to those rights in the subject lewhich would entitle the applicant to conduct operations thereon.	Office								

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

JUN 0 1 2006

(Instructions on page 2)

FEDERAL I#1, CONT'D

5/01/06 TP=0; CP=90; OPEN WELL UP; START SWAB; TAG @ 5900'; MADE 15 RUNS & REC 18 BBLS; RD RIG

5/02/06 TP=140; CP=90; INSTALL PLUNGER LUBRICATOR; RU HURRICANE SWAB; MADE 1 RUN; TAG @ 5800' PULL FROM SN; PUMP 500 GAL GAS TREAT DOWN TBG & 250 GAL DOWN CSG; SWI

5/03/06 TP=VAC; CP=95; RIH W/SWAB & TAG @ 5500'; MADE 17 RUNS & REC 25 BBLS; DROP PLUNGER & TRIED TO RUN PLUNGER; WOULD NOT RUN; SWI.

5/04/06 TP=152; CP=120; SHOT FLUID LEVEL; CSG @ 4225', TBG @ 6207'; BLOW WELL DOWN; RU SWAB & RIH; PULL PLUNGER; MADE 5 SWAB RUNS TAG @ 6200'; RD & RELEASE SWAB RIG; SWI

5/05/06 TP=150; CP=100; RU PHOENIX WIRELINE; RIH PULL BUMPER SPRINGER @ 6386'; RIH & SET 3 SLIP STOP @ 5538'; RIH SHOT ½" HOLE; RIH SHOT 2<sup>ND</sup> HOLE; POH, GUN DID NOT FIRE; RIH & SHOT 2<sup>ND</sup> HOLE @ 5537'; POH RD WIRELINE; HANG WELL ON @ 10:00 AM.