Form 3160-5 (April 2004)

UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

FORM APPROVED
OM B No. 1004-0137
Expires: March 31, 200

CHIMDDY	NOTICES	AND	REPORTS	Δ NI	WEILE

SUBMIT IN TRI	IPLICATE- Other ins	tructions on r		RECEIVERU			Vor No.
Type of Well			070 F	armin gt g i	arilla 35 leas	ie As	ACOR.
Öil Well	Gas Well Other				Il Name and N	a c. Al	in a the contract of
Name of Operator ENERGEN F	RESOURCES				arilla 35#3 I Well No.	la la	λ.· ·
Address 2198 Bloomfield Hwy Farming	ton,NM 87401	3b. Phone No. (i 505.325.6800	include area code)	L	-039-21304	Exploratory Area	<u> </u>
Location of Well (Footage, Sec.,)			South Blanco PC/Otero CH			
990' FNL 1650' FEL Sec ₹2 T2	24N R5W NMPM			11. Co	unty or Parish,	State	:
				Ri	o Arriba Cou	inty, NM	
12. CHECK AF	PPROPRIATE BOX(ES) TO	O INDICATE NA	ATURE OF NO	TICE, REPORT,	OR OTHE	R DATA	
TYPE OF SUBMISSION			TYPE OF AC	TION			
	Acidize	Deepen	Produ	ection (Start/Resum	e) War	ter Shut-Off	
Notice of Intent	Alter Casing	Fracture Treat	Recla	mation	□we	ll Integrity	
Subsequent Report	Casing Repair	New Construc		mplete	Oth	er	
Final Abandonment Notice	Change Plans	Plug and Aban		orarily Abandon			
	Convert to Injection	Plug Back	∟ Wate	r Disposal			
If the proposal is to deepen dire Attach the Bond under which the following completion of the inv testing has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NU	ctionally or recomplete horizonta ne work will be performed or pro- volved operations. If the operational Abandonment Notices shall be for final inspection.) ted in follwo-up to the NOI for the SCRAPER - TIH T	ally, give subsurface levide the Bond No. or on results in a multiple pe filed only after all refiled on 12/12/05) TO 2800 RKB - TO	n file with BLM/Bl completion or rece equirements, include H ND BHA - NU	ared and true vertical A. Required subsequent of the subsequent of	depths of all pe tent reports sha terval, a Form e been complet	ertinent markers an all be filed within 3 3160-4 shall be fil led, and the operate	nd zones. 30 days led once or has
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitted in the site is ready) (This Subsquent is submitted in the site is ready) (This Subsquent is submitted in the site is ready) 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NU RKB - 260 TO SURFACE 3.CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - 1 WELL - SDFN . 5. CSG 0 PSI - TIH . DRLOTO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI 6. CSG 10 PSI - BDW - TI	ctionally or recomplete horizontate work will be performed or provolved operations. If the operational Abandonment Notices shall be for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) The second for final inspection. The second for final inspection for final inspection. The second for final inspection.	ally, give subsurface levide the Bond No. or on results in a multiple per filed only after all refiled on 12/12/05) TO 2800 RKB - TOPSI - TOH W/ PRIBP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIWIT W/ 2 % C.C & LS DISPLACEMENT TOH W/ WRK SB - C/O W/ AIR MI	ocations and measure file with BLM/Bl completion or reconcurrents, included the ND BHA - NU & . TIH W/ PRK -	ared and true vertical A. Required subsequent period in a new in the period in the	depths of all per pent reports shatterval, a Form e been complet ATE CSG LI D PSI, OK - 1 OT TRK - SQ TD NEAT CE RD HALLIB , TEST BRAI	artinent markers an all be filed within 3 3160-4 shall be filed, and the operate EAK F 320 RKI FOH W/PRK- DUEEZE BRADEMT - PUMP CIURTON - SECU DEN HEAD SQ TOH ND BHA	ad zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE PUEEZE - TIH
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitted in the site is ready) (This Subsquent is submitted in the site is ready) (This Subsquent is submitted in the site is ready) 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NU RKB - 260 TO SURFACE 3.CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - 1 WELL - SDFN . 5. CSG 0 PSI - TIH . DRLOTO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI 6. CSG 10 PSI - BDW - TI	ctionally or recomplete horizonta ne work will be performed or pro rolved operations. If the operatio nal Abandonment Notices shall b for final inspection.) ted in follwo-up to the NOI f U BIT & SCRAPER - TIH T OK - RATE 2 BPM @ 400 I RBP & TBG - TIH, SET R B - LEAK AT 300 RKB - SI IIH, SET PRK @ 137 RKB IIH, SET PRK @ 137 RKB IIH, SET PRK @ 137 RKB IIH, SET PRK @ 1400 RKB IIH, SET PRK @ 156 LB/GAL - PUMP 2 BBI G F/ 1020 FT TO 1400 RKB RE WELL - SDFN H, TAG FILL @ 3600 RKB 131 RKB - S.N. @ 3427 RKB	ally, give subsurface levide the Bond No. or on results in a multiple per filed only after all refiled on 12/12/05) TO 2800 RKB - TOPSI - TOH W/ PRIBP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIWIT W/ 2 % C.C & LS DISPLACEMENT TOH W/ WRK SB - C/O W/ AIR MI	ocations and measure file with BLM/Bl completion or reconcurrents, included the ND BHA - NU & . TIH W/ PRK -	ared and true vertical A. Required subsequent period in a new in the period in the	depths of all per pent reports shatterval, a Form e been complet ATE CSG LI D PSI, OK - 1 OT TRK - SQ TD NEAT CE RD HALLIB , TEST BRAI	artinent markers an all be filed within 3 3160-4 shall be filed, and the operate EAK F 320 RKI FOH W/PRK- DUEEZE BRADEMT - PUMP CIURTON - SECU DEN HEAD SQ TOH ND BHA	ad zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NI RKB - 260 TO SURFACE 3. CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - ' HEAD LEAK @ 300 RKB 222 PSI - RATE 3 BPM - I WELL - SDFN. 5. CSG 0 PSI - TIH. DRLA TO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI W/ PROD TBG - LD @ 34 REPORT . RDMO WSU. I	ctionally or recomplete horizonta ne work will be performed or pro rolved operations. If the operatio nal Abandonment Notices shall b for final inspection.) ted in follwo-up to the NOI f U BIT & SCRAPER - TIH T OK - RATE 2 BPM @ 400 I RBP & TBG - TIH, SET R B - LEAK AT 300 RKB - S IIH, SET PRK @ 137 RKB F - PUMP 100 SKS STD CEN 15.6 LB/GAL - PUMP 2 BBI G F/ 1020 FT TO 1400 RKB RE WELL - SDFN H, TAG FILL @ 3600 RKB 131 RKB - S.N. @ 3427 RKB RTP WELL.	ally, give subsurface levide the Bond No. or on results in a multiple per filed only after all refiled on 12/12/05) TO 2800 RKB - TOPSI - TOH W/ PRIBP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIWIT W/ 2 % C.C & LS DISPLACEMENT TOH W/ WRK SB - C/O W/ AIR MI	ocations and measure file with BLM/Bl completion or reconcurrents, included the ND BHA - NU & . TIH W/ PRK -	ared and true vertical A. Required subsequent period in a new in the period in the	depths of all per pent reports shatterval, a Form e been complet ATE CSG LI D PSI, OK - 1 OT TRK - SQ TD NEAT CE RD HALLIB , TEST BRAI	artinent markers an all be filed within 3 3160-4 shall be filed, and the operate EAK F 320 RKI FOH W/PRK- DUEEZE BRADEMT - PUMP CIURTON - SECU DEN HEAD SQ TOH ND BHA	ad zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NI RKB - 260 TO SURFACE 3. CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - HEAD LEAK @ 300 RKB 222 PSI - RATE 3 BPM - 1 WELL - SDFN . 5. CSG 0 PSI - TIH . DRLC TO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI W/ PROD TBG - LD @ 34	ctionally or recomplete horizonta ne work will be performed or pro rolved operations. If the operatio nal Abandonment Notices shall b for final inspection.) ted in follwo-up to the NOI f U BIT & SCRAPER - TIH T OK - RATE 2 BPM @ 400 I RBP & TBG - TIH, SET R B - LEAK AT 300 RKB - S IIH, SET PRK @ 137 RKB F - PUMP 100 SKS STD CEN 15.6 LB/GAL - PUMP 2 BBI G F/ 1020 FT TO 1400 RKB RE WELL - SDFN H, TAG FILL @ 3600 RKB 131 RKB - S.N. @ 3427 RKB RTP WELL.	ally, give subsurface levide the Bond No. or on results in a multiple per filed only after all refiled on 12/12/05) TO 2800 RKB - TOPSI - TOH W/ PRIBP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIWIT W/ 2 % C.C & LS DISPLACEMENT TOH W/ WRK SB - C/O W/ AIR MI	ocations and measure file with BLM/Bl completion or reconcurrents, included the ND BHA - NU & . TIH W/ PRK -	ared and true vertical A. Required subsequent period in a new in the period in the	depths of all per pent reports shatterval, a Form e been complet ATE CSG LI D PSI, OK - 1 OT TRK - SQ TD NEAT CE RD HALLIB , TEST BRAI	artinent markers an all be filed within 3 3160-4 shall be filed, and the operate EAK F 320 RKI FOH W/PRK- DUEEZE BRADEMT - PUMP CIURTON - SECU DEN HEAD SQ TOH ND BHA	ad zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NI RKB - 260 TO SURFACE 3.CSG 0 PSI - TALLY PU F/SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - ' HEAD LEAK @ 300 RKB 222 PSI - RATE 3 BPM - 1 WELL - SDFN . 5. CSG 0 PSI - TIH . DRLI TO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI W/PROD TBG - LD @ 34 REPORT . RDMO WSU. 1	ctionally or recomplete horizonta ne work will be performed or pro rolved operations. If the operatio nal Abandonment Notices shall b for final inspection.) ted in follwo-up to the NOI f U BIT & SCRAPER - TIH T OK - RATE 2 BPM @ 400 I RBP & TBG - TIH, SET R B - LEAK AT 300 RKB - SI TIH, SET PRK @ 137 RKB F PUMP 100 SKS STD CEN 15.6 LB/GAL - PUMP 2 BBI G F/ 1020 FT TO 1400 RKB RE WELL - SDFN H, TAG FILL @ 3600 RKB 131 RKB - S.N. @ 3427 RKB RTP WELL.	ally, give subsurface levide the Bond No. or on results in a multiple per filed only after all refiled on 12/12/05) TO 2800 RKB - TO PSI - TOH W/ PRI BP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIMT W/ 2 % C.C & LS DISPLACEMEN B - TOH W/ WRK SB - C/O W/ AIR MIB - NU TBG HGR ,	ocations and measure file with BLM/Bl completion or reconcurrents, included the ND BHA - NU & . TIH W/ PRK -	Treed and true vertical A. Required subsequently and a new ir ting reclamation, have a preclamation, have a preclamation of the preclamatical	depths of all per pent reports shatterval, a Form e been complet ATE CSG LI D PSI, OK - 1 OT TRK - SQ TD NEAT CE RD HALLIB , TEST BRAI	artinent markers an all be filed within 3 3160-4 shall be filed, and the operate EAK F 320 RKI FOH W/PRK- DUEEZE BRADEMT - PUMP CIURTON - SECU DEN HEAD SQ TOH ND BHA	ad zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NI RKB - 260 TO SURFACE 3. CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - 'HEAD LEAK @ 300 RKB 222 PSI - RATE 3 BPM - I WELL - SDFN. 5. CSG 0 PSI - TIH. DRLATO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI W/PROD TBG - LD @ 34 REPORT - RDMO WSU. I	ctionally or recomplete horizonta ne work will be performed or pro rolved operations. If the operatio nal Abandonment Notices shall b for final inspection.) ted in follwo-up to the NOI f U BIT & SCRAPER - TIH T OK - RATE 2 BPM @ 400 I RBP & TBG - TIH, SET R B - LEAK AT 300 RKB - SI TIH, SET PRK @ 137 RKB F PUMP 100 SKS STD CEN 15.6 LB/GAL - PUMP 2 BBI G F/ 1020 FT TO 1400 RKB RE WELL - SDFN H, TAG FILL @ 3600 RKB 131 RKB - S.N. @ 3427 RKB RTP WELL.	ally, give subsurface levide the Bond No. or on results in a multiple per filed only after all refiled on 12/12/05) TO 2800 RKB - TO PSI - TOH W/ PRI BP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIMT W/ 2 % C.C & LS DISPLACEMEN B - TOH W/ WRK SB - C/O W/ AIR MIB - NU TBG HGR ,	ocations and measure file with BLM/Bl completion or recepturements, included the ND BHA - NU K . TIH W/ PRK -	Treed and true vertical A. Required subsequently and a new ir ting reclamation, have a preclamation, have a preclamation of the preclamatical	depths of all percent reports shaterval, a Form e been complet ATE CSG LI D PSI, OK - 7 ATT TRK - SQ TO NEAT CERD HALLIB , TEST BRAILS IS DEPTH - 7 A - TURN TO	Timent markers and the filed within 3 3160-4 shall be filed, and the operated and the opera	nd zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH - FINAL
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NI RKB - 260 TO SURFACE 3.CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - ' HEAD LEAK @ 300 RKB 222 PSI - RATE 3 BPM - I WELL - SDFN. 5. CSG 0 PSI - TIH. DRLA TO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI W/PROD TBG - LD @ 34 REPORT . RDMO WSU. I	ctionally or recomplete horizonta ne work will be performed or pro rolved operations. If the operatio nal Abandonment Notices shall b for final inspection.) ted in follwo-up to the NOI f U BIT & SCRAPER - TIH T OK - RATE 2 BPM @ 400 I RBP & TBG - TIH, SET R B - LEAK AT 300 RKB - SI TIH, SET PRK @ 137 RKB F PUMP 100 SKS STD CEN 15.6 LB/GAL - PUMP 2 BBI G F/ 1020 FT TO 1400 RKB RE WELL - SDFN H, TAG FILL @ 3600 RKB 131 RKB - S.N. @ 3427 RKB RTP WELL.	ally, give subsurface levide the Bond No. or on results in a multiple of filed only after all refiled on 12/12/05) TO 2800 RKB - TO! PSI - TOH W/ PRIBP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIMT W/ 2 % C.C & LS DISPLACEMENT SI - TOH W/ WRK SI - C/O W/ AIR MI B - NU TBG HGR ,	ocations and measure file with BLM/Bl completion or reconstruction of reconstruction of the sequirements, included the sequirements of the	Treed and true vertical A. Required subsequence of the properties	depths of all percent reports shaterval, a Form e been complet ATE CSG LI D PSI, OK - 7 ATT TRK - SQ TO NEAT CERD HALLIB , TEST BRAILS IS DEPTH - 7 A - TURN TO	artinent markers an all be filed within 3 3160-4 shall be filed, and the operate EAK F 320 RKI FOH W/PRK- DUEEZE BRADEMT - PUMP CIURTON - SECU DEN HEAD SQ TOH ND BHA	nd zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH - FINAL
If the proposal is to deepen dire Attach the Bond under which the following completion of the investing has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NI RKB - 260 TO SURFACE 3.CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - HEAD LEAK @ 300 RKB 222 PSI - RATE 3 BPM - I WELL - SDFN . 5. CSG 0 PSI - TIH . DRLA TO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI W/ PROD TBG - LD @ 34 REPORT . RDMO WSU. I	ctionally or recomplete horizonta ne work will be performed or pro rolved operations. If the operatio nal Abandonment Notices shall b for final inspection.) ted in follwo-up to the NOI f U BIT & SCRAPER - TIH T OK - RATE 2 BPM @ 400 ! RBP & TBG - TIH, SET R B - LEAK AT 300 RKB - SI TIH, SET PRK @ 137 RKB - PUMP 100 SKS STD CEN 15.6 LB/GAL - PUMP 2 BBI G F/ 1020 FT TO 1400 RKB RE WELL - SDFN H, TAG FILL @ 3600 RKB SI RKB - S.N. @ 3427 RKB RTP WELL. going is true and correct hez	ally, give subsurface levide the Bond No. or on results in a multiple of filed only after all refiled on 12/12/05) TO 2800 RKB - TO! PSI - TOH W/ PRIBP @ 2690 RKB - ECURE LOC - SD B - RU HOWCO CIMT W/ 2 % C.C & LS DISPLACEMENT SI - TOH W/ WRK SI - C/O W/ AIR MI B - NU TBG HGR ,	ocations and measure file with BLM/Bl completion or reconstruction of reconstruction of the completion of reconstruction of the completion of reconstruction of the completion	Treed and true vertical A. Required subsequence of the properties	depths of all perent reports shaterval, a Form e been completed at East CSG Line of the CSG Li	EPTED FO	nd zones. 30 days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH - FINAL
If the proposal is to deepen dire Attach the Bond under which the following completion of the invitesting has been completed. Fir determined that the site is ready (This Subsquent is submitt 1. MIRU WSU. NU BOP 2. CSG 30 PSI - BDW - NI RKB - 260 TO SURFACE 3.CSG 0 PSI - TALLY PU F / SURFACE TO 292 RK 4. CSG 0 PSI - NU PRK - ' HEAD LEAK @ 300 RKB 222 PSI - RATE 3 BPM - I WELL - SDFN. 5. CSG 0 PSI - TIH. DRLA TO 300 PSI , OK - SECUR 6. CSG 10 PSI - BDW - TI W/PROD TBG - LD @ 34 REPORT . RDMO WSU. I	ctionally or recomplete horizontate work will be performed or provolved operations. If the operational Abandonment Notices shall be for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.) ted in follwo-up to the NOI for final inspection.)	ally, give subsurface levide the Bond No. or on results in a multiple per filed only after all refiled on 12/12/05) TO 2800 RKB - TO PSI - TOH W/ PRI ECURE LOC - SD - RU HOWCO CIMT W/ 2 % C.C & LS DISPLACEMEN - TOH W/ WRK SB - C/O W/ AIR MIB - NU TBG HGR ,	ocations and measure file with BLM/BI completion or reconsequirements, include the ND BHA - NU K. TIH W/ PRK - TIH W/ PRK	Treed and true vertical A. Required subsequence of the properties	depths of all percent reports shaterval, a Form e been completed. ATE CSG LID PSI, OK - 7 ATT TRK - SQ TD NEAT CERD HALLIB TEST BRAILES TURN TO	EPTED FO	d zones. d days led once or has B TO 261 CSG OK DEN EMT @ URE DUEEZE - TIH - FINAL

(Instructions on page 2)

