Submit 3 Copies To Appropriate District Office	State of New Mexico			Form C-103 Revised March 25, 1999		
District 1 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources			WELL API NO.		
District II	OH CONCEDIA	A TIONI I	30-045-13268			
811 South First, Artesia, NM 88210	OIL CONSERVATION DIVISION			5. Indicate Type of	of Lease	$\neg \neg$
<u>District III</u> 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.			STATE	FEE X	
District IV	Santa Fe, NM 87505			6. State Oil & G	as Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM 87505						
	S AND REPORTS ON	WELAS	31173	7. Lease Name or	Unit Agreement Nan	ne:
(DO NOT USE THIS FORM FOR PROPOSAL	LS TO DRILL OR TO DEEPE	ENAOROPLUC	BBACK TO A	,,		1
DIFFERENT RESERVOIR. USE "APPLICA"	FION FOR PERMIT" (FORM	<b>Æ-10</b> 1) FOR	SECH CA	Hutto	on Gas Com	ļ
PROPOSALS.)  1. Type of Well:	الم	ال الحري	1 5002 —J			ļ
Oil Well Gas Well	Other	E A	Children on			
2. Name of Operator	(6	S OIL C	ONG DIV.	8. Well No.		$\neg$
BP America Production Company	Attn: Cherry Hlava		)15T. 3 S		1	}
3. Address of Operator		(C)	200	9. Pool name or V	Vildcat	
P.O. Box 3092 Houston, TX 77253		8/	11 01 61 41 250	Basin Dakota		
4. Well Location			Craita July			
Unit Letter H 15	515feet from theN	lorth lin	e and <u>940</u> fee	et from the <u>East</u>	line	
Court 6 Tra	. 1.5. 20N D	401		M. Can luan	0 .	
		nge 12V			County	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)  5435' GR						
11 Check An	propriate Box to Ind			Papart or Other 1	Doto	
		icaie ivai		SEQUENT REI		
NOTICE OF INTI		$\neg$ $\mid$	SUBS REMEDIAL WORK		ALTERING CASING	· —
FERFORINI REINIEDIAL WORK	PLUG AND ABANDON	_	KENIEDIAL WORF	`	ALIERING CASING	<i>,</i> С
TEMPORARILY ABANDON ☐ CHANGE PLANS COMMENCE DRI				LING OPNS.	PLUG AND	
		i		_	ABANDONMENT	Ш
	MULTIPLE		CASING TEST AN	D 🗀		
'	COMPLETION		CEMENT JOB			
OTHER: Well Clean out & Return to	Production	×	OTHER:			
12. Describe proposed or completed				ve nertinent dates	including estimated d	late
of starting any proposed work).	SEE RULE 1103. For M	Iultiple Co	mpletions: Attach	wellbore diagram	of proposed completion	on
or recompilation.					r - p p	
-						
6/11/03 Lay 3" blow line & blow down	n well. Tbg 50 psi, Csg 5	550 psi BH	OPSI. NDWH, NU	JBOPs. TIH land T	og @ 6064'. TIH w/2	00,
of TBG. SDFN.						
	- <b></b>		_			
6/12/03 Finish TIH w/TBG & scrape	r. Tag fill @ 6075′. <i>C/O</i>	fill to PBT	D@ 6100'. Test we	:II thru 孝" CK to blw	back tnk. 550 MCFD	, @
75 to 80 PSI. SDFN.						
4/13/03 CCC 400 DCT TOLLW/AL-	8 a. a. a. a. a. a	- O (OE)		. 500 DCT /: 1		2.5
6/13/03 CSG 490 PSI. TOH W/tbg floor. NDBOPs, NUWH. RU WL & pull						. RD
Hoor. NOBOFS, NOWH, RO WE & Pull	λα Γπιρριε plugs. Set	i BG STOP G	2 0042. KD WITEIIN	e. Clean location. F	telease rig.	
I handky postify that the information -	h	4 - 4 - 41 - 1 - 1		11 11 6		
I hereby certify that the information a	pove is true and comple	te to the be	st of my knowledg	ge and bener.		
SIGNATURE (hurry Ala	11a		FITLE Regulator	v Analyst D	ATE 07/28/2003	
Type or print name Cherry Hlava	1			l'elephone	No. 281-366-4081	
(This space for State use)	[				JUL 3 1 2	ነጠብ «
APPPROVED BY Man	1/_	TITIOEPI	ITY OIL & GAS IMS	<b>Drevo</b> r	11 6	uus
Conditions of approval, if any:		1111111	CHI CINU D SIE	ratus, Dist. 🤔	DATE	

And the state of t