Submit 3 Copies To Appropriate District	State of New M	<b>I</b> exico		Form C-103
Office District I	Energy, Minerals and Na	tural Resources	IVELL ABLAC	Revised May 08, 2003
1625 N. French Dr., Hobbs, NM 88240 District II			WELL API NO.	045-10151
1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATIO		5. Indicate Type of	
<u>District III</u> 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fr	AGE IS DON'T	STATE	FEE X
District IV	Santa Fe, XINP	87505	6. State Oil & Gas	
1220 S. St. Francis Dr., Santa Fe, NM 87505		2003		
STINDBY NOT	CES AND REPORTS ON WELL	<b>10</b>	7. Lease Name or	Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPLEN OR PEUG BACK WO'A				
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FOR SUCH 3 PROPOSALS.)				ruston LS
1. Type of Well:			8. Well Number	
Oil Well Gas Well X	Other	S/ S/ 6/ 6/ 8/ 8/ 8/ 8/ 8/ 8/ 8/ 8/ 8/ 8/ 8/ 8/ 8/		1
2. Name of Operator			9. OGRID Numbe	er
BP America Production Company				000778
* · · · · · · · · · · · · · · · · · ·			10. Pool name or	
Attn: Mary Corley P.O. Box 3092 Houston, Texas 77253 Blanco Mesaverde				) Mesaverde
4. Well Location				
Unit Letter H : 1	750 feet from the Nort	h line and	990 feet from t	he East line
Ome Better 11 . 1	rect from the 14014	mic and	<u> </u>	ne <u>Bust</u> me
Section 31 Township 31N Range 11W NMPM County San Juan				
11. Elevation (Show whether DR, RKB, RT, GR, etc.)				
		328'		
	Appropriate Box to Indicate			
NOTICE OF IN			SEQUENT REI	
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WOR	к Ц	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRI		PLUG AND
PULL OR ALTER CASING	MULTIPLE	CASING TEST AN		ABANDONMENT
	COMPLETION	CEMENT JOB	_	
OTHER:	,	OTHER: F	Pay Add	П
	leted operations. (Clearly state a			s. including estimated date
of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion				
or recompletion.				
06/06/2003 MIRUSU. Blow down wellhead. Kill w/2% KCL WTR. NDWH. NU BOPs. Test BOPs to 500#. Test OK. TOH w/production TBG. RU & ran GR log. RU, T1H w/C1BP & set @ 4420'. Load hole with 2% KCL. Press Test to 500#. Test				
<del>-</del>	•	<u> </u>		
ok. Pressure test CSG to 2500#. Test ok. RU & Perforate Menefee formation w/2 JSPF, .300 inch diameter, 20 Shots / 40 Holes: 3851, 3867, 3874, 3885, 3914, 3933, 3950, 3964, 3964, 4008, 4018, 4028, 4048, 4058, 4068, 4081, 4102, 4114, 4150.				
Install wellhead isolation tool. Spearhead 500 gal 15% HCL, establish injection rate, and frac w/84,000# 16/30 Brday Sand,				
70% Quality Foam & N2. RU & flowback frac thru ¼" choke for 16 hrs. Upsized to ½" choke & flowed back for 48 hrs.				
Upsized to 3/4" choke & flowed back 2 hrs. TIH & tag fill @ 4060'. C/O to top of CIBP. Mill out CIBP & circ hole clean.				
TIH & tag fill @ 4740'. C/O to PBTD @ 4749'. TOH. TIH w/2-3/8" production TBG & and land @ 4707'. ND BOP's. NUWH. Test well for air.				
	hrs. Return well to production.			
00/20/2003 RDMOSC 17.30 /	ins. Return wen to production.			
I hereby certify that the information above is true and complete to the best of my knowledge and belief.				
SIGNATURE Mary Cosley TITLE Senior Regulatory Analyst DATE 07/22/2003				
Type or print name Mary Corley Telephone No. 281-366-4491				
(This space for State use)		<del></del>		
$\sim$ / /	1 1	DELITA OTH R CAS IMSO	RCKOL UNDING	Mar a -
A DDDD OLIDE STORY	J. V	puty cil & gas insp		JUL 28 2003
APPPROVED BY Conditions of approval, if any:	XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX	PUTY QIL & GAS INSP		JUL 2 8 2003 DATE