

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
March 4, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-039-25612
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		7. Lease Name or Unit Agreement Name San Juan 28-6 Unit
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		8. Well Number #207M
2. Name of Operator Burlington Resources Oil & Gas Company LP		9. OGRID Number 14538
3. Address of Operator P.O. Box 4289, Farmington, NM 87499-4289		10. Pool name or Wildcat Blanco Mesaverde/ Basin Dakota
4. Well Location Unit Letter <u>F</u> : <u>1450</u> feet from the <u>North</u> line and <u>1575</u> feet from the <u>West</u> line Section <u>10</u> Township <u>27N</u> Range <u>6W</u> NMPM Rio Arriba County		
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: Tubing Repair/Replace <input checked="" type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached:

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE Amanda Sanchez TITLE Regulatory Analyst DATE 9/15/06

Type or print name Amanda Sanchez E-mail address: asanchez@br-inc.com Telephone No. 505-326-9891

(This space for State use)

APPROVED BY H. Villanueva TITLE DEPUTY OIL & GAS INSPECTOR, DIST. 8 DATE SEP 20 2006
Conditions of approval, if any:

7/17/06 MIRU Drake #22. Lay 2" line to FB tank. Check psi tbg @130#, csg @190#. BWD. Kill tbg w/10bbls 2% KCL H2). ND tree. NU BOP. PU tbg tongs, lay 3" line to FB tank. RU Phoenix W/L. Fish three stop @ 6310'. RD W/L. Run 1 5/8" weight bars, tag @ 6345'. TOH. RIH w/freepoint, free to 6345'. POH chemical cut tbg @ 6332'. POH. RD W/L. Pull tbg hanger, LD 2jts 2 3/8" tbg. 7/18/06 LD tbg from 4750' to 5200'. Pitted w/holes. PUMU baker outside cutter for 2 3/8" tbg 4 1/2" csg, 3jts WO pipe 6jts 3 1/8" DC's, XO. TIH w/2 3/8" 4.7# tbg and baker BHA to 5830'. RU swivel. Workover fish w/outside cutter, cut off tbg @ 6410'. RD swivel. TOH w/ 2 3/8" tbg. 7/19/06 TIH w/baker 3 7/8" full open overshot to 6400'. Latch onto tbg @ 6410'. RIH w/1 5/8" weight bars tag @ 6858'. POH w/3/4" rod on W/L tag @ 6858'. POH freepoint tbg, free to 6850'. RIH w/chemical cutter cut tbg @ 6848'. RD W/L. TOH w/2 3/8" tbg. LD fish tools and fish. 7/20/06 TIH w/baker outside cutter, 90'x3 3/4" WO pipe, XO, 6jts 3 1/8" DC's, XO, and 2 3/8" tbg in hole to 6800'. RU swivel, work over tbg from 6829' to 6910'. Cut tbg off. LD 2jts tbg. RD swivel. TOH w/ 2 3/8" tbg, LD WO pipe and 2 3/8" tbg. TOF @6910'. TIH w/baker outside cutter, 90'x3 3/4" WO pipe, XO, 6jts 3 1/8" DC's, XO and 2 3/8" tbg in hole to 6900'. RU swivel. Workover tbg from 6910' to 7020'. LD 2jts tbg. RD swivel. TOH w/ 2 3/8" tbg. LD WO pipe and no fish. TOF @ 6910', Outside cutter blade broke, no cut. 7/21/06 TIH w/baker outside tbg cutter, 5jts 3 3/4" WO pipe, LD XO, 6jts 3 1/8" DC's, XO, on 2 3/8" tbg to 6900'. RU swivel. PUMU 2 3/8", workover tbg fist to 7065'. Tag fill. Pull up to 7034', attempt to make a cutoff. TOH w/2 3/8" tbg, 5jts 3 1/8" DC's. PUMU baker screwing sub, 3 1/8" bumpersub, 6jts 3 1/8" DC's, and 62jts 2 3/8" tbg. 7/22/06 TIH w/2 3/8" tbg and baker fish tools. Screw into fish @ 6841'. Work fish free. LD 4 jts 2 3/8" tbg. TOH w/2 3/8" tbg, stand back 6jts 3 1/8" DC's LD fish tools and fish. PUMU baker outside cutter 3 3/4" x 2 3/8" 3jts 3 3/4" WO pipe, XO, 6jts 3 1/8" DC's XO. TIH w/ 2 3/8" tbg to 6900'. RU swivel, work over fish to 7000', cut tbg pull up LD 4 jts 2 3/8". RD swivel. TOH w/ 2 3/8" tbg, STD back DC's, LD WO pipe and 2 3/8" tbg fish, TOF @ 7000'. TIH w/3 3/4" shoe jt, WO pipe jars 6jts of 3 1/8" DC's and 40jts 2 3/8" tbg. 7/24/06 TIH w/2 3/8" tbg and WO pipe to 6900'. Circulate hole w/airmist. RD swivel. Kill tbg. TOH w/2 3/8" tbg till WO shoe @ 2100', in 7" csg. 7/26/06 TIH w/2 3/8" tbg. TOH above perfs w/tbg and BHA. 7/27/06 TIH w/2 3/8" tbg and 3 3/4" WO pipe to 6900'. RU swivel break circulation w/air mist. Circulate hole and C/O from 7000' to 7090'. Recovering heavy sand. TOH w/2 3/8" tbg. TIH w/2 3/8" tbg and SN to 5000' tie back onto lines. 7/28/06 TIH w/2 3/8" tbg to 7000'. RU swivel Circulate hole and C/O w/ air mist. Recovering sand. Pull tbg up. LD 1jt tbg. 7/29/06 Circulate hole and C/O w/air mist. Pump 10bbls 2% KCL, unload hole w/ air mist. Recovered sand. Pumped 15bbls 2% KCL H2), unload hole w/air mist. Recovered light sand. 7/30/06 Check psi tbg @180# and csg @290#. Open 2" line, blow well down. Natural flow black for 2hrs. Unload hole w/air mist. Recovered blackwater. Cleaned up to trace sand. Recovered trace sand. Increase water to 15BWPH, run 4 sweeps of 3bbls 2% KCL water. Recovering no sand. Clean up to no sand. Pump 15bbls 2% KCL water. Unload hole. Recovered light sand. 7/31/06 Tbg @180# and csg @ 250#. LD 6jts 2 3/8" tbg, tie back on 2 lines. TOH w/2 3/8" tbg. LD BHA. TIH w/3 3/4" WO pipe, jars, 6jts 3 1/8" DC's, on 2 3/8" tbg to 7000'. RU swivel, unload hole w/air mist. C/Ow/air mist from 7000' to 7090' Circulate hole. LD 4 jts 2 3/8" tbg. RD swivel, pull 2 3/8" tbg above perfs. 8/1/06 TIH w/2 3/8" tbg and 3 3/4" WO pipe, tag no fill. Pull tbg up, tie back 2 lines. TOH w/2 3/8" tbg, LD 3 3/4" WO shoe. TIH w/ baker outside cutter, 3jts 3 3/4" WO pipe, 6jts 3 1/8" DC's XO and 2 3/8" tbg to 6990'. Tie back 4 lines. RU swivel. PU 2 3/8" tbg to get over fish, cut tbg @ 7100'. LD 4jts 2 3/8" tbg. RD swivel. Tie 2 lines back. TOH w/2 3/8" tbg. STD back 6 3 1/8" DC's. TOH w/ 2 3/8" tbg fish. TIH w/ 3 3/4" WO shoe 90' WO pipe, jars 6jts 3 1/8" DC's on 2 3/8" tbg to 4000'. 8/2/06 TIH w/2 3/8" tbg to 7100'. RU swivel, break circulation w/air mist. Circulate and C/O w/air mist. C/O From 7098' to 7138'. Milling sand, scale, and blades off outside sutter. Circulate hole. RD swivel. LD 3jts 2 3/8" tbg. Pull tbg above perfs. 8/3/06 TOH w/2 3/8" tbg XO 6jts 3 1/8" DC's baker jars XO 90' of 3 3/4" WO pipe LD 3 7/8" washover shoe. TIH w/new WO shoe 90' 3 3/4" WO pipe XO baker jars 6jts 3 1/8" DC's XO and 7100' of 2 3/8" tbg. RU swivel break circulation w/air mist. C/O w/air mist to 7098' to 7150'. Mill shoe. 12'-13' of new hole 7138' to 7150'. Circulate hole. RD swivel. TOH w/ 2 3/8" tbg stand back DC's jars and WO pipe change out washover shoe. TIH w/new 3 7/8" WO shoe 90' 3 3/4" WO pipe XO baker jars 6jts 3 1/8" DC's XO and 2000' of 2 3/8" tbg. 8/4/06 TIH w/2 3/8" tbg and BHA to 7100'. RU swivel, break circulation. Circulate hole. C/O from TOF @ 7098' to 7150'. Mill and clean out from 7150' to 7162'. Circulate sand from 7162' to 7186'. Mill and C/O from 7186' to 7188'. Circulate hole. RD swivel. TOH w/2 3/8" tbg XO 6jts 3 1/8" DC's baker jars XO 90' WO pipe LD 3 7/8" WO shoe. TIH w/new 3 7/8" washover shoe, BHA and 4000' of 2 3/8" tbg. 8/5/06 TIH w/2 3/8" tbg to 7100'. RU swivel. Break circulation w/air mist. Mill over and C/O over fish from 7098' to 7196'. Circulate clean. RD Swivel. TOH w/2 3/8" tbg, BHA and 3 7/8" washover millshoe. LD shoe. TIH w/baker outside cutter, 90' of 3 3/4" washover pipe XO float valve 6jts 3 1/8" DC's XO and 7100' of 2 3/8" tbg. RU swivel work over fish w/baker outside cutter, cut tbg @ 7190'. LD 2jts 2 3/8" tbg. RD swivel. TOH w/2 3/8" tbg XO jts 3 1/8" DC's XO 90' of 3 3/4" WO pipe LD tbg fish and baker outside cutter. 8/7/06 TIH w/ 3 7/8" WO shoe 90' of 3 3/4" WO pipe XO 6jts 3 1/8" DC's baker jars XO and 7190' of 2 3/8" tbg. RU swivel, break circulation w/air mist. C/O from TOF @ 7194' to 7290' w/air mist. Circulate hole. RD swivel. TOH w/2 3/8" tbg, fish tools. LD WO shoe. TIH w/baker outside cutter 3 3/4" WO pipe DC's and 2 3/8" tbg to 4000'. 8/8/06 TIH w/2 3/8" tbg to 7180'. RU swivel, work over fish w/baker outside cutter to 7290' cut tbg off @ 7284'. Pull up LD 4jts 2 3/8" tbg. RD swivel. TOH w/2 3/8" tbg XO 6jts 3 1/8" DC's XO 3 3/4" washover pipe. LD 2 3/8" tbg fish and baker outside cutter. TIH w/ 3 7/8" washover shoe, 90' of 3 3/4" washover pipe XO baker jars 6jts 3 1/8" DC's and 4000' of 2 3/8" tbg. 8/9/06 TIH w/2 3/8" tbg to TOF @ 7284'. RU swivel, break circulation w/air mist. C/O air mist from TOF @ 7284' to 7370'. Circulate hole. LD 4jts 2 3/8" tbg. RD swivel. Pull tbg above perfs. 8/11/06 TIH w/2 3/8" tbg to TOF @7284'. RU swivel, break circulation w/air mist. C/O w/air mist from 7284' to 7370'. Mill and C/O from 7370' to 7415'. PBTD @ 7432'. Circulate hole. RD swivel. TOH w/2 3/8" tbg 6jts 3 1/8" DC's jars. LD 3 3/4" washover pipe and shoe. TIH w/baker 3 7/8" overshot jars 6 3 1/8" DC's and 2 3/8" tbg to TOF @ 7284'. Latch onto 2 3/8" tbg fish. TOH w/2 3/8" tbg. LD DC's jars and fish tools and fish. 8/10/06 Rig repair. 8/14/06 TIH w/3 3/4" bit, on 2 3/8" tbg to 7150'. RU swivel. Unload hole w/air mist. PU. RIH w/2 3/8" tbg. Tag fill @ 7400'. Circulate hole. C/O w/air mist from 7400' to 7415'. PBTD @ 7432'. C/O TD @ 7415'. LD 2jts 2 3/8" tbg. RD swivel. Pull tbg to 7170'. Spot 150gal 15% HCL acid across perfs 7168'-7392'. Flush w/3bbls 2% KCL H2O. TOH w/2 3/8" tbg to 4340'. Spot 450gal 15% HCL acid across perfs 4340'-5513'. Flush w/11bbls 2% KCL H2O. TIH w/2 3/8" tbg to PBTD @ 7415'. Tag no fill. Pull to top perfs @ 7168'. Unload hole w/air mist. Blow and clean well. Unload acid water. Recovering sand. 8/15/06 TIH w/2 3/8" tbg from 7168' to PBTD @ 7415', tag no fill. TOH w/2 3/8" tbg. LD bit sub and 3 3/4" bit. TIH w/2 3/8" BHA and 2 3/8" tbg. Broach and test tbg in hole. Fish 2" standing valve. TOH w/2 3/8" tbg. Recovering standing valve. TIH w/BHA and 2 3/8" tbg. Tag for fill, no fill @ 7415'. Pull tbg up. Land tbg @ 7367'. Set tbg tongs back. ND BOP. NU tree. RD flowline. Circulate hole. Pump 3bbls 2% KCL water. C/O. 8/16/06 Release rig @ 0900 hrs.