(ASUBUSE ZVVI)

FORM APPRO	VED
OMB No. 1004-	0135
Errainan Into 21	2010

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANGEMENT SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an Abandoned well. Use Form 3160-3 (APD) for such proposals.		OMB No. 1004-0135 Expires July 31, 2010			
			5. Lease Serial No. SF 078319-A		
		2	6. If Indian, Allottee or tribe	: Name	
SUBMIT'IN TRIPLIC	ATE - Other instructions on	reverse side	7. If Unit or CA/Agreement	eName and/or No.	
1. Type of Well Oil Well Gas	Well Cther	8	8. Well Name and No.	DEC 1 7 2006 © LS_artu wanayement	
2. Name of Operator			9. API Well No. Fa	mington Field Office	
BP America Production Compan	y Attn: Cherry Hlava			5-10279	
3a. Address P.O. Box 3092 Houston, TX	77253 3b. Phone No. (include are 281-366-		0. Field and Pool, or Explo Blanco M	ratory Area Iesaverde	
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) Sec 30 T 31 N R 09 W 1650' FSL 500' FWL			11. County or Parish, State San Juan, NM		
12. CHECK	APPROPRIATE BOX(ES) TO INDICAT	E NATURE OR NOTICE	REPORT, OR OTHER DA	TA	
TYPE OF SUBMISSION		TYPE OF AC	CTION		
Notice of Intent	Acidize Deepen		· —	Water shut-Off	
	Alter Casing Fracture	<u></u>		Well Integrity	
Subsequent Report				Other Cement Casing RCVD JAN 12'09 DIL CONS. DIV.	
Final Abandonment Notice	Convert to Injection Plug Ba	ck		Cist. 3	
Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.					
	John Hatch called BLM's (W CD) regarding cement job. Ve	•	<u> </u>	ent job. Also talked	
	pmp 2 bbls class G neat (5 sxsnt. Speared 4.5" & set slops to				
& 7" kept topping off between bbls. rig down Schlumberger	g up schlumberger pmp 4.33 bb en 10 3/4" and 7"; cement woul . Picked up over shot backed of MT between 10 3/4" and 7" 16	d drop where 3 gal ' f 48' of 4 1/2" csg la	would fill it in 45 min ay down 4 1/2" csg R	n pmp'd total of 27 D wire line nipple up	
12/6/08 NDWH: spear 7" nu	Il up to 100,000# in 25,000# in	crements cut off css	g head: weld on new	csg head and install	

new 7" slopsand pack off pick up 2 jts of 4 1/2" --- 10.5# csg screw into 4 1/2". set 4 1/2" slips 48' of new csg cut off 4 1/2" csg install well head rig up antelope test 4 1/2" to 500# lost 50# in 5 min. air in csg drain equipment rig down antelope.

12/8/08 set packer 10 ft in .test backside no leak. t.i.h 70 ft test good test. release pkr, t.i.h tag top of sand @110ft. pull up 3 ft test backside good test. TOH w /packer.t.i.h w/ 3 7/8 bit tag @ 110 ft. p.u swivel break circ w/wtr, circ sand out to top of bridge plug. TIH w/ret head tag top of b.p.clean, latch on to b.p. Release BP TOH.

12/9/08 TIH set 4 1/2 packer @120 test backside good test. test down tbg 500psi hold 15 min, good test. TOH lay down pkr. build 3" flow line. pick up ret head & string float, t.i.h w/ret head & string float.unload well @ 2000 ft. Release bp @5250' toh w pkr. Ishut down.

12/10/08 Clean out t.i.h w/ exp check, tag up @ 5909'ft.breck circ w/air & mist.unload well w/air. run 5 bbls sweeps every 30 min. Well making 3 to 4 cups of sand.cont to clean out. Pull above perfs Secure well shut down.

12/12/08 TIH from top of perfs.install 2 way check. Blow well dry. Rig up B & R slinkline, run broach to x.n @ 5912, run sinker bar through exp check . TOH w/sinker bar, run stop & spring. TOH rig down slinkline. Secure well shut down. RD MO location.

	reby certify that the foregoing is true and correct				
Ch	erry Hlava	Title	Regulatory Analy	/st	
Sign	nature Cherry Hlana	Date	12/16/08		
	THIS SPA	ACE FOR FEDERAL OR :	STATE OFFICE US	Ē	ACCEPTED FOR RECORD
Approve		Title		Date	JAN 0 9 2839
Certify	ns of approval, if any, are attached. Approval of this notice does that the applicant holds legal or equitable title to those rihich would entitle the applicant to conduct operations the	ights in the subject Office	NMOCD		PARIMHERON FIELD OFFICE